

Ramboll Hong Kong Limited 21st Floor, BEA Harbour View Centre 56 Gloucester Road Wan Chai, Hong Kong

Attn:

Mr. Raymond Dai - Independent Environmental Checker

Our Reference TC/GC/bw/T355861/02/ 02/L095

20/F AIA Kowloon Tower Landmark East 100 How Ming Street Kwun Tong Kowloon Hong Kong

T +852 2828 5757 F +852 2827 1823 mottmac.hk Contract No. HY/2013/04 Hong Kong-Zhuhai-Macao Bridge (HZMB) Hong Kong Boundary Crossing Facilities – Infrastructure Works Stage II (Southern Portion)

Quarterly EM&A Report for January 2018 to March 2018

8 June 2018 **By Email**

Dear Sir,

In accordance with Section 16.4 of the updated EM&A Manual for Hong Kong Boundary Crossing Facilities (Version 1.0) covering the captioned contract, we are pleased to submit the certified Quarterly EM&A Report for January 2018 to March 2018 for your verification.

Yours faithfully For MOTT MACDONALD HONG KONG LIMITED

Gary Chow

Environmental Team Leader

Encl.

CC.

AECOM – Mr. Alfred Cheng (By Email) China State Construction Engineering (Hong Kong) Ltd. – Mr. Xavier Lam / Mr. Billy Lao (By Email)



Ref.: HYDHZMBEEM00_0_6557L.18

11 June 2018

By Fax (3468 2076) and By Post

AECOM Asia Co. Ltd. The PRE's Office 5 Ying Hei Road, Tung Chung, Lantau Hong Kong

Attention: Mr. Alfred Cheng

Dear Sir,

Re: Agreement No. CE 48/2011 (EP)

Environmental Project Office for the

HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing Facilities,

and Tuen Mun-Chek Lap Kok Link - Investigation

Contract No. HY/2013/04 - HZMB HKBCF - Infrastructure Works Stage II

(Southern Portion)

Quarterly EM&A Report for January 2018 to March 2018

Reference is made to the Environmental Team's submission of the Quarterly Environmental Monitoring & Audit Report for January 2018 to March 218 certified by the ET Leader (ET's ref.: "TC/GC/bw/T355861/02/02/L095" dated 8 June 2018) and provided to us via e-mail on 8 June 2018.

We are pleased to inform you that we have no adverse comment on the captioned Quarterly EM&A Report for January 2018 to March 2018.

Thank you very much for your attention and please feel free to contact the undersigned should you require further information.

Yours faithfully, For and on behalf of Ramboll Hong Kong Limited

Raymond Dai

Konju

Independent Environmental Checker

c.c. HyD Mr. Vico Cheung (By Fax: 3188 6614) HyD Mr. Horace Hong (By Fax: 3188 6614) MMHK Mr. Gary Chow (By Fax: 2827 1823) CSCE Mr. Jason Chung (By Fax: 2459 4336)

Internal: DY, YH, TM, HW, ENPO Site

Q:\Projects\HYDHZMBEEM00\02_Proj_Mgt\02_Corr\HYDHZMBEEM00_0_6557L.18.doc



Contract No. HY/2013/04 HZMB HKBCF – Infrastructure Works Stage II (Southern Portion)

Quarterly EM&A Report for January 2018 to March 2018

April 2018

Contents

Ex	ecutiv	ve summary	1
1	Intr	oduction	4
	1.1	Basic Project Information	4
	1.2	Project Organisation	4
	1.3	Construction Programme	5
	1.4	Construction Works undertaken during the Reporting Period	5
2	EM	&A Requirements	6
	2.1	Summary of EM&A Requirements	6
	2.2	Monitoring Requirements	9
	2.3	Action and Limit Levels	9
	2.4	Event and Action Plans	11
	2.5	Mitigation Measures	11
3	Env	rironmental Monitoring and Audit	12
	3.1	Air Quality Monitoring Results	12
	3.2	Noise Monitoring Results	13
	3.3	Water Quality Monitoring Results	13
	3.4	Dolphin Monitoring Results	14
	3.5	Implementation of Environmental Measures	15
	3.6	Advice on the Solid and Liquid Waste Management Status	15
		3.6.1 Disposal of Marine Sediment Extracted from Bored Piling Works	16
	3.7	Environmental Licences and Permits	17
4		nmary of Exceedances, Complaints, Notification of Summons and cessful Prosecution	18
	4.1	Summary of Exceedance of the Environmental Quality Performance Limit	18
	4.2	Summary of Complaints, Notification of Summons and Successful Prosecution	18
5	Cor	nments, Recommendations and Conclusions	22
	5.1	Comments	22
	5.2	Recommendations	22
	5.3	Conclusions	22

Figures

- Figure 2.1: Location of Air Quality Monitoring Stations
- Figure 2.2: Location of Noise Monitoring Stations
- Figure 2.3: Location of Water Quality Monitoring Stations
- Figure 2.4: Impact Dolphins Monitoring Line Transect Layout Map

Appendices

- Appendix A. Location of Works Areas Appendix B. Project Organization for Environmental Works Appendix C. Construction Programme Appendix D. Event and Action Plan Appendix E. Implementation Schedule for Environmental Mitigation Measures (EMIS) Appendix F. Site Audit Findings and Corrective Actions
- Appendix G. Waste Flow Table
- Appendix H. Environmental Licences and Permits
- Appendix I. Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions

Tables

Table 1.1: Contact Information of Key Personnel	4
Table 2.1: Construction Dust and Noise Monitoring Locations	6
Table 2.2: Impact Water Quality Monitoring Stations	7
Table 2.3: Impact Dolphin Monitoring Line Transect Co-ordinates (Provided by AFCD)	8
Table 2.4: Action and Limit Levels for 1-hour TSP	9
Table 2.5: Action and Limit Levels for 24-hour TSP	ç
Table 2.6: Action and Limit Level for Construction Noise	ç
Table 2.7: Action and Limit Levels for Water Quality	10
Table 2.8: Action and Limit Levels for Chinese White Dolphin Monitoring - Approach to	
Define Action Level (AL) and Limit Level (LL)	10
Table 2.9: Derived Value of Action Level (AL) and Limit Level (LL) for Chinese White	
Dolphin Monitoring	10
Table 3.1: Action and Limit Level Exceedance for Air Quality	12
Table 3.2: Summary of Water Quality Exceedances during Reporting Period	13
Table 3.3: Action and Limit Level Exceedance for Dolphin Monitoring	15
Table 3.4: Summary of Marine Sediment disposed to Dumping Site via Contract No.	
HY/2013/03	17
Table 4.1: Summary of Environmental Complaints for the Reporting Month	19

Executive summary

This Quarterly Environmental Monitoring and Audit (EM&A) Report is prepared for Contract No. HY/2013/04 "Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Infrastructure Works Stage II (Southern Portion)" (hereafter referred to as "the Contract") for the Highways Department of Hong Kong Special Administrative Region (HKSAR). The Contract was awarded to China State Construction Engineering (Hong Kong) Limited (hereafter referred to as "the Contractor") and Mott MacDonald Hong Kong Limited (MMHK) was appointed as the Environmental Team (ET) by the Contractor.

The Contract is part of the "Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities" (HZMB HKBCF) Project which is a "Designated Project" under Schedule 2 of the Environmental Impact Assessment (EIA) Ordinance (Cap. 499) and for which an EIA Report (Register No. AEIAR-145/2009) was prepared and approved. The current Environmental Permit (EP) for HKBCF, namely No. EP-353/2009/K, was issued on 11 April 2016. These documents are available through the EIA Ordinance Register. Commencement of the Contract took place on 13 March 2015 and the construction works commenced on 13 July 2015.

Mott MacDonald Hong Kong Limited has been appointed by the Contractor to implement the Environmental Monitoring & Audit (EM&A) programme for the Contract in accordance with the Updated EM&A Manual for HKBCF (Version 1.0) and will be providing environmental team services for the Contract. This is the 11th Quarterly EM&A Report for the Contract which summaries findings of the EM&A works during the reporting period from 1 January 2018 to 31 March 2018 (the "reporting period").

Environmental Monitoring and Audit Progress

The EM&A programme was undertaken in accordance with the Updated EM&A Manual for HKBCF (Version 1.0). It should be noted that, for this Contract:

- The air quality monitoring works are covered by Contract No. HY/2011/03 "Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road Section between Scenic Hill and HKBCF" and Contract No. HY/2013/01 "Hong Kong-Zhuhai-Macao Bridge HKBCF Passenger Clearance Building"; and
- The noise, water quality and marine ecology monitoring works are covered by Contract No. HY/2013/01.

The ET of the Contract or another ET of the HZMB project is required to conduct impact air quality monitoring at AMS6 and AMS7/AMS7B, noise monitoring at NMS2 and NMS3B, water quality monitoring at the twenty-one stations and dolphin monitoring at the twenty-four transects as part of EM&A programme if these monitoring stations are no longer covered under Contract Nos. HY/2011/03 and HY/2013/01 (as the case may be). However, this is subject to ENPO's final decision on which ET should carry out the monitoring work at these stations.

The dates of site inspection during the reporting period are listed below:

• 3, 10, 15, 24 and 31 January, 9, 12, 22 and 28 February and 7, 14, 19 and 28 March 2018

Breaches of Action and Limit Levels

Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 is reported in the monthly EM&A report prepared by Contract No. HY/2011/03.

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7/AMS7B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

There was no Action and Limit Level exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

During January 2018, a total of three Action Level exceedances, consisting of one Action Level exceedance of SS for water quality and two Action Level exceedances of 24-hour TSP for air quality, were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During February 2018, a total of two Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During March 2018, a total of four Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and were referred to this Contract for follow-up. The ET of this Contract conducted investigations and the findings with respect to the Contract can be referred to the corresponding monthly EM&A Report prepared under Contract No. HY/2013/01.

Furthermore, Limit Level exceedances of impact dolphin monitoring were recorded by the Environmental Team of Contract No. HY/2013/01 during the period of December 2017 to February 2018 and investigated by the ET of Contract No. HY/2013/01.

Impact dolphin monitoring results at all transects during the reporting period are reported in the monthly EM&A Reports for Contract No. HY/2013/01.

Complaint Log

There was one new complaint received in relation to the environmental impact during the reporting period.

Log No.	Environmental Complaint Ref. No.	Date of Complaint Receipt	Description
008	ENPO-C0134	10 March 2018	Air Quality and Water Quality

The complaint was investigated by the ET of the Contract and the findings are presented in this report.

In addition, the investigation of the complaint received on 29 December 2017 by the ET of the Contract was carried over from the previous reporting period and completed during this reporting period, and the findings are also presented in this report.

Notifications of Summons and Successful Prosecutions

There were no notifications of summons or prosecutions received during this reporting period.

Reporting Changes

Air quality monitoring station AMS7 (Hong Kong SkyCity Marriott Hotel) was relocated to AMS7B (3RS Site Offices) with effect from 6 February 2018. A proposal for re-location of air quality monitoring station AMS7 was justified by the ET Leader for Contract No. HY/2013/01 on 22 January 2018, verified by the IEC on 24 January 2018 and submitted to EPD on 30 January 2018, and the air quality monitoring has been carrying out at the alternative air quality monitoring station AMS7B with EPD's consent since 6 February 2018.

The same baseline and Action/Limit Levels for air quality, as derived from the baseline monitoring data recorded at AMS7, apply with the abovementioned relocation to AMS7B.

1 Introduction

1.1 Basic Project Information

This Quarterly Environmental Monitoring and Audit (EM&A) Report is prepared for Contract No. HY/2013/04 "Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Infrastructure Works Stage II (Southern Portion)" (hereafter referred to as "the Contract") for the Highways Department of Hong Kong Special Administrative Region (HKSAR). The Contract was awarded to China State Construction Engineering (Hong Kong) Limited (hereafter referred to as "the Contractor") and Mott MacDonald Hong Kong Limited (MMHK) was appointed as the Environmental Team (ET) by the Contractor.

The Contract is part of the "Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities" (HZMB HKBCF) Project which is a "Designated Project" under Schedule 2 of the Environmental Impact Assessment (EIA) Ordinance (Cap. 499) and for which an EIA Report (Register No. AEIAR-145/2009) was prepared and approved. The current Environmental Permit (EP) for HKBCF, namely No. EP-353/2009/K, was issued on 11 April 2016. These documents are available through the EIA Ordinance Register. Commencement of the Contract took place on 13 March 2015 and the construction works commenced on 13 July 2015. The works areas of the contract are shown in **Appendix A**.

This is the 11th Quarterly EM&A Report summarising the findings of EM&A activities conducted under the Contract from 1 January 2018 to 31 March 2018 (the "reporting period").

1.2 Project Organisation

The organisation chart and lines of communication with respect to the on-site environmental management structure together with the contact information of the key personnel are shown in **Appendix B**. The key personnel contact names and numbers are summarized in **Table 1.1**.

Table 1.1: Contact Information of Key Personnel

Party	Position	Name	Telephone	Fax
Engineer or Engineer's Representative (AECOM Asia Co. Ltd.)	Chief Resident Engineer	Alfred Cheng	3958 7471	3468 2076
Environmental Project	Environmental Project Office Leader	Y H Hui	3465 2888	3465 2899
Office / Independent Environmental Checker (Ramboll Hong Kong Limited)	Independent Environmental Checker	Raymond Dai	3465 2888	3465 2899
	Environmental Site Supervisor	Ray Yan	5181 8165	3465 2899
Contractor (China State Construction	Site Agent	Jason Chung	9127 8369	2459 4336
Engineering (Hong Kong) Limited)	Environmental Officer	Xavier Lam	9493 2944	2459 4336
,		Billy Lao	6679 1950	2459 4336
Environmental Team (Mott MacDonald Hong Kong Limited)	Environmental Team Leader	Gary Chow	2828 5874	2827 1823
24-hour Complaint Hotline	-	-	5236 7111	-

1.3 Construction Programme

The Construction Works Programme of the Project is provided in **Appendix C**.

1.4 Construction Works undertaken during the Reporting Period

A summary of the construction activities undertaken during this reporting period is shown below:

- Box Culvert D: whole structure completed
- Box Culvert C: whole structure completed
- Pier Column: no works done
- Segment Erection: 203 no. completed
- Segment Delivery: delivery completed on 20 January 2018 (all segments stored at segment storage yard on HKBCF island site)
- Depressed road: whole structure completed
- No generation of excavated marine sediment

2 EM&A Requirements

2.1 Summary of EM&A Requirements

The EM&A programme was undertaken in accordance with the Updated EM&A Manual for HKBCF (Version 1.0). It should be noted that, for this Contract:

- The air quality monitoring works are covered by Contract No. HY/2011/03 "Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road Section between Scenic Hill and HKBCF" and Contract No. HY/2013/01 "Hong Kong-Zhuhai-Macao Bridge HKBCF Passenger Clearance Building"; and
- The noise monitoring works are covered by Contract No. HY/2013/01 "Hong Kong-Zhuhai-Macao Bridge HKBCF – Passenger Clearance Building".

Air quality monitoring station AMS7 (Hong Kong SkyCity Marriott Hotel) was relocated to AMS7B (3RS Site Offices) with effect from 6 February 2018. A proposal for re-location of air quality monitoring station AMS7 was justified by the ET Leader for Contract No. HY/2013/01 on 22 January 2018, verified by the IEC on 24 January 2018 and submitted to EPD on 30 January 2018, and the air quality monitoring has been carrying out at the alternative air quality monitoring station AMS7B with EPD's consent since 6 February 2018.

The ET of the Contract or another ET of the HZMB project is required to conduct impact air quality monitoring at AMS6 and AMS7/AMS7B and noise monitoring at NMS2 and NMS3B as part of EM&A programme if these monitoring stations are no longer covered under Contract Nos. HY/2011/03 and HY/2013/01 (as the case may be). However, this is subject to ENPO's final decision on which ET should carry out the monitoring work at these stations.

A summary of air and noise monitoring locations are presented in **Table 2.1**. The location of air quality and noise monitoring stations are shown as in **Figure 2.1** and **Figure 2.2**, respectively.

Table 2.1: Construction Dust and Noise Monitoring Locations

Environmental Monitoring	Identification No.	Location Description
Air Quality	AMS6 ⁽¹⁾	Dragonair/CNAC (Group) Building
	AMS7 ⁽¹⁾⁽²⁾	Hong Kong SkyCity Marriot Hotel
	AMS7B ⁽²⁾	3RS Site Offices
Noise	NMS2 ⁽³⁾	Seaview Crescent
	NMS3B ⁽³⁾⁽⁴⁾	AECOM PRE's Office

Remarks:

- (1) The ET of this Contract should conduct impact air quality monitoring at the AMS listed in the table as part of EM&A programme according to latest notification from ENPO when the monitoring station(s) is/are no longer covered by another ET of the HZMB project.
- (2) Air quality monitoring station AMS7 (Hong Kong SkyCity Marriott Hotel) was relocated to AMS7B (3RS Site Offices) with effect from 6 February 2018. A proposal for re-location of air quality monitoring station AMS7 was justified by the ET Leader for Contract No. HY/2013/01 on 22 January 2018, verified by the IEC on 24 January 2018 and submitted to EPD on 30 January 2018, and the air quality monitoring has been carrying out at the alternative air quality monitoring station AMS7B with EPD's consent since 6 February 2018.
- (3) The ET of this Contract should conduct impact noise monitoring at the NMS listed in the table as part of EM&A programme according to the latest notification from ENPO when the monitoring station(s) is/are no longer covered by another ET of the HZMB project.
- (4) The Action and Limit Levels for schools will be applied for this alternative monitoring location.

The water quality monitoring works for the Contract are covered by Contract No. HY/2013/01 "Hong Kong-Zhuhai-Macao Bridge HKBCF – Passenger Clearance Building". A total of twenty-one stations (nine Impact Stations, seven Sensitive Receiver Stations and five Control/Far Field Stations) are covered by the current EM&A programme. The ET of the Contract or another ET of the HZMB project is required to conduct water quality at these stations as part of EM&A programme if these monitoring stations are no longer covered under Contract No. HY/2013/01. However, this is subject to ENPO's final decision on which ET should carry out the monitoring work at these stations.

Table 2.2 and **Figure 2.3** show the locations of water quality monitoring stations.

Table 2.2: Impact Water Quality Monitoring Stations

Station	Description	East	North
IS5	Impact Station (Close to HKBCF construction site)	811579	817106
IS(Mf)6	Impact Station (Close to HKBCF construction site)	812101	817873
IS7	Impact Station (Close to HKBCF construction site)	812244	818777
IS8	Impact Station (Close to HKBCF construction site)	814251	818412
IS(Mf)9	Impact Station (Close to HKBCF construction site)	813273	818850
IS10(N)	Impact Station (Close to HKBCF construction site)	812942	820881
IS(Mf)11	Impact Station (Close to HKBCF construction site)	813562	820716
IS(Mf)16	Impact Station (Close to HKBCF construction site)	814328	819497
IS17	Impact Station (Close to HKBCF construction site)	814539	820391
SR3(N)	Sensitive receivers (San Tau SSSI)	810689	816591
SR4(N)	Sensitive receivers (Tai Ho)	814705	817859
SR5(N)	Sensitive receivers (Artificial Reef in NE Airport)	812569	821475
SR6	Sensitive receivers (Sha Chau and Lung Kwu Chau Marine Park)	805837	821818
SR7	Sensitive receivers (Tai Mo Do)	814293	821431
SR10A(N)	Sensitive receivers (Ma Wan FCZ) 1	823644	823484
SR10B(N2)	Sensitive receivers (Ma Wan FCZ) 2	823689	823159
CS(Mf)3(N)	Control Station	808814	822355
CS(Mf)5	Control Station	817990	821129
CS4	Control Station	810025	824004
CS6	Control Station	817028	823992

The dolphin monitoring works for the Contract are covered by Contract No. HY/2013/01 "Hong Kong-Zhuhai-Macao Bridge HKBCF – Passenger Clearance Building". The ET of the Contract or another ET of the HZMB project is required to conduct dolphin monitoring at the twenty-four transects as part of EM&A programme if these transects are no longer covered under Contract No. HY/2013/01. The dolphin monitoring should adopt line-transect vessel survey method. The survey follows pre-set and fixed transect lines in the two areas defined by AFCD as: Northeast Lantau survey area; and Northwest Lantau survey area.

Table 2.3 shows the co-ordinates for the transect lines and layout map.

The revised layout map showing the transect lines have been provided by AFCD and are shown in **Figure 2.4**.

Table 2.3: Impact Dolphin Monitoring Line Transect Co-ordinates (Provided by AFCD)

Transect	HK Grid	l System	Long Lat	in WGS84
	Х	Y	Long	Lat
1#	804671	815456	113.870287	22.277678
	804671	831404	113.869975	22.421696
2*^	805476	820800	113.877995	22.325951
	805476	826654	113.877882	22.378815
3^	806464	821150	114.030267	22.196697
	806464	822911	114.047344	22.196712
4^	807518	821500	114.033651	22.206219
	807518	829230	114.108618	22.206267
5^	808504	821850	114.037037	22.215126
	808504	828602	114.102523	22.215169
6^	809490	822150	114.039938	22.224033
	809490	825352	114.070995	22.224056
7 [#] ^	810499	822000	114.038474	22.233143
	810499	824613	114.063820	22.233163
8#	811508	821123	113.936539	22.328966
	811508	824254	113.936486	22.357241
9#	812516	821303	113.946320	22.330606
	812516	824254	113.946279	22.357255
10*	813525	820827	113.956112	22.326321
	813525	824657	113.956066	22.360908
11#	814556	818853	113.966155	22.304858
	814556	820992	113.966125	22.327820
12	815542	818807	113.975726	22.308109
12	815542	824882	113.975647	22.362962
13	816506	819480	113.985072	22.314192
	816506	824859	113.985005	22.362771
14	817537	820220	113.995070	22.320883
1-7	817537	824613	113.995018	22.360556
15	818568	820735	114.005071	22.325550
	818568	824433	114.005030	22.358947
16	819532	821420	114.014420	22.331747
	819532	824209	114.014390	22.356933
17	820451	822125	114.023333	22.338117
11	820451	823671	114.023337	22.352084
18	821504	822371	114.033556	22.340353
10	821504	823761	114.033544	22.352903
19	822513	823268	114.043340	22.348458
10	822513	824321	114.043331	22.357971
20	823477	823402	114.052695	22.349680
20	823477	824613	114.052686	22.360610
21				
21	805476	827081	113.877878	22.382668
22	805476	830562	113.877811	22.414103
22	806464	824033	113.887520	22.355164
	806464	829598	113.887416	22.405423

Transect	HK Grid	System	Long Lat i	in WGS84
23	814559	821739	113.966142	22.334574
	814559	824768	113.966101	22.361920
24^	805476	815900	113.979368	22.187721
	805476	819100	114.010398	22.187756

Remarks:

- (a) * Due to the presence of deployed silt curtain systems at the site boundaries of the Contract, some of the transect lines shown in Figure 2.4 could not be fully surveyed during the regular survey. Transect 10 is reduced from 6.4km to approximately 3.6km in length due to the HKBCF construction site. Therefore the total transect length for both NEL and NWL combined is reduced to approximately 108km.
- (b) # Coordinates for transect lines 1, 2, 7, 8, 9 and 11 have been updated in respect to the Proposal for Alteration of Transect Line for Dolphin Monitoring approved by EPD on 19 August 2015.
- (c) ^ The change of transect lines 2, 3, 4, 5, 6 and 7 and new transect line 24 were justified and verified by the ET Leader for Contract No. HY/2010/02 and the IEC respectively on 24 March 2017 and it was approved by EPD on 12 May 2017.

2.2 Monitoring Requirements

The monitoring requirements, monitoring equipment, monitoring parameters, frequency and duration, monitoring methodology, monitoring schedule, meteorological information are detailed in the quarterly EM&A reports prepared for Contract Nos. HY/2013/01 and HY/2011/03.

2.3 Action and Limit Levels

The Action and Limit Levels for 1-hr TSP and 24-hr TSP are provided in **Table 2.4** and **Table 2.5** respectively.

Table 2.4: Action and Limit Levels for 1-hour TSP

Monitoring Station	Action Level, μg/m³	Limit Level, μg/m³
AMS6 – Dragonair / SNAC (Group) Building (HKIA)	360	500
AMS7 – Hong Kong SkyCity Marriot Hotel /	370	500
AMS7B – 3RS Site Offices		

Table 2.5: Action and Limit Levels for 24-hour TSP

Monitoring Station	Action Level, μg/m ³	Limit Level, μg/m ³
AMS6 – Dragonair / SNAC (Group) Building (HKIA)	173	260
AMS7 – Hong Kong SkyCity Marriot Hotel /	183	260
AMS7B – 3RS Site Offices		

If exceedance(s) at these stations is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the quarterly EM&A report.

The Action and Limit Levels for construction noise are defined in **Table 2.6**.

Table 2.6: Action and Limit Level for Construction Noise

Parameter	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received	75 dB(A)*

Notes: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

^{*} Reduce to 70 dB(A) for schools and 65 dB(A) during school examination period.

If exceedance(s) at these stations is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the quarterly EM&A Report.

The Action and Limit Levels for water quality are provided in **Table 2.7**.

Table 2.7: Action and Limit Levels for Water Quality

Parameters	Action	Limit
DO in mg L ⁻¹	Surface and Middle	Surface and Middle
(Surface, Middle & Bottom)	5.0	4.2 (except 5 mg/L for FCZ)
	Bottom	Bottom
	4.7	3.6
SS in mg L ⁻¹ (depth-averaged) at all monitoring stations and control stations	23.5 and 120% of upstream control station's SS at the same tide of the same day*	34.4 and 130% of upstream control station's SS at the same tide of the same day and 10mg/L for WSD Seawater intakes*
Turbidity in NTU (depth-averaged)	27.5 and 120% of upstream control station's turbidity at the same tide of the same day*	47.0 and 130% of upstream control station's

Remarks:

Notes:

- 1. "depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
- 2. For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
- 3. For turbidity, SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits
- 4. All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.
- 5. The 1%-ile of baseline data for dissolved oxygen (surface and middle) and dissolved oxygen (bottom) are 4.2 mg/L and 3.6 mg/L respectively.

If exceedance(s) at these stations is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the monthly EM&A Report.

The Action and Limit Levels for Chinese White Dolphin Monitoring are provided in **Table 2.8** and **Table 2.9**, respectively.

Table 2.8: Action and Limit Levels for Chinese White Dolphin Monitoring - Approach to Define Action Level (AL) and Limit Level (LL)

	North Lantau Social Cluster		
	NEL	NWL	
Action Level	(STG < 70% of baseline) &	(STG < 70% of baseline) &	
	(ANI < 70% of baseline)	(ANI < 70% of baseline)	
Limit Level	[(STG < 40% of baseline) & (ANI < 40% of baseline)] AND		
[(STG < 40% of baseline) & (ANI < 40% of		& (ANI < 40% of baseline)]	

Table 2.9: Derived Value of Action Level (AL) and Limit Level (LL) for Chinese White Dolphin Monitoring

	North Lantau Social Cluster		
	NEL	NWL	
Action Level	(STG < 4.2) & (ANI < 15.5)	(STG < 6.9) & (ANI < 31.3)	
Limit Level	[(STG < 2.4) & (ANI <8.9)] AN	[(STG < 2.4) & (ANI <8.9)] AND [(STG < 3.9) & (ANI < 17.9)]	

Reference is made to EPD approval of adjustment of water quality assessment criteria issued and became effective on 18 February 2013.

If exceedance(s) at these survey transect(s) is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the monthly EM&A Report.

2.4 Event and Action Plans

The event and action plans for air quality, noise, water quality and dolphin monitoring are provided in **Appendix D**.

2.5 Mitigation Measures

Environmental mitigation measures for the contract were recommended in the approved EIA Report. **Appendix E** lists the recommended mitigation measures and the implementation status.

3 Environmental Monitoring and Audit

3.1 Air Quality Monitoring Results

The monitoring results for AMS6 and AMS7/AMS7B are reported in the monthly EM&A Reports (for January, February and March 2018) prepared for Contract Nos. HY/2011/03 and HY/2013/01 respectively.

Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 is reported in the monthly EM&A Reports (for January, February and March 2018) prepared by Contract No. HY/2011/03.

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7/AMS7B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

Two Action Level exceedances of 24-hour TSP level were recorded at stations AMS2 and AMS3B by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

Air quality exceedances recorded during the reporting period are summarised in Table 3.1.

Table 3.1: Action and Limit Level Exceedance for Air Quality

Date	Parameter	Station	Exceedance Recorded
17 Jan 2018	24-hour TSP	AMS2	Action Level
17 Jan 2018	24-hour TSP	AMS3B	Action Level

The details of the air quality exceedances can be referred to in the Monthly EM&A reports under Contract No. HY/2013/01.

Investigations into the exceedances were conducted and the findings are summarised below.

17 January 2018 (at AMS2 and AMS3B)

According to the Contractor of HY/2013/04, the major construction activities conducted under the Contract during the monitoring period included bridge segment delivery and erection, and construction of Box Culvert D.

As informed by the Contractor of HY/2013/04, watering of all main haul roads was provided in accordance with the HY/2013/04 site watering plan. This plan schedules water spraying for at least 8 times per day which follows the recommended mitigation measures in the EM&A Manual and Environmental Permit.

During ET's regular weekly site inspection on 15 January 2018 (between 14:00 and 15:00), one air quality observation regarding a dry haul road at Bridge D1 was made; subsequently the Contractor provided water spray for this location and the observation was closed. The remaining haul roads were observed to be watered and no fugitive dust generation from HY/2013/04 works was observed during this inspection.

During the next ET regular weekly site inspection on 24 January 2018 (between 14:00 and 15:00), there was no air quality observation associated with watering of site areas.

Photos relating to the site inspections on 15 January 2018 and 24 January 2018 are presented in ET's investigation report.

The wind data collected at the AMS3B wind station at Works Area WA2 during the monitoring period on 17 and 18 January 2018 shows that winds were still (averaged wind speed 0 m/s) during the monitoring period. This indicates that it was unlikely that the source of exceedances could be attributed to HY/2013/04.

Information available on EPD's Air Quality Health Index (AQHI) website shows that the short-term health risk of air pollution between 08:00 a.m. on 17 January 2018 and 08:00 a.m. on 18 January 2018 was low to serious in Tung Chung (with maximum AQHI of 10+ at 13:00-19:00 on 17 January 2018). This, combined with the still winds recorded at the wind station, indicate that the background air pollution was relatively high during part of the monitoring period and may have contributed to the high level of TSP recorded. The AQHI data is available online at http://www.aqhi.gov.hk/epd/ddata/html/history/2018/201801_Eng.csv.

It was concluded that the exceedances were not due to HY/2013/04.

3.2 Noise Monitoring Results

The monitoring results for NMS2 and NMS3B are reported in the monthly EM&A Reports (for January, February and March 2018) prepared for Contract No. HY/2013/01.

No noise exceedances were recorded at stations NMS2 and NMS3B by the ET of Contract No. HY/2013/01 during the reporting period.

3.3 Water Quality Monitoring Results

The monitoring results for the twenty-one monitoring stations are reported in the monthly EM&A Report (for January, February and March 2018) prepared for Contract No. HY/2013/01.

During January 2018, one Action Level exceedance of SS was recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During February 2018, two Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During March 2018, four Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and were referred to this Contract for follow-up. The ET of this Contract conducted investigations.

Water quality exceedances recorded during the reporting period are summarised in **Table 3.2**.

Table 3.2: Summary of Water Quality Exceedances during Reporting Period

Date	Parameter (Units)	Station	Depth	Exceedance Recorded during Mid-ebb Tide	Exceedance Recorded during Mid-flood Tide
31 Jan 2018	SS	SR6	Depth Average	Action Level	-
2 Feb 2018	SS	SR6	Depth Average	-	Action Level
		SR7	Depth Average	-	Action Level
2 Mar 2018	SS	SR6	Depth Average	-	Action Level
16 Mar 2018	SS	SR5(N)	Depth Average	-	Action Level
21 Mar 2018	SS	IS7	Depth Average	-	Action Level
30 Mar 2018	SS	SR5(N)	Depth Average	-	Action Level

The details of water quality exceedances can be made reference to the monthly EM&A reports under Contract No. HY/2013/01.

Investigations into these exceedances were conducted by the ET of this Contract. The findings for exceedances on 31 January 2018 and 2 February 2018 are summarised below, while the findings for exceedances on 2, 16, 21 and 30 March 2018 with respect to the Contract can be referred to the corresponding monthly EM&A Report prepared under Contract No. HY/2013/01.

31 January 2018

According to the Contractor of HY/2013/04, all marine-based segment deliveries were completed in December 2017 and no marine-based works were conducted under the contract on 31 January 2018. Furthermore, no discharge originating from any HY/2013/04 site works on 31 January 2018 was identified.

While SS exceedance was recorded at SR6, no exceedance was recorded at IS(Mf)9 which is the nearest monitoring location to HY/2013/04 loading and unloading point and the shoreline interfacing with open waters.

During ET's regular weekly site inspection on 31 January 2018, HY/2013/04 site shoreline interfacing with open waters was inspected between 14:25 and 15:00 (i.e. shortly after the recorded exceedance at SR6 during mid-ebb tide). There were no observations referring to water quality mitigation measures associated with that shoreline.

It was concluded that the exceedance was not due to HY/2013/04.

2 February 2018

According to the Contractor of HY/2013/04, all marine-based segment deliveries were completed in January 2018 and no marine-based works were conducted under the contract on 2 February 2018. Furthermore, no discharge originating from any HY/2013/04 site works on 2 February 2018 was identified.

While SS exceedance was recorded at SR6 and SR7, no exceedance was recorded at IS(Mf)9 which is the nearest monitoring location to HY/2013/04 loading and unloading point and the shoreline interfacing with open waters.

During ET's regular weekly site inspection on 31 January 2018, HY/2013/04 site shoreline interfacing with open waters was inspected between 14:25 and 15:00. There were no observations referring to water quality mitigation measures associated with that shoreline.

During ET's subsequent regular weekly site inspection on 9 February 2018, HY/2013/04 site shoreline interfacing with open waters was inspected between 14:25 and 14:50. There were no observations referring to water quality mitigation measures associated with that shoreline.

It was concluded that the exceedance was not due to HY/2013/04.

3.4 Dolphin Monitoring Results

The monitoring results for dolphin monitoring during the reporting periods are reported in the monthly EM&A Reports (for January, February and March 2018) prepared for Contract No. HY/2013/01.

Limit Level exceedance of impact dolphin monitoring was recorded by the Environmental Team of Contract No. HY/2013/01 during the period of December 2017 to February 2018 and investigated by the ET of Contract No. HY/2013/01.

Dolphin monitoring exceedances recorded are summarised in **Table 3.3**.

Table 3.3: Action and Limit Level Exceedance for Dolphin Monitoring

Period	Parameter	Area	Exceedance Recorded
Dec 2017 – Feb 2018	Ecology (Chinese White Dolphin Monitoring)	Northeast Lantau (NEL)	Limit Level
Dec 2017 – Feb 2018	Ecology (Chinese White Dolphin Monitoring)	Northwest Lantau (NWL)	Limit Level

The details of the dolphin monitoring exceedances can be referred to in the Monthly EM&A reports under Contract No. HY/2013/01.

3.5 Implementation of Environmental Measures

In response to the site audit findings, the Contractor carried out corrective actions. Details of site audit findings and the corrective actions during the reporting period are presented in **Appendix F**.

A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in **Appendix E**. Most of the necessary mitigation measures were implemented properly.

Implementation status of the Regular Marine Travel Route Plan (RMTRP) was checked by ET. Training of marine travel route for marine vessel operator was given to relevant staff and relevant records were kept properly. Marine traffic records which indicated the number of trips data for crane barge, flat top barge and tug boat on the implementation of RMTRP for December 2017 and January 2018 were checked by ET within the reporting period. Marine traffic records of December 2017 and January 2018 were provided by Contractor to ER, ETL and IEC/ENPO for checking within the months of January 2018 and March 2018 respectively. The implementation of marine traffic follows the Regular Marine Travel Route Plan with respect to ET's checking on the marine traffic records for the reporting period.

According to the Contractor of HY/2013/04, all marine-based segment deliveries were completed in January 2018 and no marine-based works were conducted under the contract during the reporting period.

Implementation status of the Dolphin Watching Plan (DWP) was checked by ET. Training of marine mammal observer (MMO) was given to relevant staff and relevant records were kept properly. Silt curtains were provided at each box culvert for marine works areas in accordance with the approved Dolphin Watching Plan. The silt curtains were inspected regularly by ET and Contractor and the implementation was found to be in working order.

3.6 Advice on the Solid and Liquid Waste Management Status

The Contractor registered as a chemical waste producer for the Contract. Sufficient numbers of receptacles were available for general refuse collection and sorting. As a practical means, the disposal operation is managed by a single HKBCF contractor who is also responsible for applying dumping permit and its subsequent extension applications from EPD. Contract No. HY/2013/03 has been assigned to coordinate and arrange for disposal of extracted marine sediment from this Contract.

There was no generation of excavated sediment for treatment during this reporting period. Any treatment of excavated marine sediment will be conducted using cement solidification / stabilization (Cement S/S) techniques and the treated sediment will be reused onsite for either backfilling or landscaping (e.g. berm material).

The summary of waste flow table is detailed in **Appendix G**.

The Contractor was reminded that chemical waste containers should be properly treated and stored temporarily in designated chemical waste storage area on site in accordance with the Code of Practice on the Packing, Labelling and Storage of Chemical Waste.

3.6.1 Disposal of Marine Sediment Extracted from Bored Piling Works

3.6.1.1 Background

After the acceptance of the review of the approved Sediment Quality Report (SQR) for this Project under EPD letter dated 19 August 2015, an approval to dispose the marine sediment extracted from bored piling for this Project was then approved under memo from Secretary, Marine Fill Committee of CEDD dated 20 August 2015 for the disposal of marine sediment extracted from bored piling works. The disposal sites allocated to this Project are the Mud Pit CMP2 of the Confined Marine Sediment Disposal Facility to the South of The Brothers (or at the East of Sha Chau). As advised by CEDD in the memo dated 19 February 2016, from 00:00 on 22 March 2016 onward, the disposal space at CMP2 of the South of The Brothers is closed and all disposal of contaminated sediment is to be carried out at CMP Vd to the East of Sha Chau (ESC).

As Contract No. HY/2013/01 has commenced treatment of the extracted marine sediment, treatment will continue and the treated marine sediment will be re-used within the HKBCF Island. On the other hand, Contract Nos. HY/2013/02, HY/2013/03 and HY/2013/04 have not commenced the treatment of extracted marine sediment. Therefore the marine sediment extracted from these three Contracts will be disposed to the allocated disposal sites directly without treatment. As a practical means, the disposal operation is managed by one contractor who is also responsible for applying dumping permit and its subsequent extension applications from EPD. Contract No. HY/2013/03 has been assigned to coordinate and arrange for disposal of extracted marine sediment from all three Contracts.

The SQR was further reviewed in mid-2016. EPD has no comment to extend the validity of the SQR to August 2017 under letter dated 18 August 2016.

Based on the actual piling operation, the estimated quantity of marine sediment to be extracted has been revised from 85,000 m³ to 126,000 m³ (bulk volume). EPD has no comments on the request as in the letter dated 20 October 2016. The Secretary of Marine Fill Committee, CEDD approved the increasing quantity in the memo dated 10 November 2016.

During the course of reviewing the SQR, it was noted that the contamination level of the marine sediment extracted from the inner part of the HKBCF Island was not identified during the previous sampling and testing. As requested by EPD, sampling and testing are required. The Sediment Sampling and Testing Proposal (SSTP) for the inner area of the HKBCF Island was approved by EPD on 2 June 2016.

As in the agreed SSTP for the inner area of the HKBCF Island, samples were taken from the seventeen batches of stockpiled marine sediments and from five boreholes each in one of the five sampling grids. After conducting chemical tests on samples, six batches of stockpiled samples under Contract No. HY/2013/03 and all eight batches of stockpiled samples under Contract No. HY/20013/04 are classified as Category L sediment. The Secretary of Marine Fill Committee of CEDD allocated disposal sites under memo dated 24 October 2016 and dated 22 November 2016 for disposal of a total of 9,500 m³ in-situ volume of Category L sediment (using a bulk factor of 1.3). The Category L sediment was disposed in December 2016.

One sample from the batch of stockpiled marine sediment under Contract No. HY/2013/03 and samples from all five sampling grids had contamination levels exceeding the Lower Chemical Exceedance Levels (LCEL) and biological screenings were carried out. All samples passed the biological screenings and are classified as Category Mp sediment and to be disposed off site using Type II confined marine disposal method the same method used for marine sediment extracted from other part of the HKBCF Island.

3.6.1.2 Dumping Arrangements

The barge for disposal of marine sediment will morn at the temporary loading and unloading at the east shore of the HKBCF Island, which has been being used by reclamation contractor (Contract No. HY/2010/02) for reclamation activities. In terms of safety consideration, each dumping date will be allocated to one Contract. The quantity of marine sediment disposed on the date is from one Contract.

During dumping, each Contractor is responsible for transporting the marine sediment from his site area to the barge. The estimated quantity of marine sediment in each truck is confirmed by Resident Site Staff of each Contract. The trip tickets for transportation and disposal of marine sediment are collected and checked. Contract No. HY/2013/03 as the dumping permit holder is responsible for reporting to EPD the quantity disposed of as the condition stipulated in the dumping permit.

3.6.1.3 Reporting

AECOM has confirmed that the disposal of excavated marine sediments to allocated dumping site via Contract No. HY/2013/03 has been completed with the last batch disposal on 30 August 2017. The total quantities disposed are presented in the following table (**Table 3.4**):

Table 3.4: Summary of Marine Sediment disposed to Dumping Site via Contract No. HY/2013/03

Month/	/Year	Type of Sediment and Quantity Disposed (m ³)		
		Cat. L (in Type I)	Type II	
' <u>-</u>	Total =	3,570	39,814	
Note:	For monthly breakdown of thes	e quantities, please refer to the waste fl	ow table in Appendix G .	

3.7 Environmental Licences and Permits

The valid environmental licences and permits during the reporting period are summarized in **Appendix H**.

4 Summary of Exceedances, Complaints, Notification of Summons and Successful Prosecution

4.1 Summary of Exceedance of the Environmental Quality Performance Limit

Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 is reported in the monthly EM&A Reports (for January, February and March 2018) prepared by Contract No. HY/2011/03.

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7/AMS7B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

There was no Action and Limit Level exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

During January 2018, a total of three Action Level exceedances, consisting of one Action Level exceedance of SS for water quality and two Action Level exceedances of 24-hour TSP for air quality, were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During February 2018, a total of two Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During March 2018, a total of four Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and were referred to this Contract for follow-up. The ET of this Contract conducted investigations and the findings with respect to the Contract can be referred to the corresponding monthly EM&A Report prepared under Contract No. HY/2013/01.

Furthermore, Limit Level exceedances of impact dolphin monitoring were recorded by the Environmental Team of Contract No. HY/2013/01 during the period of December 2017 to February 2018 and investigated by the ET of Contract No. HY/2013/01.

Impact dolphin monitoring results at all transects during the reporting period are reported in the monthly EM&A Reports prepared for Contract No. HY/2013/01.

4.2 Summary of Complaints, Notification of Summons and Successful Prosecution

There was one new complaint received in relation to the environmental impact during the reporting period. Also, the investigation of the complaint received on 29 December 2017 by the ET of the Contract was carried over from the previous reporting period and completed during this reporting period. The summary of environmental complaints is presented in **Table 4.1**.

The details of cumulative statistics of Environmental Complaints are provided in Appendix H.

Table 4.1: Summary of Environmental Complaints for the Reporting Month

Log No.	Environmental Complaint Ref. No.	Date of Complaint Receipt	Description
008	ENPO-C0134	10 March 2018	Air Quality and Water Quality

Environmental Complaint Ref. No. ENPO-C0134

The complaint was about the regular absence of site staff at the wheel wash facility to clean the wheels of vehicles leaving HZMB BCF Island site after 19:00. A video of the area concerned was provided by the complainant.

The complaint was investigated by the ET of the Contract.

The relevant mitigation measures for washing of site vehicles for the HZMB BCF Island site, as required in the EMIS and statutory requirements in the Air Pollution Control (Construction Dust) Regulations and other applicable environmental legislation, are consolidated as follows:

- Immediately before leaving a construction site, every vehicle shall be washed to remove any
 dusty materials from its body and wheels and to ensure that no earth, mud or debris is
 deposited by them on roads.
- Vehicle washing facilities with high pressure water jet should be provided at every
 discernible or designated vehicle exit point. The area where vehicle washing takes place
 and the road section between the washing facilities and the exit point should be paved with
 concrete, bituminous materials or hardcores.

The wheel washing facility at the HY/2013/04 site boundary entrance/exit for vehicles leaving HY/2013/04 site in the direction of HZMB BCF Island site exit was implemented by the Contractor on 27 January 2018. A plan of the wheel washing facility is presented in Attachment 1 of ET's investigation report. As informed by the Contractor of HY/2013/04, wheel washing facility was staffed by site workers with water hose between 07:00 and 19:00 only on each working day.

During ET's regular weekly site inspection on 14 March 2018 (between 14:00 and 15:00), the haul road in the vicinity of the wheel wash facility was observed to be watered and no fugitive dust generation from HY/2013/04 works was observed. The additional signage mentioned above was also provided. Photos of implementation of these measures at the wheel wash facility are presented in Attachment 2 of ET's investigation report. There were no observations referring to air quality mitigation measures associated with watering of site areas.

The Contractor was reminded to properly implement all necessary air and water quality mitigation measures identified in the EM&A Manual. All site vehicles leaving HY/2013/04 site should be properly washed at the wheel washing facilities at HY/2013/04 site exit to prevent muddy trail on the access roads and public roads thereafter.

The Contractor has agreed to provide 24 hours site workers with manual water spray at the wheel washing facility on each working day to ensure all vehicles have been washed before leaving the site.

Photos showing implementation of the wheel washing facility at HY/2013/04 site exit on 14 March 2018 are presented in Attachment 2 of ET's investigation report.

Environmental Complaint Ref. No. ENPO-C0129

The complaint, received on 29 December 2017, was about effectiveness of mitigation measures for dust and mud on roads related to HZMB BCF Island site works.

The complaint investigation by the ET of the Contract was carried over from the previous reporting period and completed during this reporting period.

This investigation reviewed the effectiveness of mitigation measures implemented by the Contractor of HY/2013/04 to control any potential dust or mud nuisance attributed to vehicles leaving the HY/2013/04 site boundary.

The relevant mitigation measures for access roads for the HZMB BCF Island site, as required in the EMIS and statutory requirements in the Air Pollution Control (Construction Dust)
Regulations and other applicable environmental legislation, are consolidated as follows:

- Immediately before leaving a construction site, every vehicle shall be washed to remove any
 dusty materials from its body and wheels and to ensure that no earth, mud or debris is
 deposited by them on roads.
- Vehicle washing facilities with high pressure water jet should be provided at every
 discernible or designated vehicle exit point. The area where vehicle washing takes place
 and the road section between the washing facilities and the exit point should be paved with
 concrete, bituminous materials or hardcores.
- Every main haul road shall be paved with concrete, bituminous materials, hardcores or metal plates, and kept clear of dusty materials, or sprayed with water or a dust suppression chemical so as to maintain the entire road surface wet.
- The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials.
- The Contractor should undertake proper watering on all exposed spoil (with at least 8 times per day) throughout the construction phase.

In early January 2018 RE had requested the Contractor of HY/2013/04 to provide a wheel washing facility at the HY/2013/04 site boundary exit for vehicles to adjacent HKBCF contract site. A map showing the general location of the HKBCF contract sites is presented in Attachment 1 of ET's investigation report.

As informed by the Contractor of HY/2013/04, water spray was provided by site workers as an interim measure at the HY/2013/04 site boundary entrance/exit for vehicles leaving HY/2013/04 site in the direction of HZMB BCF Island site exit. The wheel washing facility was subsequently completed and implemented on 27 January 2018. Contractor's photos showing the operation of the wheel wash facility on that day are presented in Attachment 2 of ET's investigation report.

Also, watering of all main haul roads was provided in accordance with the HY/2013/04 site watering plan (as presented in Attachment 3 of ET's investigation report). This plan schedules water spraying for at least 8 times per day which follows the recommended mitigation measures in the EM&A Manual and Environmental Permit.

Before operation of the wheel wash facility, ET conducted regular weekly site inspections on 10, 15 and 24 January 2018 with extra focus on the implementation status of all air quality and water quality mitigation measures including haul roads and washing of vehicles leaving HY/2013/04 site. The following observations were made:

- 10 January 2018 (14:00-15:00): Water spray was provided for haul roads in the HY/2013/04 site area. Water spray from two hoses was provided by the Contractor to wash the wheels of vehicles leaving HY/2013/04 and entering HY/2013/02 site towards HZMB BCF Island site exit. No specific observations referring to air or water quality mitigation measures associated with wheel washing facility.
- 15 January 2018 (14:30-15:30): Water spray was provided for haul roads in the HY/2013/04 site area. Water spray from two hoses was provided by the Contractor to wash the wheels of vehicles leaving HY/2013/04 and entering HY/2013/02 site towards HZMB BCF Island site exit. An air quality observation regarding effectiveness of water spray was made; subsequently the Contractor displayed a temporary stop sign to ensure vehicles were being properly washed at this location and the observation was closed. Also, an air quality observation regarding dry haul road at Bridge D1 was observed; subsequently, the Contractor provide water spray.
- 24 January 2018 (14:00-15:00): Water spray was provided for haul roads in the HY/2013/04 site area. Water spray from two hoses was provided by the Contractor to wash the wheels of vehicles leaving HY/2013/04 and entering HY/2013/02 site towards HZMB BCF Island site exit. No specific observations referring to air or water quality mitigation measures associated with wheel washing facility.

Following commencement of operation of the wheel wash facility, ET conducted regular weekly site inspections on 31 January, 9 and 12 February 2018 with extra focus on the implementation status of all air quality and water quality mitigation measures including haul roads and washing of vehicles leaving HY/2013/04 site. The following observations were made:

- 31 January 2018 (14:30-15:00): Water spray provided for haul roads in the HY/2013/04 site area. Wheel wash facility was in operation. No specific observations referring to air or water quality mitigation measures associated with wheel washing facility.
- 9 February 2018 (14:00-15:00): Water spray was provided for haul roads in the HY/2013/04 site area. Wheel wash facility was in operation. No specific observation referring to air or water quality mitigation measures associated with wheel washing facility and access roads was observed.
- 12 February 2018 (14:00-15:00): Wheel wash facility was in operation; no specific observation referring to air or water quality mitigation measures associated with the wheel wash facility was observed. Water spray was provided for haul roads in the HY/2013/04 site area. An air quality observation regarding fugitive dust generated when vehicles passed through the haul road between wheel washing facilities and Box Culvert C was observed. The Contractor was reminded to provide watering on haul road frequently.

Relevant photos for each abovementioned site inspection are presented in Attachment 4 of ET's investigation report.

Notifications of Summons and Successful Prosecutions

Statistics on notifications of summons and successful prosecutions are summarized in **Appendix I**.

5 Comments, Recommendations and Conclusions

5.1 Comments

According to the environmental site inspections undertaken during the reporting period, the following recommendations were provided:

- The Contractor was reminded to clear the general refuse and C&D waste as soon as possible.
- The Contractor was reminded to provide sufficient water spray for haul road.
- The Contractor was reminded to display a sign of temporary stop in the vicinity of wheel washing facilities.
- The Contractor was reminded to clear the general refuse inside the gully on the bridge deck.
- The Contractor was reminded to sort the general refuse and C&D materials properly.
- The Contractor was reminded to provide chemical container with drip tray.
- The Contractor was reminded to display the appropriate NRMM label affixed on the generator.
- The Contractor was reminded to maintain construction plant/equipment/vehicles in good condition.
- The Contractor was reminded to clear the stagnant water as soon as possible.
- The Contractor was reminded to operate the Wetsep as soon as possible.
- The Contractor was reminded to clear the sand as soon as possible to avoid site runoff entering storm drainage channel.

A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in **Appendix E**. Most of the necessary mitigation measures were implemented properly.

5.2 Recommendations

With implementation of the recommended environmental mitigation measures, the contract's environmental impacts were considered environmentally acceptable. The weekly environmental site inspections ensured that all the environmental mitigation measures recommended were effectively implemented.

The recommended environmental mitigation measures, as included in the EM&A programme, effectively minimize the potential environmental impacts from the contract. Also, the EM&A programme effectively monitored the environmental impacts from the construction activities and ensure the proper implementation of mitigation measures. No particular recommendation was advised for the improvement of the programme.

5.3 Conclusions

Commencement of the Contract took place on 13 March 2015 and the construction works of the Contract commenced on 13 July 2015. This is the 11th Quarterly EM&A Report summarising the

findings of EM&A activities conducted under the Contract from 1 January 2018 to 31 March 2018.

Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 shall be referred to the monthly EM&A Reports (for January, February and March 2018) prepared by Contract No. HY/2011/03.

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7/AMS7B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

There was no Action and Limit Level exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2013/01 during the reporting period.

During January 2018, a total of three Action Level exceedances, consisting of one Action Level exceedance of SS for water quality and two Action Level exceedances of 24-hour TSP for air quality, were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During February 2018, a total of two Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and investigated by the ET of the Contract.

During March 2018, a total of four Action Level exceedances of SS were recorded by the Environmental Team of Contract No. HY/2013/01 during the reporting period and were referred to this Contract for follow-up. The ET of this Contract conducted investigations and the findings with respect to the Contract can be referred to the corresponding monthly EM&A Report prepared under Contract No. HY/2013/01.

Furthermore, Limit Level exceedances of impact dolphin monitoring were recorded by the Environmental Team of Contract No. HY/2013/01 during the period of December 2017 to February 2018 and investigated by the ET of Contract No. HY/2013/01.

Impact dolphin monitoring results at all transects during the reporting period are reported in the monthly EM&A Reports (for January, February and March 2018) prepared for Contract No. HY/2013/01.

Environmental site inspection was carried out on 3, 10, 15, 24 and 31 January, 9, 12, 22 and 28 February and 7, 14, 19 and 28 March 2018. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site inspections.

There was one new complaint received in relation to the environmental impact during the reporting period. Also, the investigation of the complaint received on 29 December 2017 by the ET of the Contract was carried over from the previous reporting period and completed during this reporting period.

There were no notifications of summons or prosecutions received during the reporting period.

Figures

Figure 2.1 Location of Air Quality Monitoring Stations

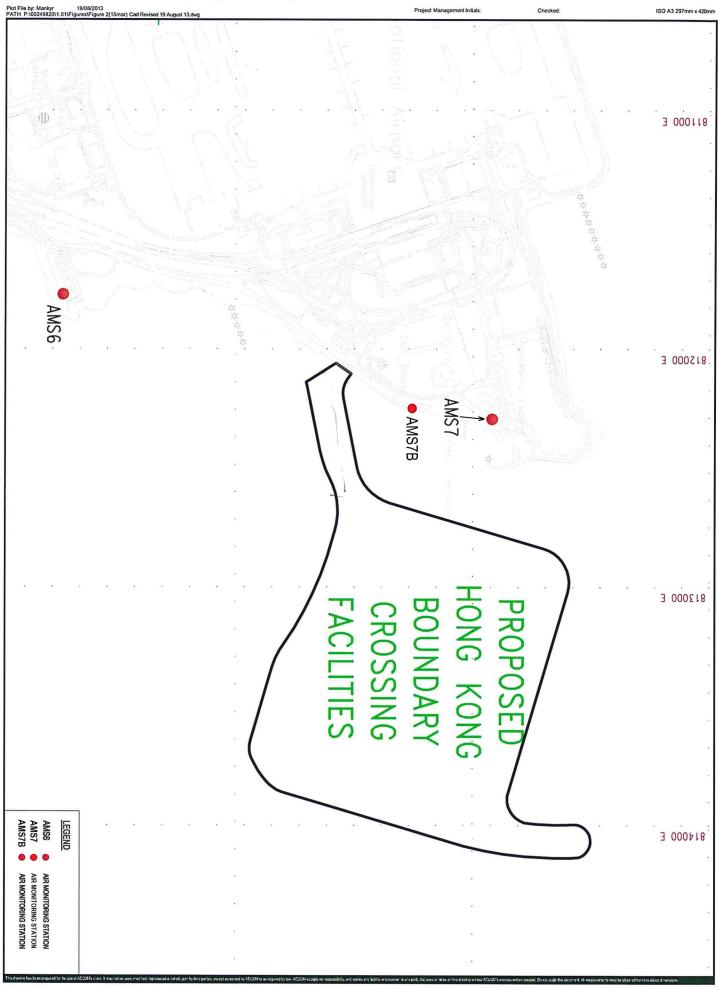


Figure 2.2 **Location of Noise Quality Monitoring Stations**

Project Management Initials: ISO A3 297mm x 420mm Plot File by: LAMMCL PATH P:#60249820#1.01#CAD#Orawing#Figure#Figure 2(15mor).dwg 817000 818000 819000 811000 E 812000 E NMS2- Sed View Cresent LEGEND NMS2 and 813000 E NMS3B - AECOM PRE's Office NMS3B NOISE MONITORING STATIONS 00418 AGREEMENT NO. CE 13/2010(EE) HZMB HONG KONG BOUNDARY CRESSING FACILITIES
(SUPERSTRUCTURE & INFRASTRUCTURE) —
DESIGN AND CONSTRUCTION
Project No.: — Date: JUL 2013 **AECOM** AIR QUALITY AND NOISE MONITORING STATIONS

Figure 5-1




Station	East	North
IS5	811579	817106
IS(Mf)6	812101	817873
IS7	812244	818777
IS8	814251	818412
IS(Mf)9	813273	818850
IS10(N)	812942	820881
IS(Mf)11	813562	820716
IS(Mf)16	814328	819497
IS17	814539	820391
SR3(N)	810689	816591
SR4(N)	814705	817859
SR5(N)	812569	821475
SR6	805837	821818
SR7	814293	821431
SR10A(N)	823644	823484
SR10B(N2)	823689	823159
CS(Mf)3(N)	808814	822355
CS(Mf)5	817990	821129
CS4	810025	824004
CS6	817028	823992
CSA	818103	823064

FIGURE 2.3 — LOCATION OF WATER QUALITY MONITORING STATIONS





CONTROL / FAR FIELD STATIONS


SENSITIVE RECEIVERS STATIONS

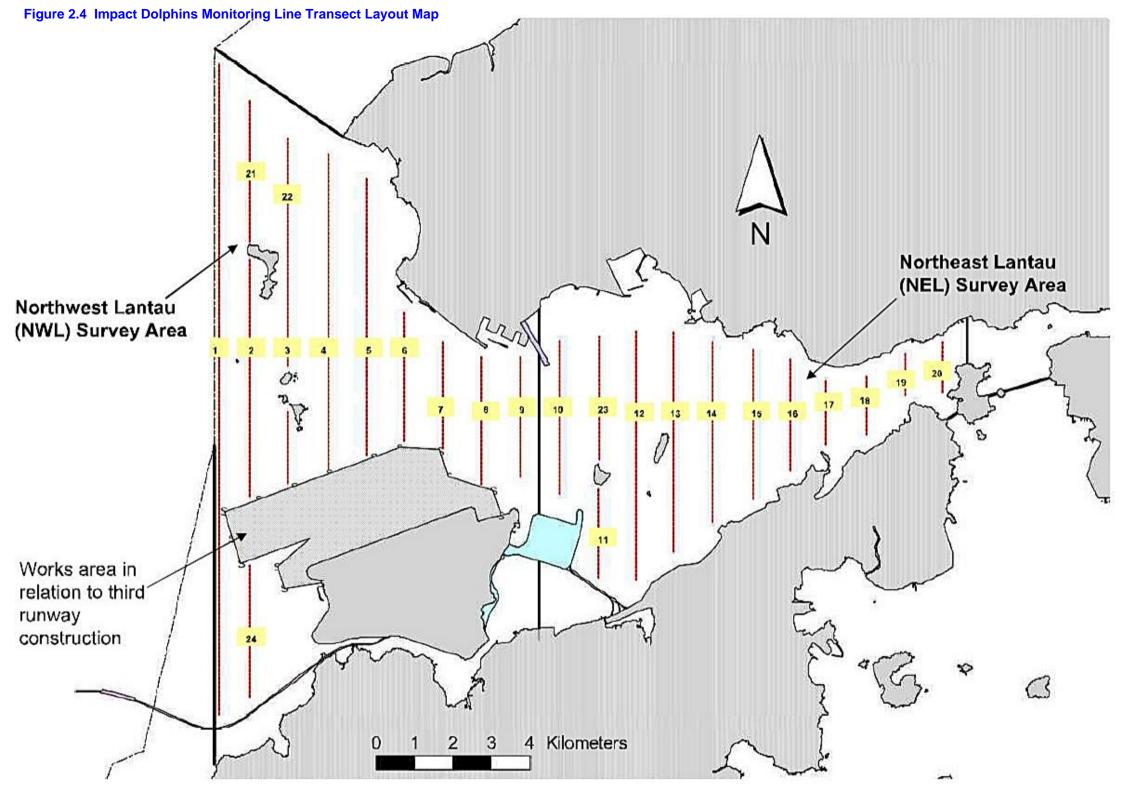

Appendix A. Location of Works Areas

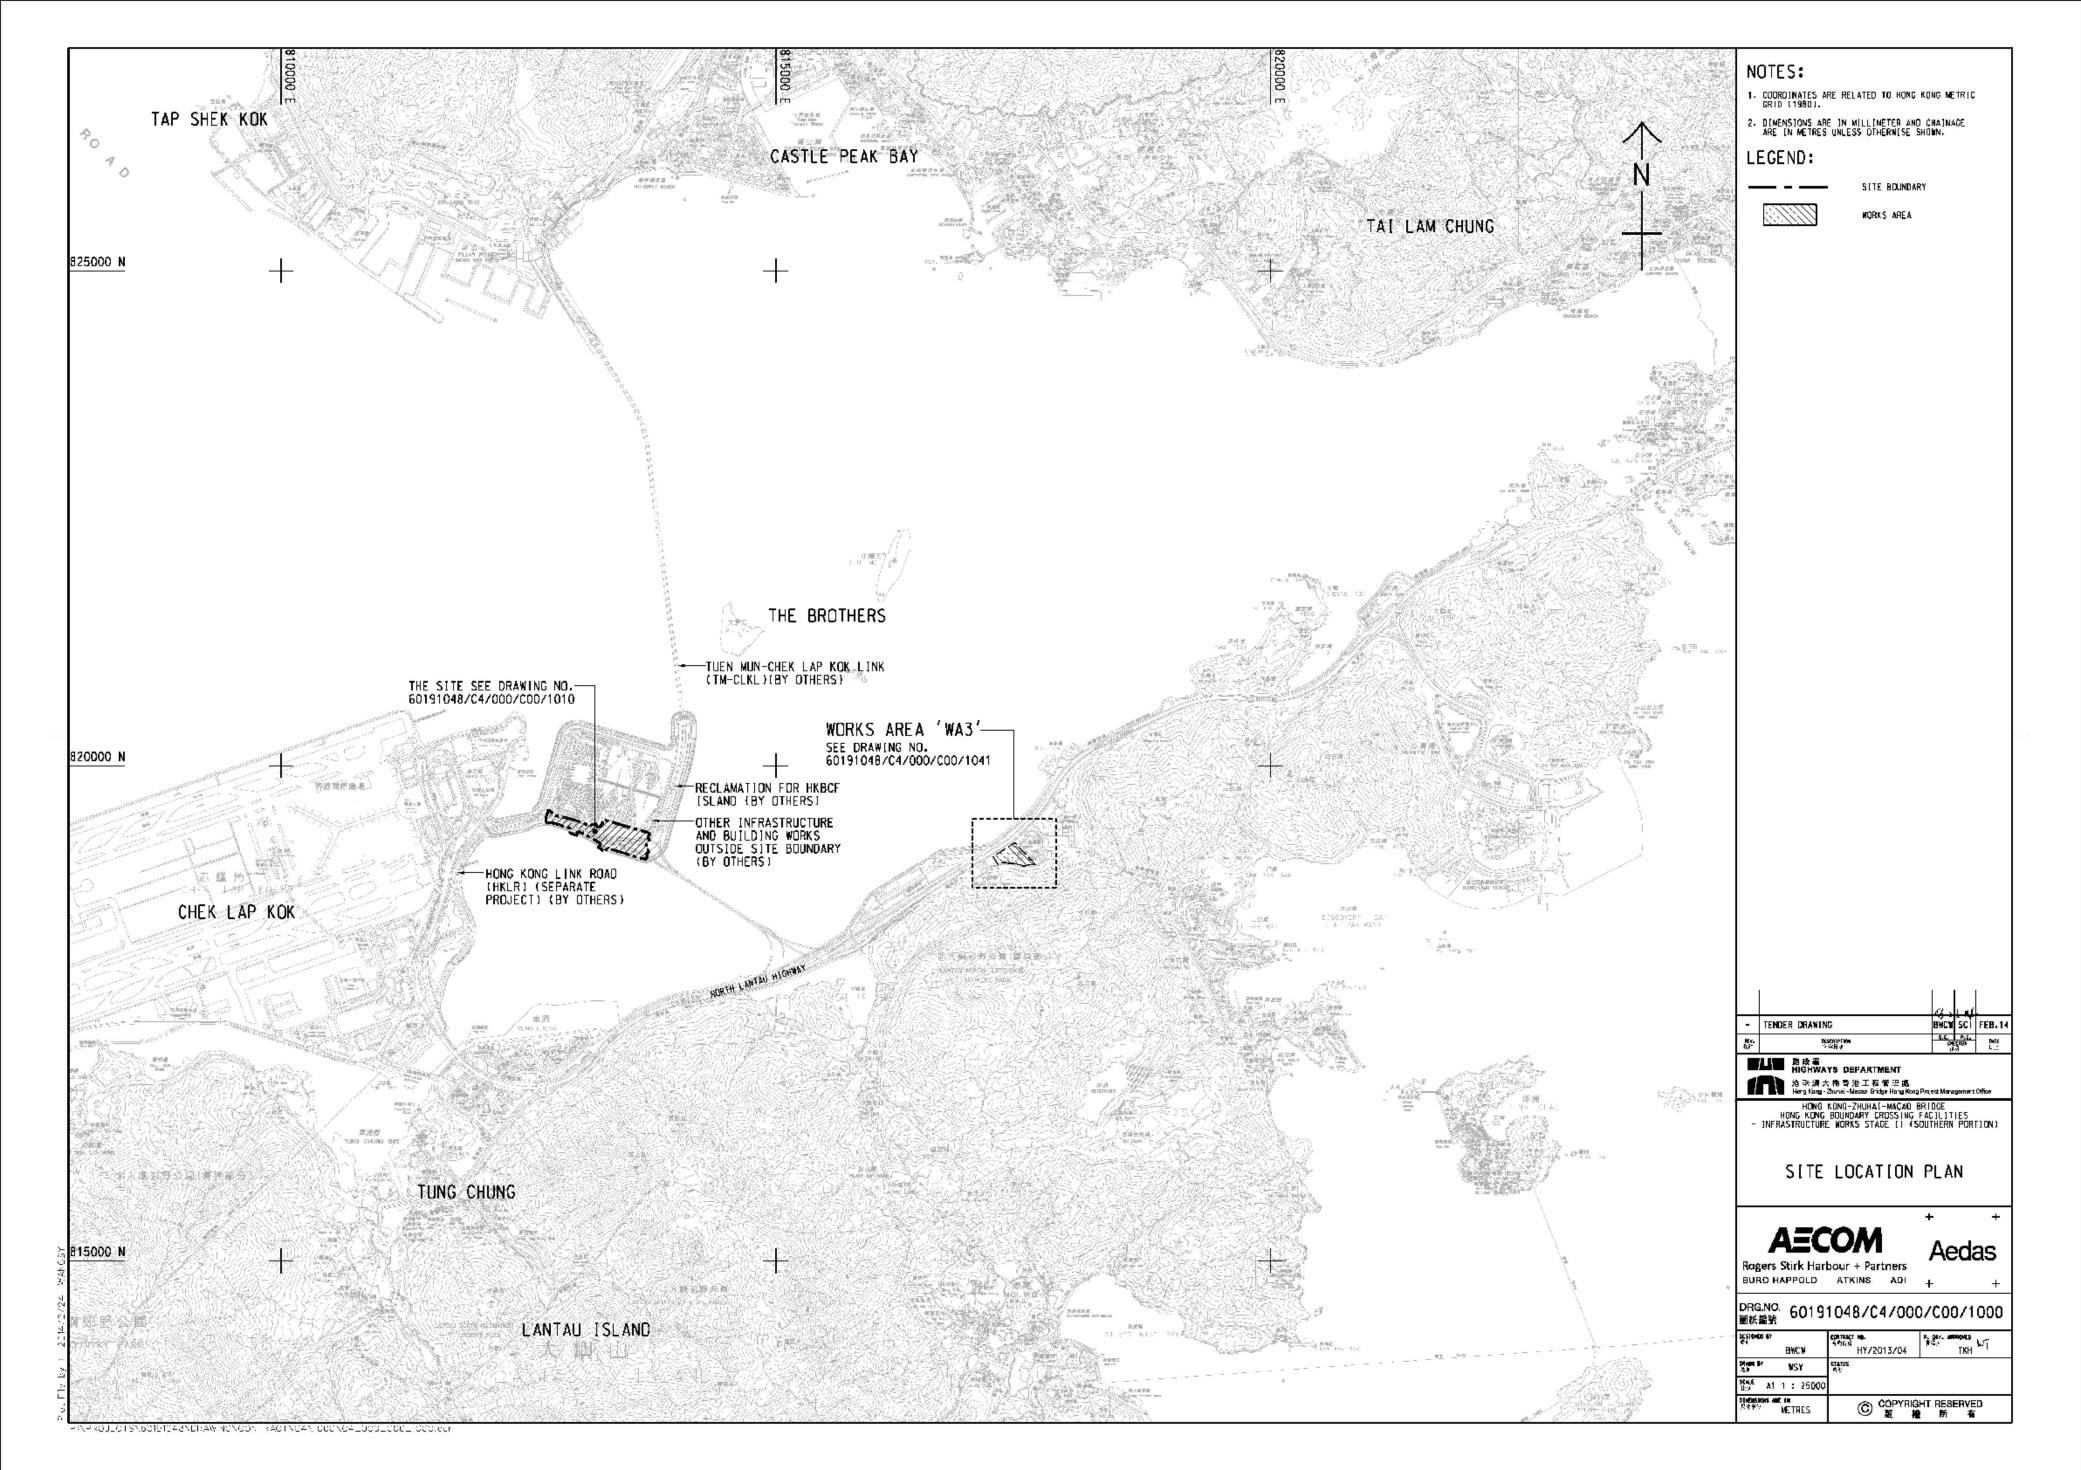


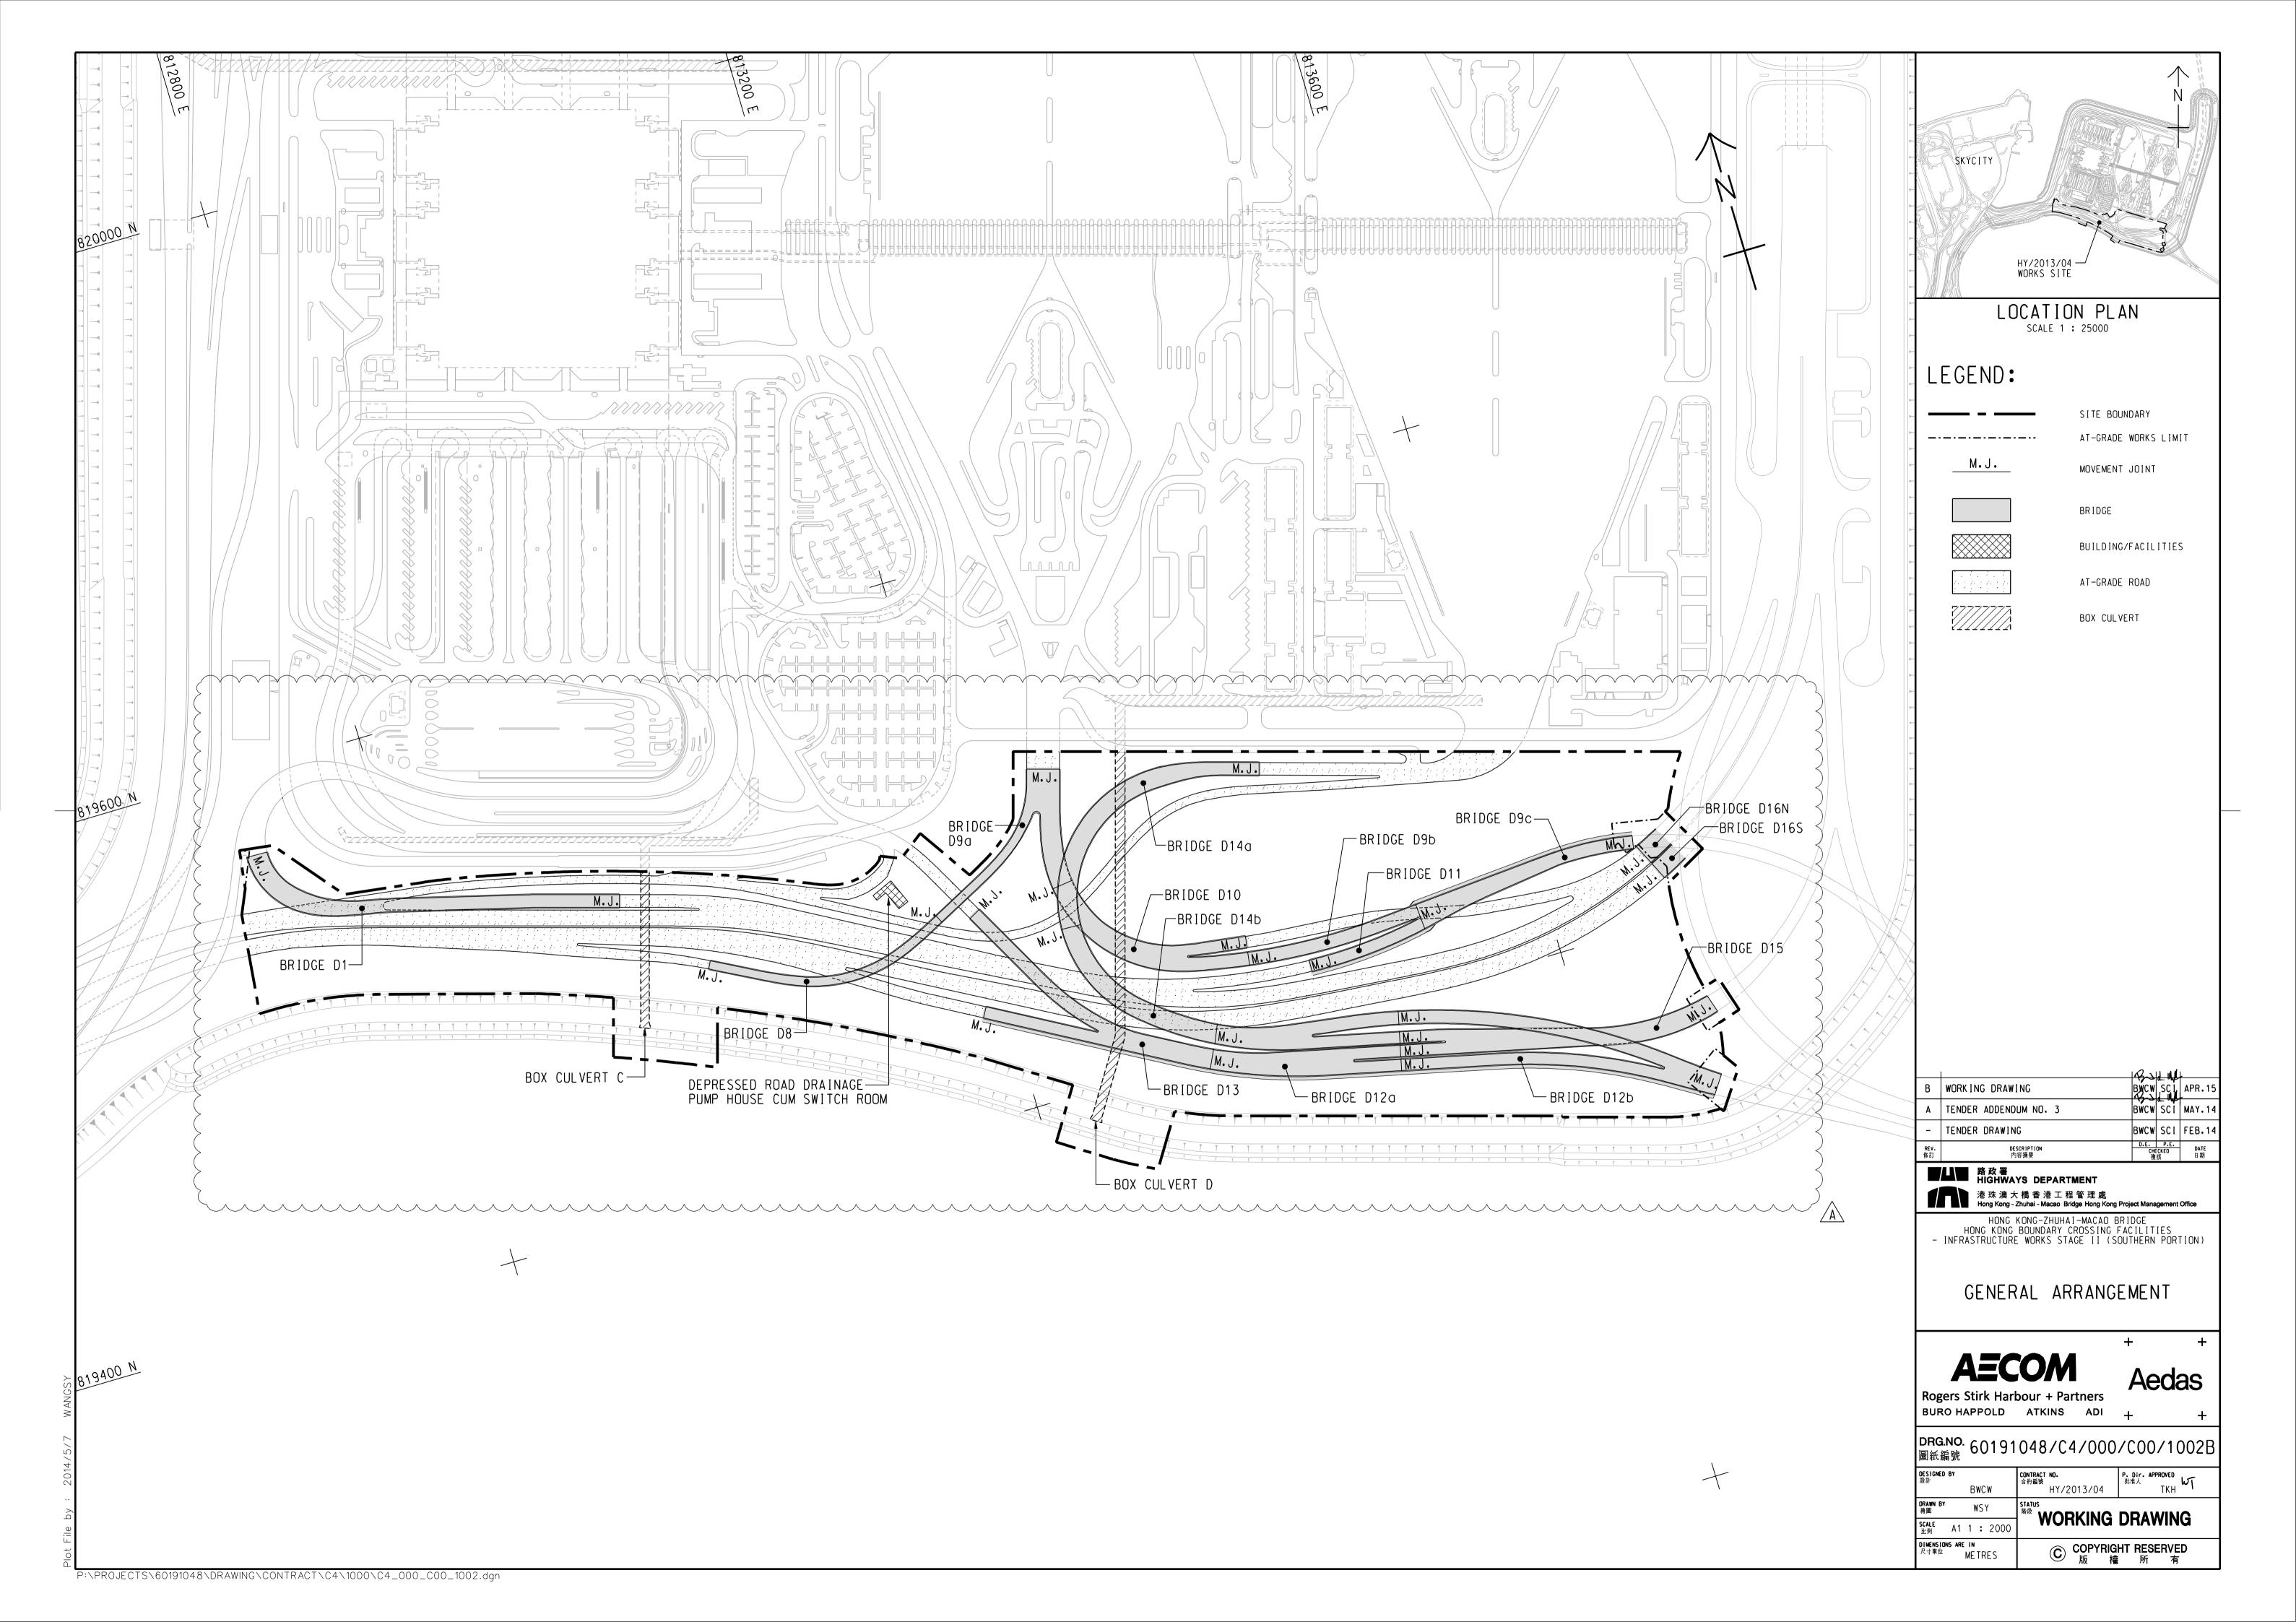

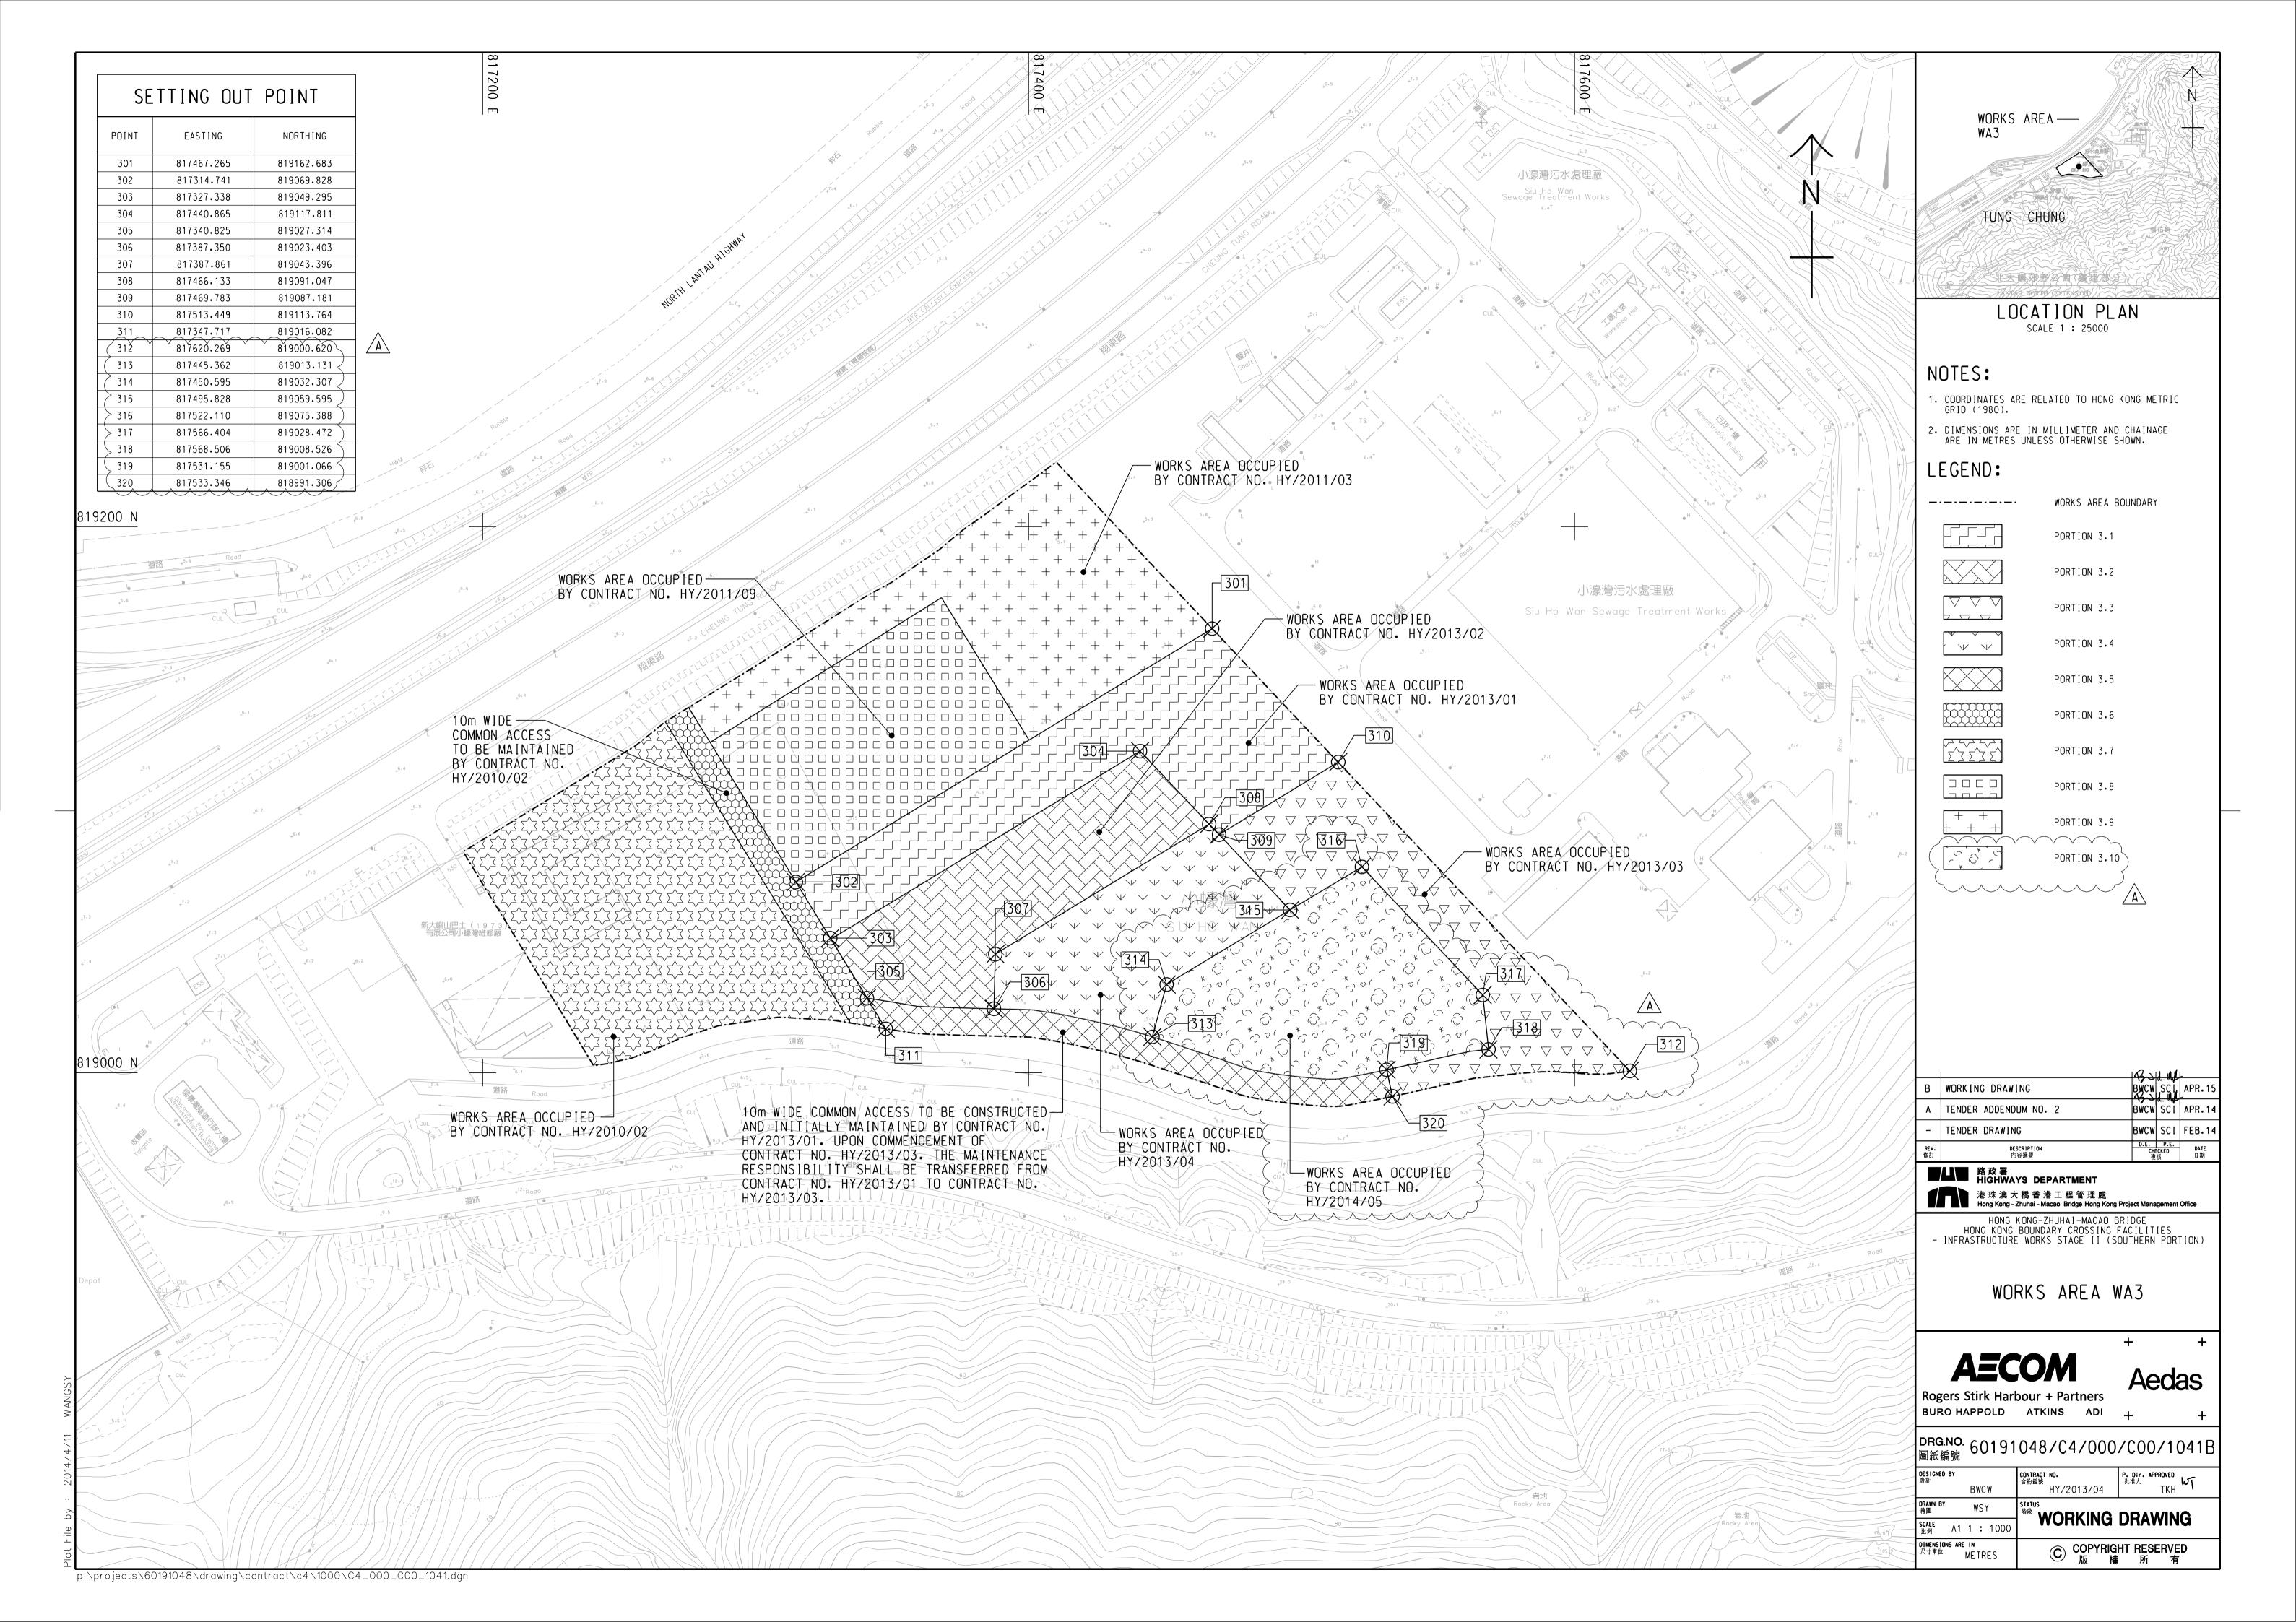

Appendix B. Project Organization for Environmental Works

Project Organisation for Environmental Works

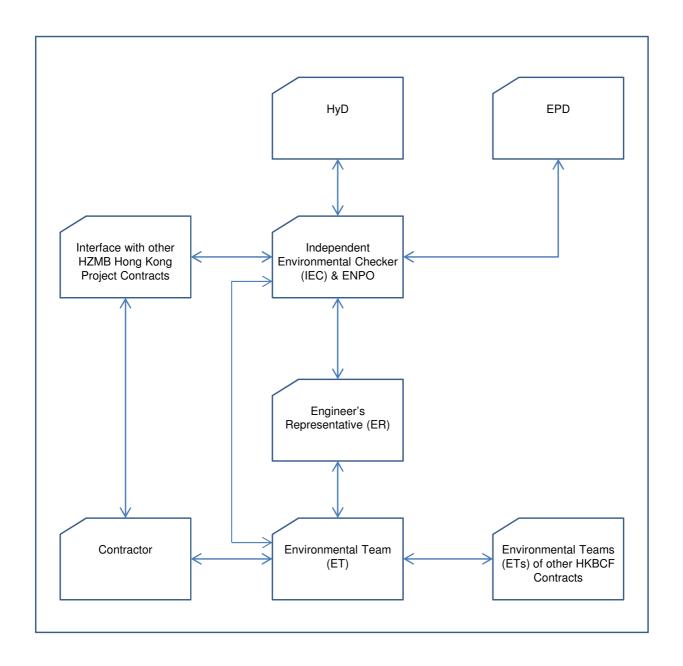

Appendix C. Construction Programme

| A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D Essential Works Updates - Tier 1 - 26 C **Contract Key Dates** CON KD 0005 Letter of Acceptance (LOA) etter of Acceptance (LOA) CON.KD.0010 ent Date Commencement Date CON.KD.0020 Completion of the whole of the Works (1520) 11-May-19, Completion of the whole of the Works (1520) Possession Dates CON.PD.1010 Site Possession of Portion A1 (61) - 8 sion of Portion A1 (61) CON.PD.1020 Site Possession of Portion A2 (61) Site Poss sion of Portion A2 (61) CON.PD.1050 Site Possession of Portion A5 (61) Site Possession of Portion Site Possession of Portion A6 (61) on of Portion A6 (61) CON.PD.1060 CON PD 1070 e Possession of Portion B1-5 (92) Site Possession of Portion B1-5 (92) CON.PD.1080 sion of Portioh B2 (123) Site Possession of Portion B2 (123) Site Possession of Portion B5 (123) CON.PD.1130 Site Possession of Portion B5 (123) CON.PD.1140 Site Possession of Portion C1 (184) 06-Oct-16 Site Pos CON.PD.1150 Site Possession of Portion C2 (184) Site Possession of Port Site Pos sion of Portion D1 (183) CON.PD.1160 Site Possession of Portion D1 (183) CON.PD.1180 Site Possession of Portion D3 (183) Site Po sion of Portion D3 (183) CON.PD.1190 Site Possession of Portion A1 (61) - 2 Site Possession of Portion A1 (61) CON.PD.1200 Site Possession of Portion A1 (61) - 5 Site Passessian of Partian A1 (61) - 5 CON.PD.1210 Site Possession of Portion A1 (61) Site Possession of Portion A1 (61) - 1 ssion of Portion C1; -1 (184) CON.PD.1220 Site Possession of Portion C1 -1 (184) CON.PD.1230 Site Possession of Portion C1 -2 (184) session of Portion C1 -2 (184) CON.PD.1240 Site Possession of Portion B1 -1 (92) Site Possession of Portion B1 -1 (92) CON.PD.1250 Site Possession of Portion B1 -2 (92) Site Possession of Portion B1 +2 (92) CON.PD.1260 Site Possession of Portion A1 (61) - 7 ion of Porti<mark>o</mark>n A1 (61) - 7 ossession of Portion B1-3 (92) CON.PD.1270 Site Possession of Portion B1-3 (92) CON PD 1280 Site Possession of Portion B1-4 (92) Site Possession of Portion B1-4 (92) Site Possession of Portion C1 -3 (184) ite Possession of Portion C1 -3 (184) CON.PD.1290 CON.PD.1030 Site Access of Portion A3 (476) 06-Oct-16 Site Access of Portion A3 (476) -16 🔷 Site Access of Portion A4 (627) CON.PD.1040 Site Access of Portion A4 (627) CON.PD.1090 Site Access of Portion B3 (476) 06-Oct-16 Site Access of Portion B3 (476) CON.PD.1100 Site Access of Portion B4 (627) -16 🔷 Site Access of Portion B4 (627) Site Access of Portion D2 (488) CON.PD.1170 Site Access of Portion D2 (488) Contractual Key Dates - Stage / Section CON.FOT.KD01 KD01 - Achievement of Stage 1A (525) 06-Oct-16, KD01 - Achi ◆ 22-Dec-16, KD02 - Achievement of Stage 1B (650) CON.FOT.KD02 KD02 - Achievement of Stage 1B (650) CON.FOT.KD03 KD03 - Achievement of Stage 2 (525) 06-Oct-16, KD03 - Achieve ment of Stage 2 (525) 06-Oct-16, KD04 - Achievement of Stage 3 (465) CON.FOT.KD04 KD04 - Achievement of Stage 3 (465) ◆ 17-Nov-16, KD05 - Achievement of Stage 4 (615) CON.FOT.KD05 KD05 - Achievement of Stage 4 (615) ◆ 17-Nov-16, KD06 - Achievement of Stage 5 CON.FOT.KD06 KD06 - Achievement of Stage 5 (615) 6-Oct-16, KD07 - Achiev nent of Stage 6 (270) CON.FOT.KD07 KD07 - Achievement of Stage 6 (270) CON.FOT.KD08 KD08 - Completion of Section I of the Works ◆ 16-May-17, KD08 - Completion of Section I of the Works (795) ◆ 24-May-17, KD09 CON.FOT.KD09 KD09 - Completion of Section II of the Works ◆ 24-May-17, KD10 - Completion of Section III of the Works (803) CON.FOT.KD10 KD10 - Completion of Section III of the Works 06-Oct-16, KD11 - Completion of Section IV of the Works (565) CON.FOT.KD11 KD11 - Completion of Section IV of the Works 24-May-17, KD12 - Completion of Section V of the Works (803) CON.FOT.KD12 KD12 - Completion of Section V of the Works 06-Oct-16, KD13 - Completion of Section VI of the Works (465) CON.FOT.KD13 KD13 - Completion of Section VI of the Works CON.FOT.KD14 KD14 - Completion of Section VII of the Works (1155) ♦ 11-May-18, KD14 - Co tion of Section VII of the Works (1155 ♦ 16 May-17, KD15 - Completion of Section VIIIA of the Works (795 CON.FOT.KD15 KD15 - Completion of Section VIIIA of the Works (795) ◆ 11-May-18, KD16 - Completion of Section VIIIB of the Works (1155) CON.FOT.KD16 KD16 - Completion of Section VIIIB of the Works (1155) CON.FOT.KD17 KD17 - Achievement of Stage 7 (718) ♦ 28-Feb-17, KD17 - Achievement of Stage 7 (718) ◆ 16-May-17, KD17A - Completion of Section VIIIC of the Works (795) CON.FOT.KD17A KD17A - Completion of Section VIIIC of the Works (795) KD18 - Completion of Section VIIID of the Works (1155) CON.FOT.KD18 ◆ 11-May-18, KD18 - Co etion of Section VIIID of the Works (1155) etion of \$ection IXA of the Works (1160) ♦ 16-May-18, KD19 - Comp KD19 - Completion of Section IXA of the Works CON.FOT.KD19 ♠ 11-May-19, KD20 - Completion of Section IXB of the Works (1520) CON.FOT.KD20 KD20 - Completion of Section IXB of the Works (1520) Contractual Handover Dates to Employer ♦ 13-Jun-17, Handover of Portion A1 (KD8+28 days) CON.HD.1190 Handover of Portion A1 (KD8+28 days) CON.HD.1200 Handover of Portion A2 (KD8+28 days) 13-Jun-17, Handover of Portion A2 (KD8+28 days) ♦ 21-Jun-17, Handover of Portion A3 (KD9+28 days) CON.HD.1210 Handover of Portion A3 (KD9+28 days) CON.HD.1220 21-Jun-17, Handover of Portion A4 (KD10+28 days) Handover of Portion A4 (KD10+28 days) Handover of Portion A5 (KD13+0 days) CON.HD.1240 r of Portion A5 (KD13+0 days) HY/2013/04 - Detailed Works Programme **** Current Milestone

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)



Data Date: 06-Oct-16

Print Date: 14-Dec-16 09:46



Detailed Works Programme (IVVP) Rev. 04					
Date	Revision	Chec	Approved		
09-Sep-15	Detailed Works Programme	WN/WC	ET		
17-Oct-15	Detailed Works Programme	WN/WC	ET		
29-Oct-15	Detailed Works Programme	WN/WC	ET		
25-Nov-15	Detailed Works Programme	WN/WC	ET		

Page: 1/23

Print Date: 14-Dec-16 09:46 Page: 2 / 23 CON.HD.1250 Handover of Portion A6 (KD14+28 days) CON.HD.1260 Handover of Portion B1 (KD8+28 days) of Portion B1 (KD8+28 days) Handover of Portion B2 (KD8+28 days) ♦ 13-Jun-17, Handover of Portion B2 (KD8+28 davs) CON.HD.1270 of Portion B3 (KD11+28 days) CON.HD.1280 Handover of Portion B3 (KD11+28 days) CON.HD.1290 Handover of Portion B4 (KD12+28 days) 21-Jun-17, Handover of Portion B4 (KD12+28 days) CON.HD.1300 Handover of Portion B5 (KD14+28days) ♦ 08-Jun-18. Had B5 (KD14+28days CON.HD.1310 Handover of Portion C1 (KD8+28 days) ♦ 13-Jun 17 Handover of Portion C1 (KD8+28 days) CON.HD.1320 Handover of Portion C2 (KD13+0 days) 06-Oct-16, Hand f Portion C2 (KD13+0 days CON.HD.1330 Handover of Portion D1 (KD8+28 days) of Portion D1: (KD8+28 days) CON.HD.1340 🔷 13-Jun-17, Handov er of Portion D2 (KD8+28 days) Handover of Portion D2 (KD8+28 days) 13-Jun-17, Handov CON.HD.1350 Handover of Portion D3 (KD8+28 days) er of Portion D3 (KD8+28 days) Contractor Planned Completion: Key Dat ◆ 19-Jun-18, KD01 - Achievement of Stage 1A (525) CON.SC.KD01 KD01 - Achievement of Stage 1A (525) nent of \$tage 1B (650) KD02 - Achievement of Stage 1B (650) CON.SC.KD02 03-May-18, KD02 - Achie CON.SC.KD03 KD03 - Achievement of Stage 2 (525) 19-Jun-18, KD03 - Achievement of Stage 2 (525) ♦ 12-Jun-17, KD04 - Achie CON.SC.KD04 KD04 - Achievement of Stage 3 (465) nt of Stage 3 (465) CON.SC.KD05 KD05 - Achievement of Stage 4 (615) ◆ 20-Aug-18, KD05 -CON.SC.KD06 03-Aug-17, KD06 - Achievement of Stage 5 (615) KD06 - Achievement of Stage 5 (615) CON.SC.KD07 KD07 - Achievement of Stage 6 (270) nent of Stage 6 (270) ♦ 04-Jul-18, KD08 tion of Section I of the Works (795 CON.SC.KD08 KD08 - Completion of Section I of the Works CON.SC.KD09 21-Aug-18, KD09 - Completion of Section II of the Works (803) KD09 - Completion of Section II of the Works (803) CON.SC.KD10 KD10 - Completion of Section III of the Works 21-Aug-18, KD10 - Completion of Section III of the Works (803) CON.SC.KD11 10-Apr 18 KD11 Completion of Section (V of the Works (565) KD11 - Completion of Section IV of the Works (565)◆ 21-Aug-18, KD12 - Completion of Section V of the Works (803) CON.SC.KD12 KD12 - Completion of Section V of the Works KD13 - Completion of Section VI of the Works CON.SC.KD13 🔷 29-Jun-17, KD13 tion of Section VI of the Works (465) ♦ 28-Aug-19, KD14 - Comp CON.SC.KD14 KD14 - Completion of Section VII of the Works CON SC KD15 KD15 - Completion of Section VIIIA of the 03-Aug-18, KD15 - Completion of Section VIIIA of the Works (795) Works (795) 28-Aug-19, KD16 - Completion of Section VIIIB of the CON.SC.KD16 KD16 - Completion of Section VIIIB of the Works (1155) O3-Jul-18, KD17 - Achievement of Stage 7 (718) CON.SC.KD17 KD17 - Achievement of Stage 7 (718) KD17A - Completion of Section VIIIC of the Works (795) CON.SC.KD17A d3-Aug-18, KDI 7A - Completion of Section VII IC of the Works (795) CON.SC.KD18 KD18 - Completion of Section VIIID of the 28-Aug-19, KD18 - Completion of Section VIIID of the Works (1155) CON.SC.KD19 KD19 - Completion of Section IXA of the Works 0/3-Aug-19, KD19 - Completion of Section IXA of the World CON.SC.KD20 KD20 - Completion of Section IXB of the Works ♦ 27-Aug-20, KD20 (1520)Preliminaries and General Requiremer Insurance CON.PR.1010 Arrange and Secure Professional Indemnity Insurances and submit copy to Engineer **Initial Works Programme** CON.PR.1020.10 Prepare & Submit Initial Works Programme (IWP) Enginéer's Approval CON.PR.1020.20 Engineer's Approval **Provisional Programme for Piling Works** CON.PR.1030.10 Prepare Detailed Piling Schedule (refer to IWP) repare Detailed Piling S CON.PR.1030.20 Engineer's Approval Engineer's Approval 3 Months Rolling Programme Prepare 3 Months Rolling Progra CON.PR.1040.10 Prepare 3 Months Rolling Programme CON.PR.1040.20 Engineer's Approval Engineer's Appro **Detailed Works Programme** CON.PR.1050.10 Prepare Detailed Works Programme (DWP) Prepare Detailed Works Programme (DWP) Engineer's Approval CON.PR.1050.20 Engineer's Approval Safety & Health CON.PR.1060.10 Draft Safety Plan Draft Safety Plan Finalized Safety Plan CON.PR.1060.20 Finalized Safety Plan **Environmental Management Plan** CON.PR.1080.10 Draft Envirionmental Management Plan Draft Envirionm Finalized EMP CON.PR.1080.20 Finalized EMP **Sub-Contractor Management Plan** CON.PR.1080.50 Draft Subcontractor Management Plan Engineer's Approval CON.PR.1080.60 Engineer's Approval **Temporary Facilities** ession / Access to W CON.PR.0130 Site Possession / Access to Works Area WA3 CON.PR.0140 Survey / Setting Out Survey / Setting Out CON.PR.0150.10 Site Formation / Site Clearing Site Formation / Site Clearing CON.PR.0160 Contractor's Site Office 💄 ¢ontractor's Site Øffice CON.PR.0170 External Works - Paving, Drainage and Fencing External Works: - Paving, Drainage and Fencing **Contractors Design & Procurement Bridge Bearings**

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D Detailed Design / Shop Drawings and Materials PROC.MA.1610 PROC.MA.1615 Engineer's Review / Approval Engineer's Review / Approva PROC.MA.1650 Production / Manufacturing / Facbrication Production / Manufacturing / Facbrid 6 ♦ Materials Delivery (first delivery) PROC.MA.1670 Materials Delivery (first delivery) **Precast Concrete - Segments** PROC.MA.1760 Moulds Detailed Design Preparation / Engineer's Review / Appr PROC.MA.1765 Engineer's Review / Approval Mould Fabri PROC.MA.1770 Mould Fabrication Cast Prototype / Ir PROC.MA.1780 Cast Prototype / Inspection and Approval ection and Approva PROC.MA.2570 Production of Precast Segments 14-Nov-16 ♦ Materials Delivery (First Delivery) PROC.MA.2590 Materials Delivery (First Delivery) Segment Fabrication and Post Pouring Segment Fabrication Type A Segment Fabrication for Bridge D1 (96 nos) tion for Bridge D1 (96 nos) Segment Fabrication Type C1 Fab.TC1.0010 Segment Fabrication for Bridge D12b (91-106) 16 nos. Segment Fabrication for Bridge D12b (91-106) 16 nos Fab.TC1.0020 rication for Bridge D9c (1-3) 3 nos. Segment Fabrication for Bridge D9c (1-3) 3 nt Fabrication for Bridge D14a (1-30) 30 nos Fab.TC1.0030 Segment Fabrication for Bridge D14a (1-30) 30 Fab.TC1.0040 Segment Fabrication for Bridge D12a (66-80) Segment Fabrication for Bridge D12a (66-80) 15 nds Segment Fabrication for Bridge D14b (14-27) 14 nos. Fab.TC1.0050 Segment Fabrication for Bridge D14b (14-27) Segment Fabrication for Bridge D14c (1-15) 15 nos. Fab.TC1.0060 Segment Fabrication for Bridge D14c (1-15) 1 Fab.TC1.0080 Segment Fabrication for Bridge D9c (4-14) 11 abrication for Bridge D9c (4-14) 11 nos Segment Fabrication for Bridge D15 (48-64) 17 nos. Fab.TC2.00060 | Segment Fabrication for Bridge D15 (48-64) 1 Segment Fabrication for Bridge D15 (31-47) 17 nos Fab.TC3.0060 Segment Fabrication for Bridge D15 (31-47) 1 Segment Fabrication for Bridge D13 (103-129) 27 nos. Fab.TC4.0030 ment Fabridation for Bridge D13 (103-129) 27 nos egment Fabrication for Bridge D14c (46-60) 15 nos Fab.TC4.0060 Segment Fabrication for Bridge D14c (46-60) 15 nos. Segment Fabrication Type C2 Segment Fabrication for Bridge D15 (1-15) 15 nos Fab.TC1.0070 Segment Fabrication for Bridge D15 (1-15) 15 Fab.TC2.00010 Segment Fabrication for Bridge D12b Segment Fabrication for Bridge D12b (112-127) 16 nos. (112-127) 16 nos. Fab.TC2.00020 Segment Fabrication for Bridge D14a (31-59) 29 nos. Segment Fabrication for Bridge D14a (31-59) 29 nos nt Fabrication for Bridge D9c (29-42) 14 nos Fab.TC2.00030 | Segment Fabrication for Bridge D9c (29-42) 14 Fab.TC2.00040 Segment Fabrication for Bridge D12a (48-65) \$egment Fabrication for Bridge D12a (48-65) 18 nos. Fab.TC2.00050 Segment Fabrication for Bridge D14c (16-30) 15 nos. Segment Fabrication for Bridge 014c (16-30) 15 nos. Segment Fabrication for Bridge D12b (4/4-8/4, 1/07-111) 46 nos Fab.TC3.0010 Segment Fabrication for Bridge D12b (44-84, 107-111) 46 nos. Segment Fabrication for Bridge D14c (31-45) 15 nos. Fab.TC3.0050 Segment Fabrication for Bridge D14¢ (31-45) 15 nos. Segment Fabrication for Bridge D15 (65-78) 14 no Fab.TC4.0070 Segment Fabrication for Bridge D15 (65-78) 1 Segment Fabrication Type C3 Fab.TC3.0020 Segment Fabrication for Bridge D9c (15-28) 14 nt Fabrication for Bridge D9c (15-28) 14 nos Segment Fabrication for Bridge D13 (43-70 & 100-102) 31 nos Fab.TC3.0030 Segment Fabrication for Bridge D13 (43-70 & 100-102) 31 nos. Fab.TC3.0040 Segment Fabrication for Bridge D14b (28-49) Segment Fabrication for Bridge D14b (28-49) 22 nos. Fab.TC4.0010 Segment Fabrication for Bridge D12b (1-43,85-90) 49 nos. nent Fabrication for Bridge D12b (1-43,85-90) 49 no abrication for Bridge D14a (60-75) 16 nos Fab.TC4.0020 Segment Fabrication for Bridge D14a (60-75) Segment Fabrication for Bridge D12a (81-95) 15 nos. Fab.TC4.0040 Segment Fabrication for Bridge 🛭 12a (81-95) 15 nos Segment Fabrication for Bridge D14b (1-13) 13 nos Fab.TC4.0050 Segment Fabrication for Bridge D14b (1-13) 13 Segment Fabrication Type D2 ment Fabrication for Bridge D9a (75-86 & nt Fabrication for Bridge D9a (75-86 & 92-104) 25 r Segment Fabrication for Bridge D13 (33-46) 14 nos. Fab.T1.0040 Segment Fabrication for Bridge D13 (33-46) 14 Segment Fabrication for Bridge D9a (1-15) 15 nos. ent Fabrication for Bridge D9a (1-15) 15 nos. Fab.T1.0050 Fab.T2.0010 Segment Fabrication for Bridge D9a (32-46) 15 ment Fabrication for Bridge D9a (32-46) 15 nos brication for Bridge D9b (1-15) 15 nos Fab.T2.0030 Segment Fabrication for Bridge D9b (1-15) 15 Fab.T2.0040 Segment Fabrication for Bridge D10 (33-47) 14 Segment Fabrication for Bridge D10 (33-47) 14 nos. Segment Fabrication for Bridge D13 (29-41) 13 nos. Fab.T2.0050 Segment Fabrication for Bridge D13 (29-41) 13 ment Fabrication for Bridge D9a (47-57, 70-74) 16 nos; Fab.T3.0030 Segment Fabrication for Bridge D9a (47-57, 70-74) 16 nos. Segment Fabrication for Bridge D10 (68-88 & 27-32) 27 nos. Fab.T3.0040 Segment Fabrication for Bridge D10 (68-88 & 27-32) 27 nos Segment Fabrication for Bridge D15 (1-14) 14 no Segment Fabrication for Bridge D15 (1-14) 14 Fab.T3.0070 Segment Fabrication for Bridge D10 (61-67 & 89-95) 14 nos. Fab.T4.0020 Segment Fabrication for Bridge D10 (61-67 & 89-95) 14 nos. Fab.T4.0040 Segment Fabrication for Bridge D8 (48-62) 15 Segment Fabrication for Bridge D8 (48-62) 15 nos Segment Fabrication for Bridge D13 (78-98) 21 nos Fab.T4.0050 Segment Fabrication for Bridge D13 (78-98) 21 Fab.T4.0060 Segment Fabrication for Bridge D10 (96-109) 14 nos. Segment Fabrication for Bridge D10 (96-109) 14 nos. Segment Fabrication Type D3 Fab.T1.0010 Segment Fabrication for Bridge D11 (17-31) 15 nos. Segment Fabrication for Bridge D11 (17-31) 15 nos egment Fabrication for Bridge D10 (1-26) 26 nos. Fab.T1.0030 Segment Fabrication for Bridge D10 (1-26) 26 Fab.T1.0060 Segment Fabrication for Bridge D8 (1-16) 16 abrication for Bridge D8 (1-16) 16 nos. Segment Fabrication for Bridge D12a (1-16) 16 nos. Segment Fabrication for Bridge D12a (1-16) 14 nos Fab.T1.0070 Fab.T2.0020 nt Fabrication for Bridge D11 (1-16) 16 no Segment Fabrication for Bridge D11 (1-16) 16 Segment Fabrication for Bridge D8 (17-31) 15 Segment Fabrication for Bridge D8 (17-31) 15 nos. Fab.T2.0060

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 3 / 23

Data Date: 06-Oct-16

Print Date: 14-Dec-16 09:47 Page: 4 / 23 AMJJASOND JFMAMJJASOND JFMAMJJASOND JFMAMJJASOND JFMAMJJASOND JFMAMJJASOND JFMAMJJASOND Fab.T2.0080 Segment Fabrication for Bridge D10 (47-60) 1 nt Fabrication for Bridge D9a (16-31) 16 no Fab.T3.0005 Segment Fabrication for Bridge D9a (16-31) 1 abrication for Bridge D9b (38-44) 7 nos Fab.T3.0010 Segment Fabrication for Bridge D9b (38-44) 7 Fab.T3.0020 ent Fabrication for Bridge D9b (16-30) 15 nos Segment Fabrication for Bridge D9b (16-30) 1 Segment Fabrication for Bridge D8 (32-47) 16 nos Fab.T3.0050 Segment Fabrication for Bridge D8 (32-47) 16 Fab.T3.0080 Segment Fabrication for Bridge D9b (31-37) 7 ent Fabrication for Bridge D9b (31:37) 7 nos Segment Fabrication for Bridge D9a (58-69, 87-91) 17 nos Segment Fabrication for Bridge D9a (58-69, 87-91) 17 nos Fab.T4.0010 Segment Fabrication for Bridge D13 (15-28 & 71-77) 22 n Fab.T4.0030 Segment Fabrication for Bridge D13 (15-28 & 71-77) 22 nos Pier Segment - Type C -1 Fab.T3.00120 Pier Segment for Bridge D9c - 3 Nos Pier Segment for Bridge D13 - 4 Nos Fab.T3.00130 Pier Segment for Bridge D13 - 4 Nos ier Segment for Bridge D14b - 4 Fab.T3.00140 Pier Segment for Bridge D14b - 4 Nos Pier Segment for Bridge D12a - 4 Nos Fab.T3.00150 Pier Segment for Bridge D12a - 4 Nos Fab.T3.00160 Pier Segment for Bridge D14c - 4 Nos ■ Pier Segment for Bridge D14c - 4 Nos Pier Segment for Bridge D12b - 4 Nos Fab.T3.00170 Pier Segment for Bridge D12b - 4 Nos Pier Segment for Bridge D15 - 4 Nos Fab.T3.00180 Pier Segment for Bridge D15 - 4 Nos Fab.T3.00260 Pier Segment for Bridge D15 - 4 Nos Pler Segment for Bridge D15 - 4 Nos Fab.T3.0090 Pier Segment for Bridge D14a - 6 Nos Segment for Bridge D14a - 6 Nos Pier Segment - Type D- 1 Fab.T2.0070 Segment Fabrication for Bridge D12a (18-31) Fab.T3.00100 Pier Seament for Bridge D9b - 4 Nos Pier Segment for Bridge D9b - 4 Nos Pier Segment for Bridge D9a - 5 Nos Fab.T3.00190 Pier Segment for Bridge D9a - 5 Nos Pier Segment for Bridge D11 - 3 Nos Fab.T3.00200 Pier Segment for Bridge D11 - 3 Nos Fab.T3.00210 Pier Segment for Bridge D10 - 5 Nos Pier Segment for Bridge D10 - 5 No Fab.T3.00220 Pier Segment for Bridge D8 - 5 Nos Pier Segment for Bridge D8 - 5 No Pier Segment for Bridge D13 - 6 Nos Fab.T3.00230 Pier Segment for Bridge D13 - 6 Nos Fab.T3.00240 Pier Segment for Bridge D12a - 4 Nos Pier Segment for Bridge D12a + 4 Nos ■ Pier Segment for Bridge D15 - 1 Nos Pier Segment for Bridge D15 - 1 Nos Fab.T3.00250 Fab.T3.00280 Pier Segment for Bridge D10 - 5 Nos Pier Segment for Bridge D10 - 5 Nbs Fab.T3.00290 Pier Segment for Bridge D9a - 5 Nos Pier Segment for Bridge D9a - 5 Nos Segment Fabrication for Bridge D12a (33-46) 14 no Segment Fabrication for Bridge D12a (33-46) Fab.T3.0060 &M Works and Building Services for Pu Detailed Design and Material/ Equipment Submisison & Statutory Approval (FSD/EMSD) PROC.SC.1285 Engineer's Review / Approval PROC.SC.1287 Engineer's Review / Approval PROC.SC.1290 Procurement and Manufacturing of Materials nt and Manufacturing of Material PROC.SC.1300 Materials Delivery (first delivery) 29-Jun-17 • Materials Delivery (first delivery) Draft Operation and Maintenance (O&M) Manual PROC.SC.1310 Draft Operation and Maintenance (O&M) PROC.SC.1320 Engineer's Review on Draft O&M Manual Engineer's Review on Draft O&M Manual Draft Testing and Commissioning (T&C) Procedure PROC.SC.1330 Draft Testing and Commissioning (T&C) Final T&C Procedure PROC.SC.1340 Final T&C Procedure Engineer's Review on Draft T&C Procedure PROC.SC.1350 Engineer's Review on Draft T&C Procedure Engineer's Approval on Final T&C Procedure PROC.SC.1360 Engineer's Approval on Final T&C Procedure PROC.SC.2840 Final O&M Manual with as-fitted drawings Final O&M Manual with as-fitted drawings PROC.SC.2850 Engineer's Approval on Final O&M Manual with teel Structures for Sign Gantry / High N PROC.MA.1990 Detailed Design / Material Submission Detailed Design / Material Subr Engineer's Review / Approval PROC.MA.1995 Engineer's Review / Approval PROC.MA.2010 Manufacture of Steel Structures of Steel Structures PROC.MA.2020 Material Delivery (first delivery) 15-Sep-17 : ♦ Material Delivery (first delivery Roads and Bridge Lighting PROC.MA.2840 Lighting Arrangement Detailed Design / Material Submission and Approval (within 12 Lighting Arrangement Detailed Design / Material Submission and Approval (within 12 weeks) Engineer's Review / Approval PROC.MA.2845 Engineer's Review / Approval Manufacture of Road and Bridge Lighting PROC.MA.2850 Manufacture of Road and Bridge Lighting rv (first delivery) PROC.MA.2860 Material Delivery (first delivery) 27-Sep-17 🔷 Material Delive The Engineer confirm Landscape Works/ Irrigation Work (31 Dec 2015) PROC.SC.1178 The Engineer confirm Landscape Works/ 06-Oct-16 Irrigation Work (31 Dec 2015) PROC.SC.1180 Detailed Design / Material Submission Detailed Design / Material Submis Engineer's Review / Approval PROC.SC.1185 Engineer's Review / Approval PROC.SC.1190 Procurement and Shipment of Irrigation Materials/Equipment Soft Landscaping PROC.SC.2760 Propose Nursery for Landscape Materials Propose Nursery for Landscape Materials Joint Inspection and Engineer's appro PROC.SC.2780 Joint Inspection and Engineer's approval PROC.SC.2790 Landscape Materials Growing 02-Aug-17 A Materials Delivery (first delivery) PROC.SC.2810 Materials Delivery (first delivery) Construction / Installation Initial Works / Site Establishment & Mai

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

| A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D **Mobilisation and Site Establishment** CONS.A1.0100 Site Possession / Access to Portion A1, A2, A5 CONS.A1.0110 Mobilisation, Site Clearing and Site Set-up oilisation, Site Clearing and Site Set-up CONS.A1.0120 Install Temporary Facilities / Hygiene Facilities Gates and Haul Road Construction (as per Dwg CONS.A1.1010 Site Possession / Access to Portion A1 Survey/ Setting Out CONS.A1.1020 Survey/ Setting Out CONS.A1.1030 | Construct Gate 1 at Haul Road Construct Gate 1 at Haul Road CONS.B1.1010 Site Possession / Access to Portion B1 06-Oct-16 Site Possession / Access to Portion B1 Mobilisation, Site Survey and Setting Out CONS.B1.1020 Mobilisation, Site Survey and Setting Out CONS.B1.1030 Construct Gate 3 and Temporary Haul Road Construct Gate 3 and Temporary Haul Road CONS.B2.1010 Site Possession / Access to Portion B2 & B5 ession / Access to Portion B2 & B5 Site Survey / \$etting out CONS.B2.1020 Site Survey / Setting out CONS.B2.1030 Construct Temporary Haul Road Construct Temporary Haul Road Preliminary Bored Pile with Additional Instrum CONS.A1.0180 | Commence Preliminary Bored Pile at Abutmer CONS.A1.0190 Mobilise Plant & Set-up Support ■ Mobilise Plant & Set-up Support CONS.A1.0195.1 Predrilling to Preliminary Bored Pile (D11) Predrilling to Preliminary Bored Pile (D11) CONS.A1.0195.2 GI Report and Verification / Agreement to GI Report and Verification / Agreement to F unding Level CONS.A1.0200 Preliminary Bored Piling with Additional Instrumentation at Abutment A1101 (1 no. Pile Curing CONS.A1.0210 Pile Curing CONS.A1.0220 Pile Load Testing & Submit Report Pile Load Testing & Submit Repor Replacement Preliminary Bored Pile and Load CONS.A1.0195.6 GI Report and Verification / Agreement to GI Report and Verification! Agreement to Founding Level CONS.A1.0195.7 Engineer's Representative confirmed the replacement bored pile at Pier P908-P1 Engineer's Representative confirmed the replace ement bored pile at Pier P908-P1 Commence Replacement Preliminary Bored Pile at Abutment A1004 CONS.A1.0280 Commence Replacement Preliminary Bored Pile at Abutment A1004 CONS.A1.0290 Mobilise Plant & Set-up Support ■ Mobilise Plant & Set-up Support Replacement Preliminary Bored Pil CONS.A1.0300 Replacement Preliminary Bored Piling - Pier Pile Curing CONS.A1.0310 Pile Curing CONS.A1.0320 Pile Load Testing & Submit Report Pile Load Testing & Submit Preliminary Bored Pile and Load Testing at Abı CONS.C1.0400 Commence Preliminary Bored Pile at Abutmer A106 06-Oct-16 Commence Préliminary Bored Pile at Abutment A106 CONS.C1.0410 Mobilise Plant & Set-up Support Mobilise Plant & Set-up Support Predrilling to Preliminary Bored Pile (D1) CONS.C1.0415.1 Predrilling to Preliminary Bored Pile (D1) CONS.C1.0415.2 GI Report and Verification / Agreement to Founding Level GI Report and Verification / Agreement to Founding Level Preliminary Bored Piling - Abutment A106 (1 no. 2000mm dia x 52m CONS.C1.0420 Preliminary Bored Piling - Abutment A106 (1 no. 2000mm dia x 52m) Pile Curing CONS.C1.0430 Pile Curing CONS.C1.0440 Pile Load Testing and Submit Report Pile Load Testing and Submit Report **Prelimnary Driven H Piles and Load Testing** CONS.A1.4360 Test Pile approved, commence permanent driven h-pile 15-Oct-16 Test Pile approved, commence permanent driven select Preliminary Test Pile (Driven H Pile) CONS.C1.0510 Engineer select Preliminary Test Pile (Driven H e Plant & Set-up Support CONS.C1.0520 | Mobilise Plant & Set-up Support CONS.C1.0530.1 Pre-drilling (2 nos) (Sign Gantry - Preliminary Pile) Pre-drilling (2 nos) (Sign Gantry - Preliminary Pile) CONS.C1.0530.2 GI Report and Verification / Agreement to Founding Level Preliminary Driven H Pile (2 nos) CONS.C1.0540 Preliminary Driven H Pile (2 nos) Pile Load Testing and Submit Report CONS.C1.0550 Pile Load Testing and Submit Report Preliminary Pre-Bored H-Pile and Load Testing CONS.A1.0195.3 Predrilling to Preliminary Pre-Bored H-Pile - 1 Predrilling to Preliminary Pre-Bored H-Pile - 1 no ent ta Founding L CONS.A1.0195.4 GI Report and Verification / Agreement to Founding Level GI Report and Verification / Agree Engineer select Preliminary Test Pile (Pre-Bored H-Pile) CONS.A1.0230 Engineer select Preliminary Test Pile (Pre-Bored H-Pile) Mobilise Plant & Set-up Support CONS.A1.0240 | Mobilise Plant & Set-up Support Preliminary Pre-Bored H-Piling - 1 no. CONS.A1.0250 Preliminary Pre-Bored H-Piling - 1 no. ile Load Testing & Submit Report CONS.A1.0270 Pile Load Testing & Submit Report **Treatment for Bored Piling Excavated Materials** Set-up Stockpile for Excavated Marine Mud CONS.EX.1010 Set-up Stockpile for Excavated Marine Mud Pilot Test for Marine Mud Treatmen CONS.EX.1020 Pilot Test for Marine Mud Treatment CONS.EX.1030 Solidification / Stabilisation / Approval Method Solidification / Stabilisation Set-up Treatment Facilities and Storage Yard CONS.EX.1040 Set-up Treatment Facilities and Storage Yard CONS.EX.1050 Full Scale Solidification / Stabilization Treatment and Verification Testing Full Scale Solidification CONS.EX.1060 Decommissioning of Treatment Facilities Site Set Up at Portion C1 CONS.C1.1010 Site Possession / Access to Portion C1 and C2 06-Oct-16 Site Possession / Access to Portion C1 and C2 06-Oct-16 Site Possession / Access to Portion D1 and D3 CONS.C1.1020 Site Possession / Access to Portion D1 and D3 Site Set-Up CONS.C1.1030 Site Set-Up Pump House cum Switch Room CONS.C1.5110 Commence Pump House Cum Switch Room mmence Pump House Cum Switch Room (2B+ GF) (2B+ GF)

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 5 / 23

Data Date: 06-Oct-16

| A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D CONS.C1.5120 Mobilisation / Survey/ Setting Out CONS.C1.5125 Cofferdam - Sheet Piling Install Dewatering Wells + Pump Test CONS.C1.5130 Install Dewatering Wells + Pump Test ELS Works to Formation level (Base CONS.C1.5140 ELS Works to Formation level (Basement 2) Blinding, Waterproofing and Base Slab CONS.C1.5150 Blinding, Waterproofing and Base Slab Construct Walls and Slab to Upper Ba CONS.C1.5160 Construct Walls and Slab to Upper Basement CONS.C1.5170 Construct Walls and Slab to Ground Level CONS.C1.5200 Construct Walls and Roof Slab Construct Walls and Roof Slab ABWF & Building Service Works to Pump Hous / Switch Room ABWF & Building Service Works to Pump House / Switch CONS.C1.5205 vement of \$tage 5 (KD6) / Interfac ♦ 03-Aug-17, Achie CONS.C1.5210 Achievement of Stage 5 (KD6) / Interface with Pump House/ Switch Rm - Allow Access to ◆ 03-Aug-17, Pump House/Switch Rm - Allow Access to Contract HY/2013/03 CONS.C1.5215 Contract HY/2013/03 CONS.C1.5225 MEP installation for Pump House/Switch Room Testing and Commissioning and Statutory Permits / Certification by FSD / BD CONS.C1.5235 Testing and Commissioning and Statutory Permits / Certification by FSD / BD ABWF Works and External Works CONS.C1.5245 ABWF Works and External Works E&M Equipment Installation CONS.C1.5255 E&M Equipment Installation **Box Culvert D - Cost Savings Design Contractors Design** AD.A1.0001 Approval in Principle for Cost Savings Design 06-Oct-16 Approval in Principle for Cost Savings Design Detailed Design / Shop Drawings and AD.A1.0100 Detailed Design / Shop Drawings and Material AD.A1.0110 Engineer's Review / Approval Engineer's Review / Approva **Preliminary Driven Pile and Load Test** AD.A1.0470.30 Predrilling (1 nos) (Box Culvert D) Predrilling (1 nos) (Box Culvert D) GI Report and Verification / Agreement to Founding Level AD.A1.0470.40 GI Report and Verification / Agreement to Engineer advise Test Pile/ Preliminary Driven Pile at Box Culvert D Engineer advise AD.A1.0510 Test Pile/ Preliminary Driven H Pile at Box (Mobilize Plant & Set-up Support AD.A1.0520 Mobilize Plant & Set-up Support AD.A1.0530 Preliminary Driven H Pile (2 nos) Preliminary Driven H Pile (2 nos) Pile Load Testing and Submit Report AD.A1.0540 Box Culvert D - 15 Bays drilling at Portion A1 (30 nos) (Box Culvert D) AD.A1.1055.30 Predrilling at Portion A1 (30 nos) (Box Culvert ■ GI Report and Verification / Agree AD.A1.1055.40 GI Report and Verification / Agreement to Founding Level AD.A1.1095.30 Box Culvert - Base Slab, Wall & Top Slab - Part Box Culvert - Base Slab, Wall & Top Slab - Part 1 (8 bays) AD.A1.1095.40 Box Culvert - Base Slab, Wall & Top Slab - Part Box Culvert - Base Slab, Wall & Top \$lab - Part 2 (7 bays) 2 (7 bays) Access to Portion A1 (Interface with Contract 03) 06-Oct-16 Access to Portion A1 (Interface with Contract AD.A1.1110 AD.A1.1120 Box Culvert D - Driven H-Pile Works ox Culvert D - Driven H-Pile Works AD.A1.1130 Install Dewatering Wells + Pump Test + Open Cut Excavation to formation ■ Backfill / Reinstate and Conhect UU and Road Works SOL101 AD.A1.1150 Backfill / Reinstate and Connect UU and Road Works SOL101 and SOL102 AD.A1.1160 Survey / Setting Out Survey / Setting Out AD.A1.1170 Pile Testing Mobilization and AD.A1.1180 Mobilization and Plant Set Up int Set Up Pile Trimming and Pile Caps (30 nos) Pile Trimming and Pile Caps (30 nos.) AD.A1.2250 Box Culvert D - 3 Bays and Outfall AD.B1.1180.30 Predrilling (6 nos) (Box Culvert D along Seawall redrilling (6 nos) (Box Culvert D along Seawall Are AD.B1.1180.40 GI Report and Verification / Agreement to Founding Level Pile Trimming and Construction of Pile Caps AD.B1.2235 Pile Trimming and Construction of Pile Caps AD.B1.2250 Remove Piling Platform ve Piling Platform AD.B1.2260 Install Seawall Block & Rockfill near Seawall AD.B1.2270 General Fill General Fill AD.B1.2280 ELS Works (2 levels of Strut) ELS Works (2 levels of \$trut) Box Culvert D - Driven H Pile with Steel Plate AD.B1.2330 AD.B1.2350 Backfill, Remove Seawall Blocks & Reinstate Backfill, Remove Seawall Blocks & Reinstate Rock Armpur AD.B1.2360 ♦ 02-Mar-18, Complete Box Culvert D - based on CSD Complete Box Culvert D - based on CSD Construct Box Culvert Outfall & Connect Drainage AD.B1.2370 Construct Box Culvert Outfall & Connect Drainage Divert/Shift Haul Road (on top of completed box culvert) AD.B1.2380 Divert/Shift Haul Road (lon to of completed box culvert) Sheet Piling Works AD.B1.2390 Install Dewatering Wells and Carry Out Pumping Test Install Dewatering Wells and Carry Out Pumping Test AD.B1.2400 AD.B1.2410 Commence Works on Box Culvert Outfall MDN Application for Marine Plants CONS.OF.1010 Prepare Documents for Statutory Submission to Marine Department MD Vetting, Site Inspection and Approva CONS.OF.1020 MD Vetting, Site Inspection and Approval 02-Dec-16. Marine Department Issues Permit / Cd CONS.OF.1030 Marine Department Issues Permit / Consent Box Culvert C (Portion C1) **Preliminary Driven Piles and Load Testing** CONS.C1.0450 Commence Preliminary Driven H Pile at Box Culvert C 06-Oct-16 Commence Preliminary Driven HiPile at Box Culvert C Mobilise Plant & Set-up Support CONS.C1.0460 Mobilise Plant & Set-up Support CONS.C1.0470. Predrilling (4 nos) (Box Culvert C) Predrilling (# nos) (Box Culvert C)

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 6 / 23

Data Date: 06-Oct-16

CONS.C1.0470. GI Report and Verification / Agreement to Founding Level CONS.C1.0480 Preliminary Driven H Pile (4 nos) Preliminary Driven H Pile (4 nos) CONS.C1.0500 Pile Load Testing and Submit Report Pile Load Testing and Submit Report Box Culvert C - Bay 4-8 CONS.C1.1040 Commence Box Culvert C at Portion C1 05-Nov-Commence Box Culvert C at Portion C1 CONS.C1.1045 Survey / Setting Out Survey / Setting Out CONS.C1.1055. Predrilling (56 nos) (Box Culvert C) Predrilling (56 nos) (Box Culvert C) CONS.C1.1055. GI Report and Verification / Agreement to GIReport and Verification / Agreement to Founding Level CONS.C1.1060 Driven H Piling Works (56 nos x 6 days per Pile Driven H Piling Works (56 nos x 6 days per Pile / 3 rigs) CONS.C1.1070 Excavate and Install Dewatering Wells+ Pump Excavate and Install Dewatering Wells+ Pump Test Test CONS.C1.1090 Pile Trimming and Construction of Pile Caps Pile Trimming and Construction of Pile Caps CONS.C1.1100 Construct Box Culvert & Drainage Connection Construct Box Culvert & Drainage (5 bays) Backfill CONS.C1.1110 Backfill Box Culvert C - Bay 1-3 and Outfall CONS.C1.1120 Divert / Shift Haul Road to North Divert / Shift Haul Road to North Remove Rock Armour CONS.C1.1150 Remove Rock Armour CONS.C1.1160 Construct Piling Plaform Construct Piling Plaform CONS.C1.1170. Predrilling (36 nos) (Box culvert area in C1, Predrilling (36 nos) (Box culvert area in C1, along the GI Report and Verification / Agreement to Founding Leve CONS.C1.1170. GI Report and Verification / Agreement to Piling Driving Works - Driven H-Pile (36 nos) CONS.C1.1180 Piling Driving Works - Driven H-Pile (36 nos) 27-Feb-17. ♦ Commence Box Culvert C Outfall CONS.C1.8480 Commence Box Culvert C Outfall Divert /Shift Haul Road to North CONS.C1.8485 Divert /Shift Haul Road to North (on top of completed box culvert) CONS.C1.8490 Remove Piling Platform Remove Piling Platform CONS.C1.8500 Seawall Block Installation near Seawall Seawall Block Installation CONS.C1.8510 General Fill General Fill Sheet Piling CONS.C1.8530 Sheet Piling CONS.C1.8540 Dewatering Wells + Pump Test Dewatering Wells + Pump Test CONS.C1.8550 ELS Works (2 layers of Strut) ELS Works (2 layers of Strut) CONS.C1.8560 Pile Trimming and Construction of Pile Caps (9 Pile Trimming and Construction of Pile Caps (9:Pile CONS.C1.8570 Construct Box Culvert + Outfall & Drainage Connection (38m or 3 bays) Construct Box Culvert + Outfall & Drainage Connection (38m or 3 bays) CONS.C1.8580 Backfill & Remove Sea Wall Blocks and Backfill & Remove Sea Wall Blocks and Reinstate Rock Armour CONS.C1.8590 | Complete Box Culvert C ◆ 28-Feb-18, Complete Box Cully **Bridge Works** Bridge D1 in Portion C1, D1 and D3 (Interface CONS.C1.1130 Access to Portion C1, D1 & D3 06-Oct-16 Access to Portion C1, D1 & D3 CONS.C1.1140 Survey / Setting Out Survey / Setting Out Pier Columns (P508) CONS.C1.2100 Pier Columns (P508) CONS.C1.2200 Pier Head (P508) Pier Head (P508) CONS.C1.2200.1 Predrilling (17 nos) (D1) CONS.C1.2200.2 GI Report and Verification / Agreement to GI Report and /erification / Agreement to Founding Level Founding Level CONS.C1.2210 D1 Bored Piling (18 nos. 1800-2000mm dia x 52m) (2 nos + 0.8m Rock Socket) D1 Bared Piling (18 nos, 1800-2000m) Pile Testing CONS.C1.2215 Pile Testing Pile Trimming CONS.C1.2220 Pile Trimming CONS.C1.2225.3 Bearing Installation, Final Inspection and ♦ 17-May-17, Achievement of KD4 (465) CONS.C1.2226 Achievement of KD4 (465) CONS.C1.2230 Construct Abutment A106 Construct Aboutm CONS.C1.2250 Bridge D1 - Erect Precast Segments + Bridge D1 Erect Precast Segments + Stitching + Stressing (6 spans) Stitching + Stressing (6 spans) D1 Bridge Ancillary Parapet/TCS\$, Railing, MJ, Drainage & Bridge Lighting CONS.C1.2260 D1 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage & Bridge Lighting CONS.C1.2265 D1 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D1 Bridge Aricillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signa D1 Final Asphalt Paving + Road Mark CONS.C1.2270 D1 Final Asphalt Paving + Road Markings ♦ 02-Jan-18, Completion of Bridge D1 CONS.C1.2280 Completion of Bridge D1 Pier Columns (P101) CONS.C1.2299 Pier Columns (P101) Pier Columns (P102) CONS.C1.8850 Pier Columns (P102) CONS.C1.8860 Pier Columns (P103) Pier Columns (P103) Pier Columns (P104) CONS.C1.8870 Pier Columns (P104) Pier Columns (P105) CONS.C1.8880 Pier Columns (P105) CONS.C1.8950 Pile Cap (P103) Pile Cap (P103) Pile Cap (P104) CONS.C1.8960 Pile Cap (P104) CONS.C1.8970 Pile Cap (P105) Pile Cap (P105) Pile Cap (P101) CONS.C1.8980 Pile Cap (P101) Pile Cap (A106) CONS.C1.8990 Pile Cap (A106) CONS.C1.9000 Pile Cap (P508) Pile Cap (P508) CONS.C1.9010 Pile Cap (P102) Ple Cap (P102) CONS.C1.9020 Pier Head & Bearing (P101) Pier Head & Bearing (P101) Pier Head & Bearing (P102) CONS.C1.9030 Pier Head & Bearing (P102) Pier Head & Bearing (P103) CONS.C1.9040 Pier Head & Bearing (P103)

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 7 / 23

Data Date: 06-Oct-16

1 A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J CONS.C1.9050 Pier Head & Bearing (P104) Pier Head & Bearing (P105) CONS.C1.9060 Pier Head & Bearing (P105) RW1 (51m / 4 bays) CONS.C2.3140 Commence RW1 Retaining Wall Survey / Setting Out CONS.C2.3150 Survey / Setting Out CONS.C2.3160 Excavate to formation level (open cut / slope) Excavate to formation level (ppen cut / slope) Cast Base & Wall Stem 4 bays (ribbed finish to 1m CONS.C2.3170 Cast Base & Wall Stem 4 bays (ribbed finish to 1m below F.G.L) Backfill to final ground level and Reinstate Roa CONS.C2.3180 Backfill to final ground level and Reinstate CONS.C2.3250 Install Railing for RW1 and RW1a Install Railing for RW1 and RW1a RW1a (176m / 11 bays) CONS.C2.3200 Commence RW1a Retaining Wall Commence RW1a Retaining Wal CONS.C2.3210 Survey / Setting Out ■ Survey / Setting Out Excavate to formation level (open cut / slope) - Bay 4 to Bay 11 CONS.C2.3220 Excavate to formation level (open cut / slope) Bay 4 to Bay 11 CONS.C2.3230 Cast Base & Wall Stem (ribbed finish to 1m below F.G.L) - Bay 4 to Bay 11 Cast Base & Wall Stem (ribbled finish to 1m below F.G.L) - Bay 4 to Bay 11 CONS.C2.3240 Backfill to final ground level and Reinstate Backfill to final ground level and Reinstate Roads - Bay 4 to Bay 1 Roads - Bay 4 to Bay 11 Excavate to formation level (open cut / slope) - Bay 1 to Bay : CONS.C2.3370 Excavate to formation level (open cut / slope) Bay 1 to Bay 3 CONS.C2.3380 Cast Base & Wall Stem (ribbed finish to 1m below F.G.L) - Bay 1 to Bay 3 Cast Base & Wall Stem (ribbed finish to 1m below F.G.L) - Bay 1 to Bay 3 CONS.C2.3390 Backfill to final ground level and Reinstate Roads - Bay 1 to Bay 3 Bridge D8 CONS.C1.2285 Site Possession / Access to Portion C1 CONS.C1.2288 Survey / Setting Out Survey / Setting Out CONS.C1.2290.1 Predrilling (10 nos) (D8) Predrilling (10 nos) (D8) CONS.C1.2290.2 GI Report and Verification / Agreement to GI Report and Verification / Agreement to Founding Leve Founding Level D8 Bored Piling (10 nos.2000mm dia x.52m) CONS.C1.2300 D8 Bored Piling (10 nos.2000mm dia x 52m) CONS.C1.2305 Pile Testing Pile Testing Pile Trimming CONS.C1.2310 Pile Trimming Construct Abutment A801 CONS.C1.2320 Construct Abutment A801 CONS.C1.2322 Pier Columns (P805) Pier Columns (P805) Bridge D8:- Erect Precast Segments + Stitching + Stressing (4 CONS.C1.2340 Bridge D8 - Erect Precast Segments + CONS.C1.2350 D8 Bridge Ancillary - Parapet/TCSS, Railing, MJ Drainage & Bridge Lighting D8 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage & Bridge Lighting D8 Bridge Ancillary - Parapet + Railing, Mi, Drainage, Bridge Lighting, Signages CONS.C1.2355 D8 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages ■ D8 Final Asphalt Paving + Road Markings CONS.C1.2360 D8 Final Asphalt Paving + Road Markings O2-Nov-17, Completion of Bridge D8 CONS.C1.2370 Completion of Bridge D8 CONS.C1.8820 Pier Columns (P804) CONS.C1.8830 Pier Columns (P803) Pier Columns (P803) CONS.C1.8900 Pile Cap (A801) Pile Cap (A801) Pile Cap (P805) CONS.C1.8910 Pile Cap (P805) CONS.C1.8920 Pile Cap (P804) Pile Cap (P804) CONS.C1.8930 Pile Cap (P802) CONS.C1.9070 Pier Head & Bearing (P805) Pier Head & Bearing (P805) CONS.C1.9080 Pier Head & Bearing (P804) Pier Head & Bearing (P804) Pier Head & Bearing (P803) CONS.C1.9090 Pier Head & Bearing (P803) Pier Columns (P802) CONS.C2.3420 Pier Columns (P802) CONS.C2.3460 Pile Cap (P803) Pier Head & Bearing (P802) CONS.C2.3490 Pier Head & Bearing (P802) RW8 (35m / 3 bays) 08-Aug-17 ♦ Commence RW8 Retaining Wall CONS.C2.3320 Commence RW8 Retaining Wall ■ Survey / Setting Out CONS.C2.3330 Survey / Setting Out CONS.C2.3340 Excavate to formation level (open cut / slope) Excavate to formation level (open cut / slope) CONS.C2.3350 Cast Base & Wall Stem 3 bays (ribbed finish to 1m below F.G.L) Backfill to final ground level & Reinstate Road CONS.C2.3360 Backfill to final ground level & Reinstate Road Bridge D9a in Portion A1 & A5 06-Oct-16 Site Possession / Access to Portion A1 & A5 (61 days) CONS.A5.2010 Site Possession / Access to Portion A1 & A5 (61 days) CONS.A5.2015 Suvey / Setting out Suvey / Setting out Predrilling - Portion A1 & A5 (12 nos) (09a) CONS.A5.2020.1 Predrilling - Portion A1 & A5 (12 nos) (D9a) ■ GI Report and Verification / Agreem CONS.A5.2020.2 GI Report and Verification / Agreement to to Founding Level Founding Level CONS.A5.2030 D9a Bored Piling (12 nos.1800-2200mm dia x 47m) Pilling (12 nos 1800-2200mm dia x 47m) D9a Bor CONS.A5.2035 Pile Testing CONS.A5.2040 Pile Trimming Bridge D9a - Erect Pr CONS.A5.2065 Bridge D9a - Erect Precast Segments + Stitching + Stressing (4 spans) D9a Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.A5.2070 D9a Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.A5.2080 D9a Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D9a Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages CONS.A5.2090 Pier Columns (P905 & P907) Pier Columns (P905 & P907) Pier Columns (P904 & P906) CONS.A5.2110 Pier Columns (P904 & P906) CONS.A5.2140 Pile Caps (P904) Pile Caps (P904) Pile Caps (P905) CONS.A5.2150 Pile Caps (P905)

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 8 / 23

Data Date: 06-Oct-16

| A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D CONS.A5.2160 Pier Head & Bearing (P905 & P907) Pier Head & Bearing (P904 & P906) CONS.A5.2180 Pier Head & Bearing (P904 & P906) Bridge D9a in Portion C1 & C2 cess to Portion C1 & C2 (184 days) CONS.C2.3010 Site Possession / Access to Portion C1 & C2 (184 days) CONS.C2.3015 Survey / Setting Out Survey / Setting Out CONS.C2.3020. Predrilling - Portion C1 & C2 (8 nos) (D9a) Predrilling + Portion C1 & C2 (8 nos) (D CONS.C2.3020. GI Report and Verification / Agreement to GI Report and Verification / Agree Founding Level D9a in Portion C1 & C2 Bored Piling (8 nos.1800-2200mm dia x 47m) CONS.C2.3030 D9a in Portion C1 & C2 Bored Piling (8 nos.1800-2200mm dia x 47m) CONS.C2.3035 Pile Testing CONS.C2.3040 Pile Trimming CONS.C2.3070 Construct Abutment A901 Construct Abutment A901 CONS.C2.3080 Bridge D9a (C1 & C2) - Erect Precast Bridge D9a (C1 & C2) - Erect P D9a (C1 & C2) Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.C2.3085 D9a (C1 & C2) Bridge Ancillary - Parapet/TCSS Railing, MJ, Drainage, Bridge Lighting, & Sign CONS.C2.3095 Completion of Works in Section VI (KD13) ♦ 14-Jun-17, Completion of Works in Section VI (KD13) CONS.C2.3100 Bridge D9a (C1 & C2) - Erect Precast Bridge D9a (C1 & C2) - Erect Precast Segments + Stitching Segments + Stitching + Stressing (1 span) iD9a Bridge Ancillary | Parapiet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.C2.3110 D9a Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.C2.3115 D9a Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D9a Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signage CONS.C2.3120 D9a Final Asphalt Paving + Road Markings ■ D9a Final Asphalt Paving + Road Markings ♦ 28-Jul-17, Completion of Bridge D9a CONS.C2.3130 Completion of Bridge D9a CONS.C2.3400 Pier Columns (P902) Pier Columns (P902) Pier Calumns (P903) CONS.C2.3410 Pier Columns (P903) CONS.C2.3440 Pile Caps (P902) Pile Caps (P902) CONS.C2.3450 Pile Caps (P903) Pile Caps (P903) CONS.C2.3470 Pier Head & Bearing (P902) Pier Head & Bearing (P902) CONS.C2.3480 Pier Head & Bearing (P903) Pier Head & Bearing (P903) CONS.C2.3560 Pile Caps (A901) Pile Caps (A901) Bridge D9b CONS.A1.1105 Access to Portion A1 ccess to Portion A CONS.A1.1108 Survey / Setting Out Survey / Setting Out CONS.A1.1110.1 Predrilling (8 nos incl. 4 nos for P910) (D9b) drilling (8 nos incl. 4 nos for P910 CONS.A1.1110.2 GI Report and Verification / Agreement to GI Report and Verification / Agreement to Founding Leve Founding Level D9b Bored Piling (8 nos. 2000mm dia x 49m) including 4 for P910 CONS.A1.1120 D9b Bored Piling (8 nos. 2000mm dia x 49m) including 4 for P910 CONS.A1.1125 Pile Testing CONS.A1.1130 Pile Trimming CONS.A1.1160 Bridge D9b - Erect Precast Segments + Stitching + Stressing (3 spans) Bridge D9b - Erect Precast Segments + Stitching + \$tressing (3 spans) CONS.A1.1170 D9b Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage & Bridge Lighting D9b Bridge Ancillary - Parapet/TC\$S, Railing, MJ Drainage & Bridge Lighting D9b Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signage CONS.A1.1175 D9b Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages CONS.A1.1180 D9b Final Asphalt Paving + Road Markings Þ9b Final Asphalt Paying + Road Markings ♦ 11-Aug-17, Bridge D9b complete CONS.A1.1190 Bridge D9b complete CONS.A1.8750 Pier Columns (P908) Pier Columns (P908) CONS.A1.8760 Pier Columns (P909) Pier Columns (P909) Pler Columns (P910) - A (Portal) CONS.A1.8770 Pier Columns (P910) - A (Portal) Per Columns (P910) B (Portal) CONS.A1.8780 Pier Columns (P910) - B (Portal) CONS.A1.9230 Pile Caps (P908) CONS.A1.9240 Pile Caps (P909) Pilė Caps (P909) CONS.A1.9250 Pile Caps (P910 - A) Pile Cap (P910 - A) CONS.A1.9260 Pile Caps (P910 - B) CONS.A1.9270 Pier Head & Bearing (P908) Pier Head & Bearing (P908) CONS.A1.9280 Pier Head & Bearing (P909) Pier Head & Bearing (P909) Bridge D9c CONS.A1.1192 Site Possession / Access to Portion A1 & A2 06-Oct-16 Site Possession / Access to Portion A1 & A2 CONS.A1.1194 Survey / Setting Out Survey / Setting Out CONS.A1.1200.1 Predrilling (8 nos) (D9c) Predrilling (8 nos) (D9c) CONS.A1.1200.2 GI Report and Verification / Agreement to Founding Level CONS.A1.1210 D9c Bored Piling (8 nos. 2000mm dia x 62m) CONS.A1.1215 Pile Testing CONS.A1.1220 Pile Trimming Construct Deck (Cast in Situ) (1 span, P910 to P911) CONS.A1.1240 Bridge D9c - Construct Deck (Cast in Situ) (1 Bridge D9c span, P910 to P911) CONS.A1.1250 Bridge D9c - Erect Precast Segments Pier P911 to Pier P913 + Stitching + Stressing (2 spans) Bridge D9¢ - Erect Precast Segments Pier P911 to Pier P913 + Stitching D9c Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage & Bridge Lighting CONS.A1.1260 D9c Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage & Bridge Lighting CONS.A1.1270 D9c Bridge Ancillary - Parapet + Railing, MJ, 💻 ;D9¢ Bridgė Aricillary į Parapet + Railing, MJ, Drainage, Bridge Lighting; Sigr Drainage, Bridge Lighting, Signages CONS.A1.8790 Pier Columns (P913) Pier Columns (P913) CONS.A1.8800 Pier Columns (P912) Pier Columns (P912) CONS.A1.8810 Pier Columns (P911) Pier Columns (P911) CONS.A1.9190 Pile Cap (P913) CONS.A1.9200 Pile Cap (P912) ap (P912)

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 9 / 23

Data Date: 06-Oct-16

1 A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J CONS.A1.9210 Pile Cap (P911) CONS.A1.9310 Pier Head & Bearing (P913) Pier Head & Bearing (P912) CONS.A1.9320 Pier Head & Bearing (P912) CONS.A1.9330 Pier Head & Bearing (P911) Pier Head & Bearing (P911) Bridge D9c in Portion A3 (Interface with Cont CONS.A3.1010 Site Possession / Access to Portion A3 06-Oct-16 ♦ Site Possession / Access to Portion A3 CONS.A3.1020 Mob/ Survey / Setting Out Mob/ Survey / Setting Out CONS.A3.1030 Bridge D9c (A3) - Erect Precast Segments Pier ridge D9c (A3) - Erect Precast Segment: Pier P913 to Contract Interface + Stitchi P913 to Contract Interface + Stitching + CONS.A3.1040 D9c Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage & Bridge Lighting D9c Bridge Ancillary - Parapet/TC\$S, Railing, MJ, Drainage & Bridge Lighting CONS.A3.1045 D9c Bridge Ancillary - Parapet + Railing, MJ 📫 🛭 Þ9c Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages Drainage, Bridge Lighting, Signages CONS.A3.1050 D9c Final Asphalt Paving + Road Markings D9c Final Asphalt Paving + Road Markings CONS.A3.1060 Completion of Works in Stage 1B (KD2) O3-May-18, Completion o Bridge D10 CONS.A1.10120 Pile Caps (A1004) Pile Caps (A1004) CONS.A1.1284 Site Possession / Access to Portion A1 Site Possession / Access to Portion A Survey / Setting Out CONS.A1.1286 Survey / Setting Out CONS.A1.1290.1 Predrilling (14 nos) (D10) drilling (14 hos) (D10) CONS.A1.1290.2 GI Report and Verification / Agreement to Founding Level CONS.A1.1300 D10 Bored Piling (14 nos 1800-2200mm dia x 57m) (42m for Abutment) D10 Bored Piling (14 nos 1800-2200mm dia x 57m) (42m for Abut CONS.A1.1305 Pile Testing CONS.A1.1310 Pile Trimming Construct Abultment A1004 CONS.A1.1315 Construct Abutment A1004 CONS.A1.1340 Bridge D10 - Erect Precast Segments + Bridge D10 - Erect Precast Segments + Stitching + Stressing (8 spans Stitching + Stressing (8 spans) CONS.A1.1350 D10 Bridge Ancillary - Parapet/TCSS, Railing, D10 Bridge Ancillary - Parapet/TCSS, Ralling, MJ, Drainage, Bridge Lighting, & Sign Gantry MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.A1.1355 D10 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D10 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, \$ignage D10 Final Asphalt Paving + Road Markings CONS.A1.1360 D10 Final Asphalt Paving + Road Markings ◆ 18-Oct-17, Bridge D10 complete CONS.A1.1370 Bridge D10 complete Pier Columns (P1003) CONS.A1.8830 Pier Columns (P1003) Pier Columns (P1002 & P1006) CONS.A1.8840 Pier Columns (P1002 & P1006) CONS.A1.8850 Pier Columns (P1008) Pier Columns (P1008) Pier Columns (P1001 & P1 CONS.A1.8860 Pier Columns (P1001 & P1005) Pier Columns (P1007) CONS.A1.8870 Pier Columns (P1007) CONS.A1.9110 Pile Caps (P1008) Pile Caps (P1008) Pile Caps (P1003) CONS.A1.9120 Pile Caps (P1003) CONS.A1.9130 Pile Caps (P1007) Pilė Caps (P1007) le Caps (P1002) CONS.A1.9140 Pile Caps (P1002) Pile Caps (P1001) CONS.A1.9160 Pile Caps (P1001) CONS.A1.9350 Pier Head & Bearing (P1003) Fier Head & Bearing (P1003) Pier Head & Bearing (P1007) CONS.A1.9360 Pier Head & Bearing (P1007) Pier Head & Bearing (P1008) CONS.A1.9370 Pier Head & Bearing (P1008) CONS.A1.9380 Pier Head & Bearing (P1002 & P1006) Pier Head & Bearing (P1002 & P1006) ■ Pier Head & Bearing (P1001 & 1005) CONS.A1.9400 Pier Head & Bearing (P1001 & 1005) Bridge D11 CONS.A1.1375 Site Possession / Access to Portion A1 (61d) Survey / Setting Out CONS.A1.1378 Survey / Setting Out CONS.A1.1380.1 Predrilling (3 nos) (D11) Predrilling (3 nos) (D11) GI Report and Verification / Agreem CONS.A1.1380.2 GI Report and Verification / Agreement to nt to Founding Level D11 Bored Piling (3 nos. 2000mm dia x 65) (52m for abutment CONS.A1.1390 D11 Bored Piling (3 nos. 2000mm dia x 65) (52m for abutment) CONS.A1.1395 Pile Testing Pile Te CONS.A1.1400 Pile Trimming CONS.A1.1405 Abutment A1101 nt A1101 CONS.A1.1430 Bridge D11 - Erect Precast Segments + Bridge D11 - Erect Precast Segments + Stitching + Stressing (2 spans) CONS.A1.1440 D11 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry D11 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.A1.1445 D11 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D11 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages Road Markings D11 Final Asphalt Paving CONS.A1.1450 D11 Final Asphalt Paving + Road Markings CONS.A1.1460 Bridge D11 complete CONS.A1.8900 Pier Columns (P1102) Pler Columns (P1102) Pile Caps (P1102) CONS.A1.9070 Pile Caps (P1102) CONS.A1.9080 Pile Caps (A1101) Pile Caps (A1101) CONS.A1.9420 Pier Head & Bearing (P1102) Pier Head & Bearing (P1102) RW11 (42m / 3 bays) CONS.A1.3320 Commence RW11 Retaining Wall (42m / 3 bays) 13-May-17 ♦ Commence RW11 Retaining Wall (42m / 3 bays) Survey / Setting Out CONS.A1.3330 Survey / Setting Out CONS.A1.3340 Excavate to formation level (open cut / slope) Excavate to formation level (open cut / slope) CONS.A1.3350 Cast Base & Wall Stem 3 bays (ribbed finish to 1m below F.G.L) Cast Base & Wall Stem 3 bays (ribbed finish to 1m below Backfill to final ground level CONS.A1.3360 Backfill to final ground level

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 10 / 23

Data Date: 06-Oct-16

Bridge D12a CONS.B1.1835 Site Possession / Access to Portion B1 Site Survey and Setting Out CONS.B1.1837 Site Survey and Setting Out CONS.B1.1840.1 Predrilling (17 nos) (D12a) Predrilling (17 nos) (D12a) GI Report and Verification / Agreement to Founding Leve CONS.B1.1840.2 GI Report and Verification / Agreement to Founding Level CONS.B1.1850 D12a Bored Piling (17 nos. 2000mm dia x 60m + 1.0m Rock Socket) D12a Bored Piling (17 nos, 2000mm dia x 60m + 1,0m Rock \$ocket) CONS.B1.1855 Pile Testing Pile Trimming CONS.B1.1860 Pile Trimming CONS.B1.1890 Bridge D12a - Erect Precast Segments + Stitching + Stressing (6 spans) Bridge D12a - Erect Precast Segr nents + Stitching + Stressing (6 spans) D12a Bridge Ancillary - Parapet/TCSS, Railing, M.), Drainage, Bridge Lighting, & Sig CONS.B1.1900 D12a Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.B1.1905 D12a Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D12a Bridge Ancillary CONS.B1.1910 D12a Final Asphalt Paving + Road Markings aving + Road Markings O4-Jul-18, Bridge D12a complete CONS.B1.1920 Bridge D12a complete Pier Columns (P1201 & P1204) CONS.B1.2020 Pier Columns (P1201 & P1204) CONS.B1.2040 Pier Columns (P1202 & P1205) Pier Columns (P1202 & P1205) Pier Columns (P1203 & P1414) CONS.B1.2050 Pier Columns (P1203 & P1414) CONS.B1.2070 Pier Columns (P1206) Pier Columns (P1206) Pile Caps (P1206) CONS.B1.2440 Pile Caps (P1206) CONS.B1.2450 Pile Caps (P1201) Pile: Caps (P1201): CONS.B1.2460 Pile Caps (P1202) Pile Caps (P1202) CONS.B1.2470 Pile Caps (P1203) Pile Caps (P1203) CONS.B1.2480 Pier Head & Bearing (P1201 & P1204) Pier Head & Bearing (P1201 & P1204) Pier Head & Bearing (P1202 & P1205) CONS.B1.2500 Pier Head & Bearing (P1202 & P1205) CONS.B1.2520 Pier Head & Bearing (P1203 & P1414) Pier Head & Bearing (P1203 & P1414) Pier Head & Bearing (P1206) CONS.B1.2530 Pier Head & Bearing (P1206) Bridge D12b CONS.B2.2015 Site Possession / Access to Portion B2 & B5 06-Oct-16 Site Possession / Access to Portion B2 & B5 CONS.B2.2018 Site Survey / Setting out Site Survey / Setting ou Predrilling (18 nds) (D12b) CONS.B2.2020.1 Predrilling (18 nos) (D12b) CONS.B2.2020.2 GI Report and Verification / Agreement to Founding Level GI Report and Verification / Agree D12b Bored Piling (18 nos. 2000mm da x 64m + 3.3m Rock Socket) CONS.B2.2030 D12b Bored Piling (18 nos. 2000mm dia x 64m 3.3m Rock Socket) CONS.B2.2035 Pile Testing Pile Testing Pile Trimming CONS.B2.2040 Pile Trimming D12b - Erect Precast Segments + Stitching + Stressing (4 spans) CONS.B2.2070 Bridge D12b - Erect Precast Segments + Stitching + Stressing (4 spans) ■ D12b Bridge Ancillary - Farapet/TCSS, Ralling, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.B2.2080 D12b Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry CONS.B2.2085 D12b Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D12b Bridge Ancillary - Parapet + Railing MJ, Drainage Bridge Lighting, \$ignage Final Paving, Road CONS.B2.2090 Final Paving, Road Markings and Signages Markings and \$ignages CONS.B2.2100 Pier Columns (P1211) Pier Columns (P1211) CONS.B2.2110 Pier Columns (P1212) Pier Columns (P1214) CONS.B2.2120 Pier Columns (P1214) CONS.B2.2130 Pier Columns (P1213) - A (Portal) Pier Columns (P1213) - A (Porta Pier Columns (P1210) CONS.B2.2140 Pier Columns (P1210) CONS.B2.2150 Pier Columns (P1213) - B (Portal) Pier Columns (P1213) - B (Porta Pier Columns (P1208) CONS.B2.2160 Pier Columns (P1208) Pier Columns (P1209) CONS.B2.2170 Pier Columns (P1209) CONS.B2.2190 Pile Caps (P1211) Pile Caps (P1211) Pile Caps (P1212) CONS.B2.2200 Pile Caps (P1212) Pile Caps (P1213 - A) CONS.B2.2210 Pile Caps (P1213 - A) CONS.B2.2220 Pile Caps (P1213 - B) Pile Caps (P1213 - B) Pile Caps (P1214) CONS.B2.2230 Pile Caps (P1214) CONS.B2.2240 Pile Caps (P1207) Pile Caps (P1207) CONS.B2.2250 Pile Caps (P1208) Pile Caps (P1208) Pile Caps (P1209) CONS.B2.2260 Pile Caps (P1209) CONS.B2.2270 Pile Caps (P1210) Pile Caps (P1210) Pier Columns (P1207) CONS.B2.2280 Pier Columns (P1207) CONS.B2.2290 Pier Head & Bearing (P1211) Pier Head & Bearing (P1211) CONS.B2.2300 Pier Head & Bearing (P1214) Pier Head & Bearing (P1214) ■ Pier Head & Bearing (P1212) CONS.B2.2320 Pier Head & Bearing (P1212) CONS.B2.2340 Pier Head & Bearing (P1207) Pier Head & Bearing (P1207) Pier Head & Bearing (F CONS.B2.2350 Pier Head & Bearing (P1210) CONS.B2.2360 Pier Head & Bearing (P1208) Pier Head & Bearing (P1208) CONS.B2.2370 Pier Head & Bearing (P1209) Pier Head & Bearing (P1209 CONS.B2.2380 Bridge D12b - Erect Precast Segments + Stitching + Stressing (4 spans) Bridge D12b - Frect Preca Bridge D12b (cast in-situ) in Portion B3 (Inter CONS.B3.2110 Site Possession/Access to Portion B3 CONS.B3.2120 Survey / Setting Out Survey / Setting Out

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 11/23

Data Date: 06-Oct-16

CONS.B3.2130 Bridge D12b (Portion B3) - Construct Deck (cast-in-situ) Pier P1210/P1214 interface with CONS.B3.2140 D12b Bridge Ancillary - Parapet/TCSS, Railing, TCSS, Railing, NJ, Drainage, Bridge Lighting, & Sign Gantry MJ, Drainage, Bridge Lighting, & Sign Gantry D 2b Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages CONS.B3.2145 D12b Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages CONS.B3.2150 D12b Final Paving, Road Markings and Signages 10-Apr-18, Completion of Section IV (KD11) Works within Portion \$3 including Bridge D12b CONS.B3.2160 | Completion of Section IV (KD11) Works within Portion B3 including Bridge D12b Bridge D13 in Portion B1 and Portion C1 CONS.B1.1925 Site Possession / Access to Portion B1 CONS.B1.1926 Site Possession / Access to Portion C1 06-Oct-16 Site Possession / Access to Portion C CONS.B1.1928 Site Survey / Setting out Portion B1 Site Survey / Setting out Portion B1 CONS.B1.1929 Site Survey / Setting out Portion C1 Site Survey / \$etting out Portion C1 CONS.B1.1930.1 Predrilling (15 nos) in Portion B1 (D13) Predrilling (15 nos) in Portion B1 (D13) GI Report and Verifica CONS.B1.1930.2 GI Report and Verification / Agreement to Founding Level - B1 Predrilling (6 nos) in Portion C1 (D13) CONS.B1.1932.1 Predrilling (6 nos) in Portion C1 (D13) CONS.B1.1932.2 GI Report and Verification / Agreement to Founding Level - C1 ■ GI:Report and Verification / Agreen nt to Founding D13 Bored Piling (15 nos 1800-2000mm dia x 52m) 4nos + 0.8m Rock Socket CONS.B1.1940 D13 Bored Piling (15 nos. 1800-2000mm dia x 52m) 4nos + 0.8m Rock Socket - Portion B1 Pile Testing B1 CONS.B1.1942 Pile Testing B1 CONS.B1.1946 D13 Bored Piling (6 nos. 1800-2000mm dia x 47m-52m) - Portion C1 D13 Bored Plling (6 nos. 1800-2000mm dia x 47m CONS.B1.1948 Pile Testing C1 CONS.B1.1950 Pile Trimming - Portion B1 Pile Trimming - Portion B1 Pile Trimming - Portion C1 CONS.B1.1952 Pile Trimming - Portion C1 CONS.B1.1960 Construct Abutment A1301 + A1307 - Portion Construct Abutment A1301 + A1307 - Portion C1 CONS.B1.1980 Bridge D13 - Erect Precast Segments + Stitching + Stressing (9 spans) g + Stressing (9 span Bridge D13 - Erect Precast Segments + Stitcl CONS.B1.1990 D13 Bridge Ancillary - Parapet/TCSS, Railing, D13 Bridge Ancillary - Parapet/TCSS, Railing, NU, Drainage, Bridge Lighting, & Sign Gantry MJ, Drainage, Bridge Lighting, & Sign Gantry D13; Bridge, Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages CONS.B1.1995 D13 Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting, Signages D13 Final Asphalt Paving, Road Markings & \$ignages CONS.B1.2000 D13 Final Asphalt Paving, Road Markings & Signages 24-Feb-18, Completion of Bridge D13 CONS.B1.2010 Completion of Bridge D13 CONS.B1.2190 Pier Columns (P1303) Pler Columns (P1303) Pier Columns (P1308) CONS.B1.2200 Pier Columns (P1308) CONS.B1.2210 Pier Columns (P1311 & P1306) Pier Calumns (P1311; & P1306) CONS.B1.2220 Pier Columns (P1310 & P1305) Pier Columns (P1310 & P130) Pier Columns (P1309 & P1304) CONS.B1.2230 Pier Columns (P1309 & P1304) CONS.B1.2330 Pile Caps (P1311) Pile Caps (P1311) CONS.B1.2340 Pier Columns (P1302) Pier Columns (P1302) Pile Caps (P1310) CONS.B1.2350 Pile Caps (P1310) CONS.B1.2360 Pile Caps (P1309) Pile Caps (P1309) CONS.B1.2370 Pile Caps (A1307) Pile Caps (A1307) Pile Caps (A1301) CONS.B1.2380 Pile Caps (A1301) CONS.B1.2390 Pile Caps (P1308) Pile Caps (P1308) CONS.B1.2400 Pile Caps (P1303) Pile Caps (P1303) Pile Caps (P1302) CONS.B1.2410 Pile Caps (P1302) CONS.B1.2560 Pier Head & Bearing (P1311 & P1306) ■ Pier Head & Bearing (P1311 & P1306) Pier Head & Bearing (P1310 & P1305) CONS.B1.2580 Pier Head & Bearing (P1310 & P1305) CONS.B1.2600 Pier Head & Bearing (P1309 & P1304) Pier Head & Bearing (P1309 & P1304) Pier Head & Bearing (P130 CONS.B1.2610 Pier Head & Bearing (P1303) Pier Head & Bearing (P1308) CONS.B1.2620 Pier Head & Bearing (P1308) CONS.B1.2630 Pier Head & Bearing (P1302) Pier Head & Bearing (P1302) RW13 (40m / 3 bays) nence RW13 Retaining Wall CONS.C2.3260 Commence RW13 Retaining Wall 11-Oct-17 🔷 Comn CONS.C2.3270 Survey / Setting Out I Survey / Setting Out CONS.C2.3280 Excavate to formation level (open cut / slope) CONS.C2.3290 Cast Base & Wall Stem 3 bays (ribbed finish to 1m below F.G.L) Cast Base & Wall Stem 3 bays (ribbed finish to 1m below F.G.L) CONS.C2.3300 Backfill to final ground level and Reinstate Backfill to final ground level and Reinstate Bridge D14a CONS.A1.1464 Commence Bridge D14a / Portion A1 06-Oct-16 nce Bridge D14a / Portion A1 Survey / Setting Out CONS.A1.1466 Survey / Setting Out CONS.A1.1470.1 Predrilling (12 nos) (D14a) Predrilling (12 nos) (D14a) CONS.A1.1470.2 GI Report and Verification / Agreement to Founding Level ■ G Report and Verification / Agr D14a Bored CONS.A1.1480 D14a Bored Piling (12 nos. 2000mm dia x 62m) 47m for Abutment Piling (12 nos. 2000mm dia x 62m) 47m for Abutment CONS.A1.1485 Pile Testing CONS.A1.1490 Pile Trimming CONS.A1.1515 Construct Abutment A1401 Construct Abutment A1401 CONS.A1.1520 Bridge D14a - Erect Precast Segments + Stitching + Stressing (5 spans) Bridge D14a - Erect Precast Segn CONS.A1.1530 D14a Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting & Signages Parapet + Ralling, MJ, Drainage, Bridge D14a Bridge Ancillary CONS.A1.1540 D14a Final Asphalt Paving + Road Markings D14a Final Asphalt Paving + Road Markings ♦ 09-Jun-17, Bridge D14a co CONS.A1.1550 Bridge D14a complete CONS.A1.8940 Pier Columns (P1402) Columns (P1402)

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 12 / 23

Data Date: 06-Oct-16

CONS.A1.8950 Pier Columns (P1403) Pier Columns (P1404) CONS.A1.8960 Pier Columns (P1404) Pier Columns (P1405) CONS.A1.8970 Pier Columns (P1405) CONS.A1.8980 Pier Columns (P1406) Pier Columns (P1406 CONS.A1.9000 Pile Caps (A1401) Pile Caps (A1401) CONS.A1.9010 Pile Caps (P1402) Pile Caps (P1402) Pile Caps (P1403) CONS.A1.9020 Pile Caps (P1403) Pile Caps (P1404) CONS.A1.9030 Pile Caps (P1404) CONS.A1.9040 Pile Caps (P1405) Pile Caps (P1405) Pile Caps (P1406) CONS.A1.9050 Pile Caps (P1406) CONS.A1.9440 Pier Head & Bearing (P1402) Pier Head & Bearing (P1402) CONS.A1.9450 Pier Head & Bearing (P1403) Pier Head & Bearing (P1404) CONS.A1.9460 Pier Head & Bearing (P1404) CONS.A1.9470 Pier Head & Bearing (P1405) Pier Head & Bearing (P1405) Pier Head & Bearing (P1406) CONS.A1.9480 Pier Head & Bearing (P1406) RW14A (29m / 2 bays) CONS.A1.3380 Commence RW14a Retaining Wall (29m / 2 25-Jul-17 • Comr nce RW14a Retaining Wall (29m / 2 bays) Survey / Setting Out CONS.A1.3390 Survey / Setting Out Excavate to formation level (open cut / slope) CONS.A1.3400 Excavate to formation level (open cut / slope) CONS.A1.3410 Cast Base & Wall Stem 2 bays (ribbed finish to Cast Base & Wall Stem 2 bays (ribbed finish to 1 m 1m below F.G.L) CONS.A1.3420 Backfill to final ground level Backfill to final ground level Bridge D14b in Portion A1 and Portion B1 CONS.B1.1654 Access to Portion B1 Access to Portion B1 CONS.B1.1656 Survey / Setting Out Survey / Setting Out CONS.B1.1660.1 Predrilling (6 nos) (D14b) Predrilling (6 nos) (D14b) GI Report and Verification / Agreement to Founding Level CONS.B1.1660.2 GI Report and Verification / Agreement to Founding Level CONS.B1.1670 D14b Bored Piling (6 nos. 2000-2200mm dia x 62m) (2nos +2.3m Rock Socket) D14b Bored Piling (6 nos. 2000-2200mm dia x 62m) (2nos +2.3m Rock Socket) Pile Testing / Coring Test for Socket Bored Pile CONS.B1.1675 Pile Testing / Coring Test for Socket Bored Pile Pile Trimming CONS.B1.1680 Pile Trimming CONS.B1.1710 Bridge D14b - Erect Precast Segments + Stitching + Stressing (3 spans) CONS.B1.1720 D14b Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting & Signages D14b Bridge Ancillary - Parapet + Railing, MJ Drainage, Bridge Lighting & Signages D14b Final Asphalt Paving + Road Markings CONS.B1.1730 D14b Final Asphalt Paving + Road Markings ♦ 26-Sep-17, Bridge D14b complete CONS.B1.1740 Bridge D14b complete Pier Columns (P1407) CONS.B1.2090 Pier Columns (P1407) CONS.B1.2100 Pier Columns (P1408) Pier Columns (P1408) CONS.B1.2110 Pier Columns (P1409) Pier Columns (P1409) Pile Caps (P1407) CONS.B1.2290 Pile Caps (P1407) Pile Caps (P1408) CONS.B1.2300 Pile Caps (P1408) Pile Caps (P1409) CONS.B1.2310 Pile Caps (P1409) CONS.B1.2640 Pier Head & Bearing (P1407) Pier Head & Bearing (P1407) CONS.B1.2650 Pier Head & Bearing (P1408) Pier Head & Bearing (P1408) Pier Head & Bearing (P1409) CONS.B1.2660 Pier Head & Bearing (P1409) Bridge D14c CONS.B1.1744 Site Possession / Access to Portion B1 Survey / Setting Out CONS.B1.1746 Survey / Setting Out CONS.B1.1750.1 Predrilling (11 nos) (D14c) redrilling (11 nos) (D14c) CONS.B1.1750.2 GI Report and Verification / Agreement to GI Report and Verification / Agreement to Founding Level D) 4c Bored Pilling (11 nos; 2000-2200mm dia x 67m + 2.3m (Rock Socket) CONS.B1.1760 D14c Bored Piling (11 nos. 2000-2200mm dia x 67m + 2.3m Rock Socket) Pile Testing CONS.B1.1765 Pile Testing CONS.B1.1770 Pile Trimming CONS.B1.1795 Bridge D14c - Construct Deck (cast in-situ) Pier P1409 to P1410 Bridge D14c - Construct Deck (cast in-situ); Pier P1409 to P1410 Bridge D14c - Erect Precast Segments + Stitching + Stressing (4 spans) CONS.B1.1800 Bridge D14c - Erect Precast Segments + CONS.B1.1810 D14c Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting & Signages D14c Bridge Ancillary - Parapet + Railing, MJ, Drainage, Bridge Lighting & Signages CONS.B1.1820 D14c Final Asphalt Paving + Road Markings D14c Final Asphalt Paving + Road Marking ♦ 14-Dec-17, Bridge D14c complete CONS.B1.1830 Bridge D14c complete CONS.B1.2120 Pier Columns (P1410) Pier Columns (P1410) CONS.B1.2130 Pier Columns (P1411 & P1413) Pier Columns (P1411 & P1413) Pier Columns (P1412) CONS.B1.2140 Pier Columns (P1412) CONS.B1.2250 Pile Caps (P1410) Pile Caps (P1410) CONS.B1.2260 Pile Caps (P1411) Pile Caps (P1411) CONS.B1.2270 Pile Caps (P1412) Pile Caps (P1412) CONS.B1.2670 Pier Head & Bearing (P1410) Pier Head & Bearing (P1410) CONS.B1.2680 Pier Head & Bearing (P1411 & P1413) Pier Head & Bearing (P1411 & P1413) Pier Head & Bearing (P1412): CONS.B1.2690 Pier Head & Bearing (P1412) Bridge D15 Site Possession/Access to Partion B5 CONS.B5.2104 Site Possession/Access to Portion B5 06-Oct-16

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 13 / 23

Data Date: 06-Oct-16

| A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D CONS.B5.2106 Survey/ Site Setting Out edrilling (11 nos) (D15) CONS.B5.2110.1 Predrilling (11 nos) (D15) CONS.B5.2110.2 GI Report and Verification / Agreement to GI Report and Verification / Agreement to Founding Level D15 Bored Piling (11 nos. 2000mm dia x 65m CONS.B5.2120 D15 Bored Piling (11 nos. 2000mm dia x 65m 3.3m Rock Socket) CONS.B5.2125 Pile Testing Pile Testing CONS.B5.2130 Pile Trimming Pile Trimmino CONS.B5.2150 Bridge D15 - Construct Deck (cast in-situ) Pier P1501/P1502-1503 CONS.B5.2160 Bridge D15 - Erect Precast Segments + Bridge D15 - Erect Precast Segments Stitching + Stressing (2 spans Stitching + Stressing (2 spans) CONS.B5.2170 D15 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry :D15 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Ligh CONS.B5.2180 D15 Final Asphalt Paving, Road Markings and p15 Final Asphalt Paving, Road Markings and Signages Signages CONS.B5.2190 Pier Columns (P1501 & P1502) Pier Columns (P1501 & P1502) Pier Columns (P1503) CONS.B5.2210 Pier Columns (P1503) Pier Columns (P1504) CONS.B5.2220 Pier Columns (P1504) CONS.B5.2230 Pier Columns (P1505) Pier Columns (P1505) CONS.B5.2250 Pile Caps (P1501 & P1502) Pile Caps (P1501 & P1502) Pile Caps (P1503) CONS.B5.2260 Pile Caps (P1503) CONS.B5.2270 Pile Caps (P1504) Plle Caps (P1504) CONS.B5.2280 Pile Caps (P1505) Pile Caps (P1505) CONS.B5.2290 Pier Head & Bearing (P1501) Pier Head & Bearing (P1501) Pier Head & Bearing (P1503) CONS.B5.2310 Pier Head & Bearing (P1503) Pier Head & Bearing (P1504) CONS.B5.2320 Pier Head & Bearing (P1504) CONS.B5.2330 Pier Head & Bearing (P1505) Pier Head & Bearing (P1505) CONS.B5.2340 Bridge D15 - Erect Precast Segments + Bridge D15 - Erect Precast Segments + \$titching + Stressing (2 spans) Stitching + Stressing (2 spans) Bridge D15 in Portion B4 (Interface with Cont CONS.B4.2170 Site Possession/Access to Portion B4 Survey / \$ite Setting Out CONS.B4.2180 Survey / Site Setting Out CONS.B4.2190 Bridge D15 - Erect Precast Segments on Falseworks at Portion B4 Interface (1 spa ■ Bridge D15 - Erect Precast Segments on Falseworks at Portion B4 Interface (1 span) orks at Portion B4 Interface (1 span) - Parapet/T¢SS, Railing, M.), Drainage, Bridge Lighting, & Sign G CONS.B4.2200 D15 Bridge Ancillary - Parapet/TCSS, Railing, MJ, Drainage, Bridge Lighting, & Sign Gantry D15 Final Asphalt Paving, Road Markings and Signages CONS.B4.2210 D15 Final Asphalt Paving, Road Markings and CONS.B4.2220 Inspection and Handover CONS.B4.2230 Completion of Section V (KD12) Works within Portion B4 including Bridge D15 mpletion of Section V (KD12) Works within Portion B4 including Bridge D15 ♦ 18-Aug-18, Co Bridge D16S and D16N and Abutment A1601 in CONS.A4.2230 Commence Works for Abutment A1601 06-Oct-16 ce Works for Abutment A1601 Survey / Site \$etting Out CONS.A4.2240 Survey / Site Setting Out CONS.A4.2250.1 Predrilling (2 nos) (D16) - BH 03 & BH 04 at Portion A6 Predrilling (2 nos) (D16) - BH 03 & BH 04 at Portion A6 CONS.A4.2250.2 GI Report and Verification / Agreement to Founding Level to BH 03 and BH 04 Predrilling (2 nos):(D16) + BH 01 & BH 02 at Portion A3 CONS.A4.2250.3 Predrilling (2 nos) (D16) - BH 01 & BH 02 at CONS.A4.2250.4 GI Report and Verification / Agreement to Founding Level to BH 01 and BH 02 CONS.A4.2260 D16S Bored Piling (2 nos x 1800mm dia) D16S Boried Piling (2 nos x 1800mm dia) CONS.A4.2265 Pile Testing - BH 03 & BH 04 Pile Testing - BH 03 & BH 04 Construct Abutment A1601 CONS.A4.2280 | Construct Abutment A1601 016N Bored Piling (2 nos x 1800mm dia) CONS.A4.2340 D16N Bored Piling (2 nos x 1800mm dia) CONS.A4.2350 Pile Testing - BH 01 & BH 02 Pile Testing - BH 01 & BH 02 CONS.A4.2360 Pile Trimming + Pile Caps Bridge D16S and D16N in Portion A4 CONS.A4.2285 Site Possession / Site Access to Portion A4 20-Mar 17 Site Po sion / Site Access Construct Deck (cast in-stu) CONS.A4.2290 Bridge D16S & D16N - Construct Deck (cast D16N & D16S Bridge Ancillary - Parapet, MJ, Drainage, Bridge Lighting, †CSS & Signage CONS.A4,2300 D16N & D16S Bridge Ancillary - Parapet, MJ Drainage, Bridge Lighting, TCSS & Signages CONS.A4.2310 D16 Final Asphalt Paving, Road Markings and D16 Final Asphalt Paving, Road Markings and Signages Signages CONS.A4.2320 Inspection and Handover of Bridge D16 Handover of Bridge D16 CONS.A4.2330 Completion of Bridge D16N and D16S 21-Aug-18, Completion of Bridge D16N and D16S RW16S (15m / 1 bay) in Portion A6 13-Feb-17 ♦ Commence RW16s Retaining Wall (29m / 2 bays) CONS.A1.3500 Commence RW16s Retaining Wall (29m / 2 bays) Survey / Setting Out CONS.A1.3510 Survey / Setting Out Excavate to formation level (open cut / slope) CONS.A1.3520 Excavate to formation level (open cut / slope) CONS.A1.3530 Cast Base & Wall Stem 1 bay (ribbed finish to 1m below F.G.L) Cast Base & Wall Stem 1 bay (ribbed finish to 1m below F.G.L) CONS.A1.3540 Install U/G Utilities - TCSS, ELV & LV Ducting & Draw Pits Install U/G Utilities - TCSS, ELV & LV Ducting & Draw Pits CONS.A1.3550 Backfill to final ground level Backfill to final ground level RW16N (15m / 1 bay) in Portion A6 ence RW16n Retaining Wall (29m / 2 bays) CONS.A1.3440 Commence RW16n Retaining Wall (29m / 2 bays) CONS.A1.3450 Survey / Setting Out : Survey / Setting Out: CONS.A1.3460 Excavate to formation level (open cut / slope) Excavate to formation level (open cut / slope) CONS.A1.3470 Cast Base & Wall Stem 1 bay (ribbed finish to 1m below F.G.L) Cast Base & Wall Stem 1 bay (ribbed finish to 1m below F.G.L) Install U/G Utilities - TCSS, FLV & LV Ducting CONS.A1.3480 Install U/G Utilities - TCSS, ELV & LV Ducting Backfill to final ground leve CONS.A1.3490 Backfill to final ground level **Depressed Road RC Structure**

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 14/23

Data Date: 06-Oct-16

Print Date: 14-Dec-16 09:47 Page: 15 / 23 Stage 1- Depressed Road RC Structure (Bay 9 CONS.C1.8670 Commence Works on Depressed Road (after removal of falsework D10, D14a) Excavate to formation level (open cut) CONS.C1.8699 Excavate to formation level (open cut) CONS.C1.8720 Construct- base slab CONS.C1.8730 Construct - wall (Plan ad Ribbed Finishes) Construct - wall (Plan ad Ribbed Finishes) Backfill and Com CONS.C1.8740 Backfill and Compaction Stage 2 - Depressed Road RC Structure (Bay 1 CONS.C1.8671 | Commence Works on Depressed Road (after 19-Aug 17: 🔷 Commence Works on Depressed Road (after remova falseworks D13, D8, D9a) removal of falseworks D13, D8, D9a) CONS.C1.8690 Excavate to formation level (open cut) Excavate to formation level (open cut) CONS.C1.8721 Construct- base slab Construct - wall (Plan ad Ribbed Finishes) CONS.C1.8731 | Construct - wall (Plan ad Ribbed Finishes) CONS.C1.8741 Backfill and Compaction Backfill and Com Sign Gantry Sign Gantry Footings at Grade in Portion A1 DS303 (Driven H Pile) Predrilling (12 nos) (DS303) CONS.A1.4380. Predrilling (12 nos) (DS303) CONS.A1.4380. GI Report and Verification / Agreement to Founding Level GI Report and Verification / Agreement to Fo CONS.A1.4390 Piling Works - Driven H Pile (12 nos) ing Works - Driven H Pile (12 nos) CONS.A1.4410 Excavation, Pile Trimming + Cast Pile Caps (3 Excavation, Pile Trimming + Cast Pile Caps (3 nos) CONS.A1.4420 Backfill Foundation Backfill Foundation Sign Gantry Footing at Grade in Portion C1 & P DS302 (610mm dia. Prebored H Pile) CONS.D1.3380 Commence Foundation / Footing for Sign 06-Oct-16 🔷 Commence Foundation / Footing for Sign Gantry Gantry Mobilisation/Survey/Setting Out CONS.D1.3390 Mobilisation/ Survey / Setting Out CONS.D1.3400. Predrilling for Prebored H Pile (8 nos) (DS302) Predrilling for Prebored H Pile (8 nos) (DS302) CONS.D1.3400. GI Report and Verification / Agreement to GI Report and Verification / Agr Founding Level CONS.D1.3410 Pre-bored Socket H-Pile (8 nos) Pre-bored Socket H-Pile (8 nds) CONS.D1.3420 Pile Testing Pile Testing Excavation, Pile Trimming + Pile Caps (2 nos) CONS.D1.3430 Excavation, Pile Trimming + Pile Caps (2 nos) CONS.D1.3440 Backfill Foundation Backfill Foundation GT408 (Driven H Pile) Predrilling (8 nos) (GT408) CONS.C1.4030. Predrilling (8 nos) (GT408) CONS.C1.4030. GI Report and Verification / Agreement to Founding Level GI Report and Verification / Agreement to Founding Level Piling Works - Driven H Pile (8 nos) CONS.C1.4040 Piling Works - Driven H Pile (8 nos) CONS.C1.4060 Excavation, Pile Trimming + Cast Pile Caps (2 nos) Excavation, Pile Trimming + Cast Pile Caps (2 nos) CONS.C1.4070 Backfill Foundation Backfill Foundation DS44 (Driven H Pile) CONS.C1.4100. Predrilling (8 nos) (DS44) Predrilling (8 nos) (DS44) GI Report and Verification / Agreement to Founding Level CONS.C1.4100. GI Report and Verification / Agreement to Founding Level ing Works - Driven H Pile (8 nos) CONS.C1.4110 Piling Works - Driven H Pile (8 nos) CONS.C1.4130 Excavation, Pile Trimming + Cast Pile Caps (2 Excavation, Pile Trimming + Cast Pile Caps (2 nos) Backfill Foundation CONS.C1.4140 Backfill Foundation DS261 (Driven H Pile) Predrilling (8 nos) (D\$261) CONS.C1.4170. Predrilling (8 nos) (DS261) ■ GI Report and Verification / Agreement to Founding Level CONS.C1.4170. GI Report and Verification / Agreement to Founding Level Piling Works - Driven H Pile (8 nos) CONS.C1.4180 Piling Works - Driven H Pile (8 nos) Excavation, Pile Trimming + Cast Rile Caps (2 nos) CONS.C1.4200 Excavation, Pile Trimming + Cast Pile Caps (2 nos) ■ Backfill Foundation CONS.C1.4210 Backfill Foundation ADS301 (Driven H Pile) Predrilling (12 nos) (ADS301) CONS.C1.4240. Predrilling (12 nos) (ADS301) GI Report and Verification / Agreement to Founding Level CONS.C1.4240. GI Report and Verification / Agreement to Founding Level Pillng Works - Driven H Pile (12 nos) CONS.C1.4250 Piling Works - Driven H Pile (12 nos) CONS.C1.4270 Excavation, Pile Trimming + Cast Pile Caps (3 nos) Excavation, Pile Trimming + Cast Pile Caps (3 nos) CONS.C1.4280 Backfill Foundation Backfill Foundation FADS303 (Driven H Pile) Predrilling (8 nos) (FADS303) CONS.C1.4310. Predrilling (8 nos) (FADS303) CONS.C1.4310. GI Report and Verification / Agreement to Founding Level GI Report and Verification / Agre Piling Works - Driven H Pile (8 nos) CONS.C1.4320 Piling Works - Driven H Pile (8 nos) CONS.C1.4340 Excavation, Pile Trimming + Cast Pile Caps (2 nos) Excavation, Pile Trimming + Cast Pile Caps (■ Backfill Foundation CONS.C1.4350 Backfill Foundation **Erection of Sign Gantry and High Mast for TCS!** CONS.C1.4360 Erection of Sign Gantry & High Mast Structure and Associated Conduits for TCSS Works and Associated Conduits for TCSS Works Drainage and U/G Utilities CONS.RW.2300 Handover area to CLP for HV Cable Laying and Install HV Cable Ducting on Ca CONS.RW.3870 Excavate and Install HV Cable Ducting on Carriageway (West of Pump House - Portion : Excavate and Install HV Cable Ducting on Carriageway (East of Pump House - Portion: A and C) CONS.RW.3880 Excavate and Install HV Cable Ducting on Carriageway (East of Pump House - Portion A

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

CONS.RW.3890 Excavate and Install HV Cable Ducting on Carriageway (East of Pump House - Portion B CONS.RW.3900 Excavate and Install HV Cable Ducting on Carriageway (West of Pump House - Portion Drainage and U/G Utilities (West of Pump Hou Drainage & UU Road SOL 101 / 105 (Phase 1) **Drainage System** CONS.RW.22 Survey/ Road Setting Out Survey/ Road Setting Out CONS.RW.228 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RW.22 Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + **Installation of Underground Utilities** CONS.RW.23 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WM / Valves & fittings; + Testing; Cleaning & Flushing and Interface Co fittings + Testing, Cleaning & Flushing and CONS.RW.23 Excavate and Install Common Telecom Ducting and Telecom Ducting by Others elecom Ducting by Other Excavate and Install ELV/ LV Ducting and Pillar Box for CONS.RW.23 Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS Road SOL 101 / 105 (Phase 2) **Drainage System** CONS.RW.34 Survey/ Road Setting Out Survey/ Road Setting Out CONS.RW.34 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RW.34(Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + **Installation of Underground Utilities** CONS.RW.34(Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Excavate and Install Fresh WM / Valves & fittings + To ng, Cleaning & Flushing a Excavate and Install Common Telecom Ducting and Telecom Ducting by Others CONS.RW.34 Excavate and Install Common Telecom Ducting and Telecom Ducting by Others CONS.RW.34 Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS Excavate and Install ELV/ LV Ducting and Pillar Box for Road SOL 102 /106 /111 and the neigboring la **Drainage System** Survey/ Road Setting Out CONS.RW.24 Survey/ Road Setting Out Road Formation to Sub-grade (Cut & Fill) CONS.RW.242 Road Formation to Sub-grade (Cut & Fill) CONS.RW.24 Excavate to invert level and install Drainage Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) System (Drain Pipes & Catchpit/Manholes) + **Installation of Underground Utilities** Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Interface Connection CONS.RW.29 Excavate and Install Fresh WM / Valves & Excavate and Install Common Telecom Ducting and Telecom Ducting; by Others fittings + Testing, Cleaning & Flushing and CONS.RW.29 Excavate and Install Common Telecom Ducting and Telecom Ducting by Others Excavate and Install ELV/ LV Ducting and Pillar Box for TC\$S CONS.RW.29(Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS Road SOL 102 /106 /111 and the neigboring la **Drainage System** Survey/ Road Setting Out CONS.RW.34 Survey/ Road Setting Out CONS.RW.34 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RW.34 Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + nd install Drainage System (Drain Pipes Installation of Underground Utilities CONS.RW.35(Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flush Excavate and Install Common Telecom Ducting and Telecom Ducting by Others CONS.RW.35 Excavate and Install Common Telecom Ducting and Telecom Ducting by Others Excavate and Install ELV/ LV Ducting and Pillar Box for TC\$S CONS.RW.352 Excavate and Install ELV/ LV Ducting and Pilla Box for TCSS Road SOL 104 (Phase 1) **Drainage System** CONS.RW.24 Survey/ Road Setting Out ■ Survey/ Road Setting Out CONS.RW.24 Road Formation to Sub-grade (Cut & Fill) Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + Testing & Interface Connection CONS.RW.24(Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + Installation of Underground Utilities CONS.RW.24 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Interface Connection fittings + Testing, Cleaning & Flushing and Excavate and Install Flush WM / Valves & fittings + Testing, Cleaning & Flushing and Interface Connection (1 line) CONS.RW.24{ Excavate and Install Flush WM / Valves & fittings + Testing, Cleaning & Flushing and CONS.RW.24 Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS Excavate and Install ELV/LV Ducting and Pillar Box for TCSS Road SOL 104 (Phase 2) **Drainage System** Survey/ Road Setting Out CONS.RW.35¢ Survey/ Road Setting Out Road Formation to Sub-grade (Cut & Fill): CONS.RW.35 Road Formation to Sub-grade (Cut & Fill) CONS.RW.35{ Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + Installation of Underground Utilities CONS.RW.351 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Interface Connection (3 lines) fittings + Testing, Cleaning & Flushing and CONS.RW.35 Excavate and Install Flush WM / Valves & fittings + Testing, Cleaning & Flushing and Excavate and Install Flush WM / Valves & fittings + Testing, Cla Excavate and Install ELV/LV Ducting and Pillar Box for TCSS CONS.RW.35! Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS Undergound Utilties (ELV, Fresh WM & Teleco Work in Portion D1 and D2 Sewage Rising main at Portion D1 16-May-17 Commence Works on Rising Main CONS.RM.101 Commence Works on Rising Main ■ Site Survey / Setting Out Sewerage Alignment CONS.RM.102 Site Survey / Setting Out Sewerage Alignmen CONS.RM.103 Excavate to Invert Level & Install 2 Sewage Rising Main DN100 CHC & CHD Excavate to Invert Level & Install 2 Sewage Rising Main DN100 CHC & CHD Construct Thrust Block CONS.RM.104 Construct Thrust Block Gravity Flow Testing CONS.RM.105 Gravity Flow Testing

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 16/23

Data Date: 06-Oct-16

Print Date: 14-Dec-16 09:47 Page: 17 / 23 CONS.RM.106 Backfill Telecom Crossing at Portion D2 and D1 Excavate and Install Common Telecom Ducting and Telecom Ducting by Telecom Com CONS.RW.28(Excavate and Install Common Telecom Ducting and Telecom Ducting by Telecom Companies Backfill and reinstate ground CONS.RW.282 Backfill and reinstate ground Drainage and U/G Utilities (East of Pump Hous Drainage & UU Road SOL 101 / 109 / 114 (Phase 1) **Drainage System** Survey/ Road Setting Out CONS.RE.101 Survey/ Road Setting Out CONS.RE.102 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RE.103 Excavate to invert level and install Drainage Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + Testing Interface Connection System (Drain Pipes & Catchpit/Manholes) + **Installation of Underground Utilities** CONS.RE.106 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WM / Valves & fittings: + Testing, Cleaning & Flushing and Interface Connection fittings + Testing, Cleaning & Flushing and CONS.RE.107 Excavate and Install Common Telecom Ducting and Telecom Ducting by Others and Install Common Telecom Ducting a Telecom Ducting by Others Excavate and Install ELV/ LV Ducting and Pillar Box for TCS\$ and Road Lighting CONS.RE.108 Excavate and Install ELV/ LV Ducting and Pilla Box for TCSS and Road Lighting Road SOL 101 / 109 / 114 (Phase 2) **Drainage System** CONS.RE.420 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RE.421 Excavate to invert level and install Drainage Excavate to invert level and install [inage System (Drain Pipes & Catchpit/ System (Drain Pipes & Catchpit/Manholes) + Survey/ Road Setting Out CONS.RE.422 Survey/ Road Setting Out **Installation of Underground Utilities** CONS.RE.423 Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Excavate and Install Common Telecom Ducting and Telecom Ducting by Others CONS.RE.424 Excavate and Install Common Telecom Ductin and Telecom Ducting by Others CONS.RE.425 Excavate and Install ELV/ LV Ducting and Pillar Excavate and Install ELV/ LV Ducting and Pillar Bdx for TCSS and Road Lighting Box for TCSS and Road Lighting Road SOL 102 and the area outside the carriage **Drainage System** CONS.RE.197 Survey/ Road Setting Out Survey/ Road Setting Out CONS.RE.198 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RE.199 Excavate to invert level and install Drainage Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + Testing & Interface Connection System (Drain Pipes & Catchpit/Manholes) + Installation of Underground Utilities CONS.RE.289 Excavate and Install Fresh WM / Valves & l; Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Interi fittings + Testing, Cleaning & Flushing and Excavate and Install Common Telecom Ducting and Telecom Ducting by Others CONS.RE.290 Excavate and Install Common Telecom Ductin and Telecom Ducting by Others CONS.RE.291 Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS and Road Lighting Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS and Road Lighting Road SOL 102 and the area outside the carriage **Drainage System** CONS.RE.426 Survey/ Road Setting Out Road Formation to Sub-grade (Cut & Fill) CONS.RE.427 Road Formation to Sub-grade (Cut & Fill) CONS.RE.428 Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + Excavate to invert level and install Dr em (Drain Pipes & Catchpit/Manholes) + Testing & Interface Connecti **Installation of Underground Utilities** CONS.RE.429 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Interface Con fittings + Testing, Cleaning & Flushing and CONS.RE.430 Excavate and Install Common Telecom Ducting and Telecom Ducting by Others Telecom Ducting and Telecom Ducting by Others CONS.RE.431 Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS and Road Lighting Road SOL 107 / 113 (Phase 1) **Drainage System** CONS.RE.200 Survey/ Road Setting Out Survey/ Road Setting Out CONS.RE.201 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RE.202 Excavate to invert level and install Drainage Excavate to invert level and install Drainage System (Drain Pipe System (Drain Pipes & Catchpit/Manholes) + **Installation of Underground Utilities** CONS.RE.204 Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Excavate and Install Fresh WM / Valves & fittings + Testing Cleaning & Flushing and Interface Connection (3 lines) CONS.RE.205 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WIM / Valves & fittings + Testing, Cleaning & Flushing and Interface Cor fittings + Testing, Cleaning & Flushing and CONS.RE.206 Excavate and Install ELV/ LV Ducting and Pillar Box for TCSS Excavate and Install ELV/LV Ducting and Pillar Box for TOSS Road SOL 107 / 113 (Phase 2) **Drainage System** CONS.RE.432 Survey/ Road Setting Out CONS.RE.433 Road Formation to Sub-grade (Cut & Fill) Road Formation to Sub-grade (Cut & Fill) CONS.RE.434 Excavate to invert level and install Drainage Excavate to invert level and install Drainage System (Drain I System (Drain Pipes & Catchpit/Manholes) + Installation of Underground Utilities CONS.RE.435 Excavate and Install Fresh WM / Valves & Excavate and Install Fresh WM / Valves & fittings; + Testing, Cleaning & Flushing and Interface Connection (3 lines) Excavate and Install Fresh:WM / Valves & fittings +: Testing, Cleaning & Flushing and Interface Connection (1 line) fittings + Testing, Cleaning & Flushing and CONS.RE.436 Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and and Install ELV/LV Ducting and Pillar Box for TCSS CONS.RE.437 Excavate and Install ELV/ LV Ducting and Pilla Box for TCSS Road SOL 108 / 106 & SOL 110 Adjacent to Road SOL 108 / 106, Abutment A90 CONS.RE.207 Excavate and Install Common Telecom Ducting Common Telecom Ducting and Telecom and Telecom Ducting by Others + Backfilling CONS.RE.216 Road Formation to subgrade + Drainage Road Formation to subgrade + 'Drainage System' CONS.RE.219 Install TCSS/LV/ELV Ducting ■ Install TC\$S/LV/ELV Ducting Portion A1 and A2 - Sub-Base Area

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 18 / 23 Print Date: 14-Dec-16 09:47 CONS.A1.4430 Demobilisation of Temporary Facilities on Site CONS.A1.4440 Site Survey / Site Clearing Area to Formation Level CONS.A1.4450 Area to Formation Level CONS.A1.4460 Sub-Base Material Topping (Area 29,963 m2 : 100mm thk Subbase) Sub-Base Material Topping (Area 29,963 m2 x 100r Area 3 (in Portion A6) **Drainage System** ■ Survey/ Road Setting Out CONS.RE.4660 Survey/ Road Setting Out Road Formation to Sub-grade (Cut & Fill) CONS.RE.4670 Road Formation to Sub-grade (Cut & Fill) CONS.RE.4680 Excavate to invert level and install Drainage System (Drain Pipes & Catchpit/Manholes) + ■ Excavate to invert leve and install Drainage System (Drain Pipe Installation of Underground Utilities CONS.RE.4690 Excavate and Install ELV/ LV Ducting and Pilla Excavate and Install ELV/, LV Ducting and Pillar Box for TCSS Box for TCSS Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Interface Connec CONS.RE.4700 Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flyshing and Interface Connection CONS.RE.4710 Excavate and Install Fresh WM / Valves & fittings + Testing, Cleaning & Flushing and Area 1 (West of Pump House) (Portion C1) **Road Works** Road SOL 101 / 105 (Phase 1) Kerbing and Footings for Railing, Fencing, Sign CONS.RW.30(Excavate and Construct Footings for Road and Construct Footings for Road Lightings / Railing / Fencing and Signage Lightings / Railing / Fencing and Signages oad Formation to Sub-base CONS.RW.30' Road Formation to Sub-base CONS.RW.301 Construct Precast Road Kerbings Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RW.30 Road Formation to Road Base CONS.RW.304 Road Formation to Base Course Road Formation to Base Course Installation of Railing and Fencing + Road Ligh Install Road Railing and Fencing CONS.RW.30! Install Road Railing and Fencing CONS.RW.30(Install Road Lighting and Signages Install Road Lighting and Signages **Final Paving and Road Markings** CONS.RW.29 Cleaning and Rectification Works ☐ Cleaning and Rectification Work CONS.RW.298 Final Road Paving (Wearing Course) Final Road Paving (Wearing C Road Markings and Road Sig CONS.RW.299 Road Markings and Road Signages Road SOL 101 / 105 (Phase 2) Kerbing and Footings for Railing, Fencing, Sign Road Formation to Sub-bas CONS.RW.36; Road Formation to Sub-base Construct Precast Road Kerbings CONS.RW.36 Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RW.36! Road Formation to Road Base Road Formation to Road Base Road Formation to Base Course CONS.RW.36¢ Road Formation to Base Course Installation of Railing and Fencing + Road Ligh CONS.RW.36 Install Road Railing and Fencing Install Road Railing and Fencing CONS.RW.36{ Install Road Lighting and Signages Install Road Lighting and \$igna **Final Paving and Road Markings** CONS.RW.35 Cleaning and Rectification Works Cleaning and Rectification Work Final Road Paving (Wearing C CONS.RW.36(Final Road Paving (Wearing Course) Road Markings and Road Sigha CONS.RW.36 Road Markings and Road Signages Road SOL 102 /106 /111 (Phase 1) Kerbing and Footings for Railing, Fencing, Sign and Construct Footings for Road Lightings / Railing / Fencing and Signage CONS.RW.32 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages Road Formation to Sub-base CONS.RW.328 Road Formation to Sub-base CONS.RW.32 Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RW.32 Road Formation to Road Base Road Formation to Base Course CONS.RW.32: Road Formation to Base Course Installation of Railing and Fencing + Road Ligh CONS.RW.32 Install Road Railing and Fencing nstall Road Railing and Fehcing CONS.RW.32 Install Road Lighting and Signages Install Road Lighting and Signage Final Paving and Road Markings CONS.RW.32 Final Road Paving (Wearing Course) Final Road Paving (Wearing Course) CONS.RW.32 Road Markings and Road Signages Road SOL 102 /106 /111 (Phase 2) Kerbing and Footings for Railing, Fencing, Sign CONS.RW.37 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages / Railing / Fencing and Signages CONS.RW.37(Road Formation to Sub-base CONS.RW.37 Construct Precast Road Kerbings Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RW.36 Road Formation to Road Base Road Formation to Road Base

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 19 / 23 Print Date: 14-Dec-16 09:47 CONS.RW.37(Road Formation to Base Course Installation of Railing and Fencing + Road Ligh Install Road Railing and Fencing CONS.RW.37 Install Road Railing and Fencing CONS.RW.37. Install Road Lighting and Signages Install Road Lighting and Signages **Final Paving and Road Markings** Final Road Paving (Wearing Course) CONS.RW.37 Final Road Paving (Wearing Course) Road Markings and Road Signages CONS.RW.37 Road Markings and Road Signages Road SOL 104 (Phase 1) Kerbing and Footings for Railing, Fencing, Sign CONS.RW.332 Excavate and Construct Footings for Road Excavate and Construct Footings for Road Lightings Lightings / Railing / Fencing and Signages CONS.RW.33: Road Formation to Sub-base Road Formation to Sub-base CONS.RW.33 Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RW.33 Road Formation to Road Base Road Formation to Road Base Road Formation to Base Course CONS.RW.33¢ Road Formation to Base Course Installation of Railing and Fencing + Road Ligh Install Road Railing and Fencing CONS.RW.33 Install Road Railing and Fencing CONS.RW.338 Install Road Lighting and Signages nstall Road Lighting and Signag **Final Paving and Road Markings** Final Road Paving (Wearing Course) CONS.RW.33(Final Road Paving (Wearing Course) CONS.RW.33 Road Markings and Road Signages Road Markings and Road Signages Road SOL 104 (Phase 2) Kerbing and Footings for Railing, Fencing, Sign CONS.RW.38(Excavate and Construct Footings for Road Excavate and Construct Footings for Road Lightings Lightings / Railing / Fencing and Signages CONS.RW.38 Road Formation to Sub-base Road Formation to Sub-base Construct Precast Road Kerbings CONS.RW.38: Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RW.38 Road Formation to Road Base Road Formation to Base Course CONS.RW.38 Road Formation to Base Course Installation of Railing and Fencing + Road Ligh Install Road Railing and Fencing CONS.RW.38! Install Road Railing and Fencing CONS.RW.38 Install Road Lighting and Signages Install Road Lighting and Signages **Final Paving and Road Markings** CONS.RW.378 Final Road Paving (Wearing Course) inal Road Paving (Wearing Course) CONS.RW.37 Road Markings and Road Signages ■ Road Markings and Road Signages Area 2 (East of Pump House Portion C1, A1, A2 **Road Works** Road SOL 101 / 109 / 114 (Phase 1) Kerbing and Footings for Railing, Fencing, Sign CONS.RE.384 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages Excavate and Construct Footings for Road Lightings / Railing / Fencing and Sign CONS.RE.385 Road Formation to Sub-base Road Formation to Sub-base Construct Precast Road Kerbings CONS.RE.386 Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RE.372 Road Formation to Road Base Road Formation to Base Course CONS.RE.373 Road Formation to Base Course Installation of Railing and Fencing + Road Ligh ■ Install Road Railing and Fencing CONS.RE.374 Install Road Railing and Fencing ■ Install Road Lighting and Signag CONS.RE.375 Install Road Lighting and Signages Road SOL 101 / 109 / 114 (Phase 2) Kerbing and Footings for Railing, Fencing, Sigr CONS.RE.442 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages CONS.RE.443 Road Formation to Sub-base Road Formation to Sub-base CONS.RE.444 Construct Precast Road Kerbings Construct Precast Road Kerbing Road Works to Road Base and Base Course CONS.RE.438 Road Formation to Road Base CONS.RE.439 Road Formation to Base Course Road Formation to Base (Installation of Railing and Fencing + Road Ligh CONS.RE.440 Install Road Railing and Fencing Install Road Railing and Fencing CONS.RE.441 Install Road Lighting and Signages Install Road Lighting Road SOL 102 (Phase 1) Kerbing and Footings for Railing, Fencing, Sign CONS.RE.415 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages nd Construct Footings for Road Lightings / Railing / Fencing and Signages CONS.RE.416 Construct Precast Road Kerbings Construct Precast Road Kerbings CONS.RE.417 Road Formation to Sub-base ad Formation to Sub-base Road Works to Road Base and Base Course CONS.RE.410 Road Formation to Road Base Road Formation to Road Base

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 20 / 23 Print Date: 14-Dec-16 09:47 1 A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J CONS.RE.411 Road Formation to Base Course Installation of Railing and Fencing + Road Ligh CONS.RE.418 Install Road Railing and Fencing Install Road Railing and Fencing CONS.RE.419 Install Road Lighting and Signages ■ Install Road Lighting and Sig **Final Paving and Road Markings** CONS.RE.402 Final Road Paving (Wearing Course) Final Road Paving (Wearing Co Road Markings and Road Signages CONS.RE.403 Road Markings and Road Signages Road SOL 102 (Phase 2) Kerbing and Footings for Railing, Fencing, Sign oad Lightings / Railing / Fencing and Sigr CONS.RE.449 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages Construct Precast Road Kerbings CONS.RE.450 Construct Precast Road Kerbings CONS.RE.451 Road Formation to Sub-base Road Works to Road Base and Base Course CONS.RE.447 Road Formation to Road Base Road Formation to Road Bas Road Formation to Base Course CONS.RE.448 Road Formation to Base Course Installation of Railing and Fencing + Road Ligh CONS.RE.452 Install Road Railing and Fencing Install Road Railing and Fencing Install Road Lighting and \$ignage CONS.RE.453 Install Road Lighting and Signages **Final Paving and Road Markings** CONS.RE.445 Final Road Paving (Wearing Course) Final Road Paying (Wearing Course) Road Markings and Road Signages CONS.RE.446 Road Markings and Road Signages Road SOL 107 / 113 (Phase 1) Kerbing and Footings for Railing, Fencing, Sign CONS.RE.393 Excavate and Construct Footings for Road Excavate and Construct Footings for Road Lightings / Railing / Fencing and Sign Lightings / Railing / Fencing and Signages CONS.RE.394 Road Formation to Sub-base Road Formation to Sub-base CONS.RE.395 Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RE.396 Road Formation to Road Base Road Formation to Base Course CONS.RE.397 Road Formation to Base Course Installation of Railing and Fencing + Road Ligh Install Road Railing and Fencing CONS.RE.398 Install Road Railing and Fencing CONS.RE.399 Install Road Lighting and Signages stall Road Lighting and Signage Final Paving and Road Markings CONS.RE.400 Final Road Paving (Wearing Course) Final Road Paving (Wearing Course) CONS.RE.401 Road Markings and Road Signages Road Markings and Road \$ignages Road SOL 107 / 113 (Phase 2) Kerbing and Footings for Railing, Fencing, Sign CONS.RE.454 Excavate and Construct Footings for Road Lightings / Railing / Fencing and Signages CONS.RE.455 Road Formation to Sub-base Construct Precast Road Kerbing CONS.RE.456 Construct Precast Road Kerbings Road Works to Road Base and Base Course CONS.RE.457 Road Formation to Road Base CONS.RE.458 Road Formation to Base Course Road Formation to Base Course Installation of Railing and Fencing + Road Ligh CONS.RE.459 Install Road Railing and Fencing Install Road Railing and Fencing Install Road Lighting and Signage CONS.RE.460 Install Road Lighting and Signages Final Paving and Road Markings CONS.RE.461 Final Road Paving (Wearing Course) Final Road Paving (Wearing Course) CONS.RE.462 Road Markings and Road Signages Road Markings and Road Signages Road SOL 108 / 106 & SOL 110 Adjacent to Road SOL 108 / 106, Abutment A90 CONS.RE.362 Excavate and Construct footing for Railing and ■ Excavate and Construct footing for Railing and Road lighting CONS.RE.363 Road formation to Subbase Road formation to Subbase CONS.RE.364 Construct Precast Road Kerbings Construct Precast Road Kerbing Road formation to Road base and Base dourse CONS.RE.365 Road formation to Road base and Base course CONS.RE.366 Install Road Lighting, Railing and Signages I Instal Road Lighting, Railing and Signages CONS.RE.367 Final Road Paving and Road markings (KD13 Completion of Section VI) Final Road Paving d Road markings (KD13 Portion A1 and A2 - Sub-Base Area CONS.A1.8710 Demobilisation of Temporary Facilities on Site CONS.A1.8720 Site Survey / Site Clearing Area to Formation Level CONS.A1.8730 Area to Formation Level CONS.A1.8740 Sub-Base Material Topping (Area 29,963 m2 100mm thk Subbase) iterial Topping (Area 29,963 m2 k 100mm thk Subbase) Area 3 (in Portion A6) Final Paving and Road Markings Portion A6 - Final Paving and Road Markings Road Clearing CONS.RE.3780 Road Clearing

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Print Date: 14-Dec-16 09:47 Page: 21 / 23 A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J CONS.RE.3790 Road Base and Final Road Paving to Wearing Course CONS.RE.3800 Road Markings and Road Signages Landscaping and Irrigation System Landscaping - Water Meter W04 Zone AC4 CONS.A1.8120 Commence Landscape Works in Zone AC4 (after Bridgeworks complete) 20-Oct-17: • Ca CONS.A1.8130 Top Soil to Landscaped Areas (600mm) Install Irrigation System Main Lines (900mm dia) CONS.A1.8140 Install Irrigation System Main Lines (900mm CONS.A1.8150 Install Lateral Irrigation Pipes & Sprinklers Install Lateral Irrigation Pipes & Sprinklers Irrigation Coverage Test CONS.A1.8160 Irrigation Coverage Test CONS.A1.8170 Soft Landscaping - Shrubs Planting / Ground Soft Landscaping - Shrubs Planting / Ground Cover CONS.A1.8180 Complete Landscape Works Zone AC4 Zone BC4 CONS.A1.8200 Commence Landscape Works in Zone BC4 CONS.A1.8210 Top Soil to Landscaped Areas Main Lines (900mm dia) CONS.A1.8220 Install Irrigation System Main Lines (900mm CONS.A1.8230 Install Lateral Irrigation Pipes & Sprinklers Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8240 Irrigation Coverage Test CONS.A1.8250 | Soft Landscaping - Shrubs Planting / Ground Soft Landscaping - Shrubs Planting / Ground Cover ♦ d3-Aug-18, Complete Landscape Works in Zone BC4 CONS.A1.8260 | Complete Landscape Works in Zone BC4 Zone CC4 CONS.A1.8280 Commence Landscape Works in Zone CC4 CONS.A1.8290 Top Soil to Landscaped Areas Top Soil to Landscaped Areas CONS.A1.8300 Install Irrigation System Main Lines (900mm CONS.A1.8310 Install Lateral Irrigation Pipes & Sprinklers Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8320 Irrigation Coverage Test Irrigation Coverage Test CONS.A1.8330 | Soft Landscaping - Shrubs Planting / Ground Soft Landscaping - Shrubs Planting / Ground Cover ♦ 03-Aug-18, Complete Landscape Works in Zone CC4 CONS.A1.8340 Complete Landscape Works in Zone CC4 Zone DC4 CONS.A1.8360 | Commence Landscape Works in DC4 Top Soil to Landscaped CONS.A1.8370 Top Soil to Landscaped Areas Install Irrigation System Main Lines (900mm dia) CONS.A1.8380 Install Irrigation System Main Lines (900mm CONS.A1.8390 Install Lateral Irrigation Pipes & Sprinklers Install Lateral Irrigation Pipes & Sprinklers I Irrigation Coverage Test CONS.A1.8400 Irrigation Coverage Test CONS.A1.8410 Soft Landscaping - Shrubs Planting / Ground I Soft Landscaping - Shrubs Planting / Ground Cover CONS.A1.8420 Complete Landscape Works in Portion C1 ♦ 08-Jun-18, Complete Landscape Works in Portion C1 (West S (West Section) Zone EC4 CONS.A1.8440 Commence Landscape Works in Zone EC4 05-May-18 ♦ Comm CONS.A1.8450 Top Soil to Landscaped Areas Install Irrigation System Main Lines CONS.A1.8460 Install Irrigation System Main Lines Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8470 Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8480 | Irrigation Coverage Test CONS.A1.8490 Soft Landscaping - Shrubs Planting / Ground Soft Landscaping - Shrubs Planting / Ground Cover ♦ 12-Jul-18, Complete Landscape Works in Portion C1 (Wes CONS.A1.8500 | Complete Landscape Works in Portion C1 Zone FC4 CONS.A1.8520 Commence Landscape Works in Zone FC4 23-May-18 Comn ence Landscape Works in Zone FC4 CONS.A1.8530 Top Soil to Landscaped Areas Install Irrigation System Main Lines (900mm dia) CONS.A1.8540 Install Irrigation System Main Lines (900mm ■ Install:Lateral Irrigation Pipes & Sprinklers CONS.A1.8550 Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8560 | Irrigation Coverage Test CONS.A1.8570 Soft Landscaping - Shrubs Planting / Ground Soft Landscaping - Shrubs Planting / Ground Cover • 03-Aug-18, Complète Landscape Works in Zone FC4 CONS.A1.8580 Complete Landscape Works in Zone FC4 Landscape Softworks in Portion A6 and B5 CONS.A1.8590 Commence Landscape Works in Zone AC4 in Portion A6 & B5 Clearing of unsuitable materials CONS.A1.8595 Clearing of unsuitable materials Top Soil to Landscaped Areas CONS.A1.8600 Top Soil to Landscaped Areas CONS.A1.8610 Install Irrigation System Main Lines (900mm dia) Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8620 Install Lateral Irrigation Pipes & Sprinklers CONS.A1.8630 Irrigation Coverage Test Irrigation Coverage Test CONS.A1.8640 | Soft Landscaping - Shrubs Planting / Ground 01-Aug-19, Complete Landscape, Works Zone AC4 (KD16) CONS.A1.8650 Complete Landscape Works Zone AC4 (KD16) CONS.A1.8660 Establishment Works for Landscape Softworks in Portion A6 and B5 Landscaping - Water Meter W02 e Landscape Works (Portion C1) 11-Oct-17 ♦ Com CONS.C1.8200 | Commence Landscape Works (Portion C1) CONS.C1.8210 Top Soil to Landscaped Areas Top Sail to Landscaped Areas

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Page: 22 / 23 Print Date: 14-Dec-16 09:47 | A | M | J | A | S | O | N | D | J | F | M | A | M | J | J | A | S | O | N | D | J | F | M | A | M | J | J | A | S | O | N | D | J | F | M | A | M | J | J | A | S | O | N | D | J | CONS.C1.8220 Install Irrigation Main Line + Construct Swale CONS.C1.8230 Install Lateral Irrigation Pipes / Sprinklers CONS.C1.8240 Irrigation Coverage Test Inrigation Coverage Test CONS.C1.8250 Soft Landscaping - Shrubs Planting / Ground | Soft Landscaping - Shrubs Planting / Ground Cove ♦ 15-May-18, Complete Landscape Works in Zone BC4 W02 CONS.C1.8260 Complete Landscape Works in Zone BC4 W02 Zone BC4 in Portion D1 CONS.C1.8600 Commence Landscape Works in Portion D1 CONS.C1.8610 Top Soil to Landscaped Areas Top Soil to Landscaped Areas CONS.C1.8620 Install Irrigation Main Line + Construct Swale nstall Lateral Irrigation Pipes CONS.C1.8630 Install Lateral Irrigation Pipes / Sprinklers ■ Irrigation Coverage Test CONS.C1.8640 Irrigation Coverage Test CONS.C1.8650 Soft Landscaping - Shrubs Planting / Ground • 05-May 18, Complete Landscape Works in Portion D1 of Zone BC4 W02 CONS.C1.8660 Complete Landscape Works in Portion D1 of Zone BC4 W02 CONS.C1.8270 Commence Landscape Works in Zone CC4 Top Soil to Landscaped Areas CONS.C1.8280 Top Soil to Landscaped Areas CONS.C1.8290 Install Irrigation Main Line Install Irrigation Main Line CONS.C1.8300 Install Lateral Irrigation Pipes / Sprinklers Instal Lateral Irrigation Pipe CONS.C1.8310 Irrigation Coverage Test ■ Irrigation Coverage Test Soft Landscaping - Shrubs Planting / Ground CONS.C1.8320 | Soft Landscaping - Shrubs Planting / Ground ◆ 19-Jun-18, Complete Landscape Works in Zone CC4 CONS.C1.8330 | Complete Landscape Works in Zone CC4 Zone EC4 CONS.C1.8340 | Commence Landscape Works 18-Jan-18 Ocmmence Landscape Works ■ Top Soil to Landscaped Areas CONS.C1.8350 Top Soil to Landscaped Areas CONS.C1.8360 Install Irrigation Main Line Install Irrigation Main Line Install Lateral Irrigation Pipe CONS.C1.8370 Install Lateral Irrigation Pipes / Sprinklers ■ In igation Coverage Test CONS.C1.8380 Irrigation Coverage Test CONS.C1.8390 Soft Landscaping - Shrubs Planting / Ground Shrubs Planting / Ground Cover ♦ 13-Jul-18, Complete Landscape Works in Zone EC4 W02 CONS.C1.8400 Complete Landscape Works in Zone EC4 W02 Zone FC4 CONS.C1.8410 Commence Landscape Works Top Soil to Landscaped Areas CONS.C1.8420 Top Soil to Landscaped Areas CONS.C1.8430 Install Irrigation Main Line Install Irrigation Main Line Install Lateral Irrigation Pip CONS.C1.8440 Install Lateral Irrigation Pipes / Sprinklers CONS.C1.8450 Irrigation Coverage Test I Irrigation Coverage Test CONS.C1.8460 | Soft Landscaping - Shrubs Planting / Ground CONS.C1.8470 | Complete Landscape Works in Zone FC4 W02 O3-Aug-18, Complete Landscape Works in Zone FC4 W0 **Irrigation Water Tanks and Booster Pumps** CONS.C1.8790 Identify and Agree location with Engineer ■ Identify and Agree location with Engineer CONS.C1.8800 | Construct Irrigation Water Tanks and Booster Construct Irrigation Water Tanks and Booster Pump Chamber CONS.C1.8810 MEP Works - Electrical and Mechanical Installation + T&C MEP Works - Electrical and Mecha Establishment Period (1 year) CONS.C1.8190 Establishment of Landscape Works Establishment of Landscape Works **Executive Summary Box Culverts Box Culvert D** Box Culvert D - Bored Piling, Testing + Pile caps (Bay 1-15) BCD.ES.1010 Box Culvert D - Bored Piling, Testing + Pile caps (Bay 1-15) Box Culvert D.- RC Box Structure + Backfilling (Bay 1-15) BCD.ES.1020 Box Culvert D - RC Box Structure + Backfilling BCD.ES.1030 Box Culvert D - Bored Piling + Pile Testing (Bay Box:Culvert D - Bored Piling + Pile Testing (Bay 1-3) ■ Bok Culvert D - Cofferdam + ELS (Bay 1-3 + Outfall) BCD.ES.1040 Box Culvert D - Cofferdam + ELS (Bay 1-3 + Outfall) Box Culvert D - Pile Caps + RC Box Structure (Bay 1-3 + Outfall) BCD.ES.1050 Box Culvert D - Pile Caps+ RC Box Structure (Bay 1-3 + Outfall) **Box Culvert C** Box Culvert C - Driven H Pile + Pile caps (Bay 4-8) BCC.ES.2010 Box Culvert C - Driven H Pile + Pile caps (Bay 4-8) Box Culvert C - Construct RC Box Structure (Bay 4-8) Box Culvert C BCC.ES.2020 Construct RC Box Structure (Bay 4-8) Box Culvert C - Driven H Pile + Load Testing (Bay 1-3) BCC.ES.2030 Box Culvert C - Driven H Pile + Load Testing (Bay 1-3) BCC.ES.2040 Box Cullvert C - Cofferdam + ELS (Bay 1-3 + Box Cullvert C - Cofferdam + ELS (Bay 1-3 + Outfall) Outfall) BCC.ES.2050 Box Cullvert C - Pilecaps + RC Box Structure (Bay 1-3 + Outfall) **Bridge Works Bridges in Portion A & B** BRG.ES.1010 Bridges in Portion A & B - Bored Piling + Pilecaps BRG.ES.1020 Bridges in Portion A & B - Column / Pier Head Bridges in Portion A & B - Column / Pier Head; + Bearings BRG.ES.1030 Bridges in Portion A & B - Decking / Segments Erection + Stitching Decking / Segments Erection BRG.ES.1040 Bridges in Portion A & B - Parapet + Ancillary n Portion A & B - Parapet Works Bridges in Portion C & D ridges in Portion C & D - Bored Piling BRG.ES.2010 Bridges in Portion C & D - Bored Piling + Pilecaps BRG.ES.2020 Bridges in Portion C & D - Column, Pier Head + Bridges in Portion € & D - Column, Pier Head + Bearings Bearings

HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion)

Data Date: 06-Oct-16 HY/2013/04 - Hong Kong Boundary Crossing Facilities Infrastructure Works Stage II (Southern Portion) Print Date: 14-Dec-16 09:47 Page: 23 / 23 Bridges in Portion C & D - Decking / Segments Erection + Stitching BRG.ES.2030 BRG.ES.2040 Bridges in Portion C & D - Parapet + Ancillary Road Works - East of Pump House RDE.ES.1010 Road Works East of Pump House - Road Road Works East of Pump House Road Formation + Drainage Formation + Drainage RDE.ES.1020 Road Works East of Pump House - U/G Utilities Road Works East of Pump House - U/G Utilities RDE.ES.1030 Road Works East of Pump House - Road Formation to Sub-base + Kerbing Poad Works East of Pump House - Road Formation to Base Course + Fencing, Railing & Road Lighting RDE.ES.1040 Road Works East of Pump House - Road Formation to Base Course + Fencing, Railing & Road Works East of Pump House + Final Paving + Road Marking & Signage: RDE.ES.1050 Road Works East of Pump House - Final Paving + Road Marking & Signages Road Works - West of Pump House RDW.ES.2010 Road Works West of Pump House - Road Road Works West of Pump House - Road Formation + Drainage RDW.ES.2020 Road Works West of Pump House - U/G Road Works West of Pump House - U/G Utilities Utilities RDW.ES.2030 Road Works West of Pump House - Road Road Works West of Pump House Road Formation to Sub-base + Kerbing Formation to Sub-base + Kerbing RDW.ES.2040 Road Works West of Pump House - Road Formation to Base Course + Fencing, Railing & Road Works West of Rump House - Road Formation to Base Course + Fencing, Railing & Road Lighting Road Works West of Pump House - Final Paving + Road Marking & Signages RDW.ES.2050 Road Works West of Pump House - Final Paving + Road Marking & Signages SGW.ES.1010 Sign Gantry - Driven H-Pile Sign Gantry - Driven H-Pile Sign Gantry - Pile caps SGW.ES.1020 Sign Gantry - Pile caps SGW.ES.1030 Sign Gantry - Erection of Sign Gantry Sign Gantry - Erection of Sign Gantr **Retaining Walls** Retaining Walls in Portion A (East) Retaining Walls in Portion A - Excavation RWW.ES.1040 Retaining Walls in Portion A - Excavation RWW.ES.1050 Retaining Walls in Portion A - Construct Base Retaining Walls in Portion A - Construct Base + Wall Stem + Wall Stem RWW.ES.1060 Retaining Walls in Portion A - Backfill and Retaining Walls in Portion A - Backfill and Reinstate Road Reinstate Road Retaining Walls in Portion C (West) Retaining Walls in Portion C - Excavation RWW.ES.1010 Retaining Walls in Portion C - Excavation Retaining Walls in Portion C - Construct Base + Wall Stem RWW.ES.1020 Retaining Walls in Portion C - Construct Base RWW.ES.1030 Retaining Walls in Portion C - Backfill and Reinstate Road Retaining Walls in Portion 🤄 - Backfill a **Depressed Road** DRE.ES.1010 Construction of Depressed Road (Stage 1) Construction of Depressed Road DRW.ES.1010 Construction of Depressed Road (Stage 2) PHO.ES.1010 Construction of Pump House Irrigation and Landscape Landscape Works - Water Meter O4 LSW.ES.1010 Irrigation & Landscape Works WM04 - Top Soi ■ Irrigation & Landscape Works WM04 - Install Irrigation Lines (Main & Lateral LSW.ES.1020 Irrigation & Landscape Works WM04 - Install Irrigation Lines (Main & Lateral) LSW.ES.1030 Irrigation & Landscape Works WM04 - Soft Landscaping Works (AC4 to FC4) Irrigation & Landscape Works WM04 - Soft Landscaping Landscape Works - Water Meter 02 LSW.ES.2010 | Irrigation & Landscape Works WM02 - Top Soi Irrigation & Landscape Works WM02 - Top LSW.ES.2020 Irrigation & Landscape Works WM02 - Install Irrigation Lines (Main & Lateral) rrigation & Landscape Works WM02 - Install Irrigation Lines (Main & Lateral) LSW.ES.2030 Irrigation & Landscape Works WM02 - Soft Landscaping Works (BC4 to FC4)

Appendix D. Event and Action Plan

Event/Action Plan for Air Quality Monitoring

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily.	 Check monitoring data submitted by ET; Check Contractor's working method. 	Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.
Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurement s to confirmfindings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate.

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
1. Exceedance for one sample	1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform ER, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate.
2. Exceedance for two or more consecutive samples	 Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractoron the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirmreceipt of notification of failure in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

Event / Action Plan for Construction Noise Monitoring

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level	Contractor; 2. Identify source,		notification of failure in writing; 2. Notify Contractor;	1. Submit noise mitigation proposals to IEC; 2. Implement noise mitigation proposals.
Limit Level	and Contractor; 2. Identify source; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

Event / Action Plan for Water Quality Monitoring

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action level being exceeded by one sampling day	 Repeat in situ measurement to confirm findings; Identify source(s) of impact; Inform IEC, contractor and ER; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Repeat measurement on next day of exceedance to confirm findings. 	 Check monitoring data submitted by ET and Contractor's working methods; Discuss with ET and Contractor on possible remedial actions; Review the proposed mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. 	 Confirm receipt of notification of noncompliance in writing; Discuss with IEC on the proposed mitigation measures; Make agreement on mitigation measures to be implemented; Ensure mitigation measures are properly implemented. 	 Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Discuss with ET and IEC on possible remedial actions and propose mitigation measures to IEC and ER; Implement the agreed mitigation measures. Amend working methods if appropriate.
Action level being exceeded by two or more consecutive sampling days	 Repeat in situ measurement to confirm findings; Identify source(s) of impact; Inform IEC, Contractor and ER; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Action level; Repeat measurement on next day of exceedance to confirm findings. 	 Check monitoring data submitted by ET and Contractor's working method; Discuss with ET and Contractor on possible remedial actions; Review the proposed mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. 	 Confirm receipt of notification of noncompliance in writing; Discuss with IEC on the proposed mitigation measures; Make agreement on mitigation measures to be implemented; Ensure mitigation measures are properly implemented; Assess the effectiveness of the implemented mitigation measures. 	 Inform the Engineer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Discuss with ET and IEC on possible remedial actions and propose mitigation measures to IEC and ER within 3 working days of notification; Implement the agreed mitigation measures; Amend working methods if appropriate.

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Limit level being exceeded by one sampling day	 Repeat in-situ measurement to confirm findings; Identify source(s) of impact; Inform IEC, Contractor, ER and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level. 	mitigation measures submitted by Contractor and advise	proposed mitigation measures; 3. Request Contractor to critically review the working methods; 4. Ensure mitigation	 Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Submit proposal of mitigation measures to ER within 3 working days of notification and discuss with ET, IEC and ER; Implement the agreed mitigation measures; Amend working methods if appropriate.
Limit level being exceeded by two or more consecutive sampling days	 Repeat <i>in-situ</i> measurement to confirm findings; Identify source(s) of impact; Inform IEC, contractor, ER and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days. 	Contractor's mitigation measures whenever necessary to assure their effectiveness and advise the ER accordingly.	 Confirm receipt of notification of failure in writing; Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Ensure mitigation measures are properly implemented; Assess the effectiveness of the implemented mitigation measures; Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level. 	avoid further exceedance; 3. Rectify unacceptable

Event / Action Plan for Dolphin Monitoring

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level	 Repeat statistical data analysis to confirm findings; Review all available and relevant data, including raw data and statistical analysis results of other parameters covered in the EM&A, to ascertain if differences are as a result of natural variation or previously observed seasonal differences; Identify source(s) of impact; Inform the IEC, ER/SOR and Contractor; Check monitoring data. Review to ensure all the dolphin protective measures are fully and properly implemented and advise on additional measures if necessary. 	 Check monitoring data submitted by ET and Contractor; Discuss monitoring results and finding with the ET and the Contractor. 	1. Discuss monitoring with the IEC and any other measures proposed by the ET; 2. If ER/SOR is satisfied with the proposal of any other measures, ER/SOR to signify the agreement in writing on the measures to be implemented.	

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Limit Level	 Repeat statistical data analysis to confirm findings; Review all available and relevant data, including raw data and statistical analysis results of other parameters covered in the EM&A, to ascertain if differences are as a result of natural variation or previously observed seasonal differences; Identify source(s) of impact; Inform the IEC, ER/SOR and Contractor of findings; Check monitoring data; Repeat review to ensure all the dolphin protective measures are fully and properly implemented and advise on additional measures if necessary. If ET proves that the source of impact is caused by any of the construction activity by the works contract, ET to arrange a meeting to discuss with IEC, ER/SOR and Contractor the necessity of additional dolphin monitoring and/or any other potential mitigation measures (e.g., consider to modify the perimeter silt curtain or consider to control/temporarily stop relevant construction activity etc.) and submit to IEC a proposal of additional dolphin monitoring and/or mitigation measures where necessary. 	Contractor the necessity of additional dolphin monitoring and any other potential mitigation measures. 4. Review proposals for additional monitoring and any other mitigation measures submitted by ET and Contractor and advise ER/SOR of the results and findings accordingly. 5. Supervise / Audit the implementation of additional monitoring and/or any other mitigation measures and advise ER/SOR the results and findings accordingly.	additional dolphin monitoring and/or any other mitigation measures submitted by ET and Contractor and verified by IEC, ER/SOR to signify the agreement in writing on such	 Inform the ER/SOR and confirm notification of the non-compliance in writing; Attend the meeting to discuss with ET, IEC and ER/SOR the necessity of additional dolphin monitoring and any other potential mitigation measures. Jointly submit with ET to IEC a proposal of additional dolphin monitoring and/or any other mitigation measures when necessary. Implement the agreed additional dolphin monitoring and/or any other mitigation measures.

Appendix E. Implementation Schedule for Environmental Mitigation Measures (EMIS)

Appendix E – Implementation Schedule of Environmental Mitigation Measures (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Location of the measures	Implementation Status
Air Quality	y			
\$5.5.6.1	A1	The Contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	All construction sites	V
5.5.6.2	A2	2) Proper watering of exposed spoil should be undertaken throughout the construction phase:	All construction sites	V
		 Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; 		
		 Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; 		
		• A stockpile of dusty material should not be extend beyond the pedestrian barriers, fencing or traffic cones;		
		 The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle; 		
		 Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 		
5.5.6.2	A2	When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;	All construction sites	V
		• The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials;		
		 Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously; 		
		 Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; 		
		 Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding; 		
		 Any skip hoist for material transport should be totally enclosed by impervious sheeting; 		
		 Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides 		
5.5.6.2	A2	Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed;	All construction sites	V
		 Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system; and 		
		 Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. 		
5.5.6.3	A3	3) The Contractor should undertake proper watering on all exposed spoil (with at least 8 times per day) throughout the construction phase.	All construction sites	V
5.5.6.4	A4	Engineer to incorporate the controlled measures into the Particular Specification (PS) for the civil work. The PS should also draw the Contractor's attention to the relevant latest Practice Notes issued by EPD.	All construction sites	V
5.5.6.4	A5	5) Implement regular dust monitoring under EM&A programme during the construction stage.	Selected representative dust monitoring station	V (covered by Contract No. HY/2013/01 & HY/2011/03)
5.5.7.1	A6	The following mitigation measures should be adopted to prevent fugitive dust emissions for concrete batching plant:	Selected representative dust	N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Location of the measures	Implementation Status
		 Loading, unloading, handling, transfer or storage of any dusty materials should be carried out in totally enclosed system; 	monitoring station	
		 All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system to meet the emission limits for TSP; 		
		Vents for all silos and cement/pulverised fuel ash (PFA) weighing scale should be fitted with fabric filtering system;		
		• The materials which may generate airborne dusty emissions should be wetted by water spray system;		
		 All receiving hoppers should be enclosed on three sides up to 3m above unloading point; All conveyor transfer points should be totally enclosed; 		
		 All access and route roads within the premises should be paved and wetted; and Vehicle cleaning facilities should be provided and used by all concrete trucks before leaving the premises to wash off any dust on the wheels and/or body. 		
S5.5.2.7	A7	The following mitigation measures should be adopted to prevent fugitive dust emissions at barging point:	All construction sites	N/A
		 All road surface within the barging facilities will be paved; Dust enclosures will be provided for the loading ramp; 		
		Vehicles will be required to pass through designated wheels wash facilities; and		
		Continuous water spray at the loading points.		
	tion Noise (/	· · · · · · · · · · · · · · · · · · ·		
S6.4.10	N1	 1) Use of good site practices to limit noise emissions by considering the following: only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; 	All construction sites	V
		machines and plant (such as trucks, cranes) that may be in intermittent use should be should have been used as global days to a principle.		
		be shut down between work periods or should be throttled down to a minimum; • plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;		
		 silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; 		
		• mobile plant should be sited as far away from NSRs as possible and practicable;		
		 material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. 		
S6.4.11	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of the hoardings shall be properly maintained throughout the construction period.	All construction sites	V
S6.4.12	N3	3) Install movable noise barriers (typically density @ 14kg/m²), acoustic mat or full enclosure close to noisy plants including air compressor, generators, saw.	For plant items listed in Appendix 6D of the EIA report at all construction sites	V
S6.4.13	N4	4) Select "Quiet plants" which comply with the BS 5228 Part 1 or TM standards.	For plant items listed in Appendix 6D of the EIA report at all construction sites	V
S6.4.14	N5	5) Sequencing operation of construction plants where practicable.	All construction sites where practicable	V
	N6	6) Implement a noise monitoring under EM&A programme.	Selected representative noise monitoring station	V (covered by Contract No. HY/2013/01)
Sediment				
S7.3	S1	1) The requirements as recommended in ETWB TC(W) 34/2002 Management of Dredged/Excavated Sediment shall be included in the Particular Specification as appropriate.	All construction sites	V
		Construction Noise)		
S8.3.8	WM1	Construction and Demolition Material The following mitigation measures should be implemented in handling the waste: • Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; • Carry out on-site sorting;	All construction sites	V
		Make provisions in the Contract documents to allow and promote the use of recycled		

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Location of the measures	Implementation Status
		aggregates where appropriate; • Adopt 'Selective Demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible;		
		• Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and		
		 Implement an enhanced Waste Management Plan similar to ETWB TC(W) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. 		
		 In addition, disposal of the C&D materials onto any sensitive locations such as agricultural lands, etc. should be avoided. The Contractor shall propose the final disposal sites to the Project Proponent and get its approval before implementation. 		
S8.3.9- S8.3.11	WM2	C&D Waste • Standard formwork or pre-fabrication should be used as far as practicable in order to minimise the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage.	All construction sites	V
		• The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.		
S8.2.12-	WM3	Chemical Waste	All construction sites	V
S8.3.15		 Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; have a capacity of less than 450 liters unless the specification has been approved by the EPD; and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation. 		
		• The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste; enclosed on at least 3 sides; have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20 % of the total volume of waste stored in that area, whichever is the greatest; have adequate ventilation; covered to prevent rainfall entering; and arranged so that incompatible materials are adequately separated.		
		 Disposal of chemical waste should be via a licensed waste collector; be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers; or be to a reuser of the waste, under approval from the EPD. 		
S8.3.16	WM4	Sewage • Adequate numbers of portable toilets should be provided for the workers. The portable toilets should be maintained in a state, which will not deter the workers from utilizing these portable toilets. Night soil should be collected by licensed collectors regularly.	All construction sites	V
S8.3.17	WM5	General Refuse • General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes.	All construction sites	V
		 A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. 		
		• Aluminium cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible.		
		 Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. In addition, waste separation facilities for paper, aluminium cans, plastic bottles etc., should be provided. 		
		 Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including reduction, reuse and recycling of wastes. 		

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures		Location of the measures	Implementation Status	
Water Quality (Construction Phase)						

S9.11.1.1 W1

Mitigation during the marine works to reduce impacts to within acceptable levels have Marine works been recommended and will comprise a series of measures that restrict the method and sequencing of dredging/backfilling, as well as protection measures. Details of the measures are provided below.

• Floating type perimeter silt curtains shall be around the HKBCF site before the commencement of marine works.

· Silt curtain shall be fully maintained throughout the works.

S9.11.1.7 W2 Land Works

General construction activities on land should also be governed by standard good working practice. Specific measures to be written into the works contracts should include

- wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters;
- sewage effluent and discharges from on-site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the W PCO or collected for disposal offsite. The use of soakaways shall be avoided;
- storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks:
- silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including specifically at the onset of and after each rainstorm:
- temporary access roads should be surfaced with crushed stone or gravel;
- rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;
- measures should be taken to prevent the washout of construction materials, soil, silt or debris into any drainage system;
- open stockpiles of construction materials (e.g. aggregates and sand) on site should be covered with tarpaulin or similar fabric during rainstorms;
- manholes (including any newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers:
- · discharges of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system;
- all vehicles and plant should be cleaned before they leave the construction site to ensure that no earth, mud or debris is deposited by them on roads. A wheel washing bay should be provided at every site exit;
- · wheel wash overflow shall be directed to silt removal facilities before being discharged to the storm drain:
- the section of construction road between the wheel washing bay and the public road should be surfaced with crushed stone or coarse gravel;
- · wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects;
- vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the W PCO or collected for off site disposal;
- the Contractors shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately;
- waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance:
- all fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank; and
- surface run-off from bunded areas should pass through oil/grease traps prior to discharge to the stormwater system.

Land-based works areas

٧

S9.14

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Location of the measures	Implementation Status
Ecology (0	Constructio	n Phase)		
S10.7	E2	 Install silt curtain during the construction. Limit dredging and works fronts. Good site practices. Site runoff control. 	Marine works and Land-based works areas	V
S10.7	E4	Watering to reduce dust generation; prevention of siltation of freshwater habitats; Site runoff should be desilted, to reduce the potential for suspended sediments, organics and other contaminants to enter streams and standing freshwater	Land-based works areas	V
S10.7	E5	Good site practices, including strictly following the permitted works hours, using quieter machines where practicable, and avoiding excessive lightings during night time	Land-based works areas	V
S10.7	E6	Dolphin Exclusion Zone; Dolphin watching plan		V
S10.7	E7	Decouple compressors and other equipment on working vesselsAvoidance of percussive piling	Marine works	V
S10.7	E8	 Control vessel speed Skipper training Predefined and regular routes for working vessels; avoid Brother Islands. 	Marine Traffic	V
S10.10	E9	Dolphin vessel monitoring	North Lantau and West Lantau	V (covered by Contract No. HY/2013/01)
Fisheries				
S11.7	F4	 Maritime Oil Spill Response Plan (MOSRP); Contingency plan.	HKBCF	V
_andscap	e & Visual (l	Detailed Design Phase)		
		 Transplanting of mature trees in good health and amenity value where appropriate and reinstatement of areas disturbed during construction by compensatory hydroseeding and planting; Protection measures for the trees to be retained during construction activities; Optimizing the sizes and spacing of the bridge columns; Fine-tuning the location of the bridge columns to avoid visually-sensitive locations; Maximizing new tree, shrub and other vegetation planting to compensate tree felled and vegetation removed; Providing planting area around peripheral of HKBCF for tree planting screening effect; Providing salt-tolerant native trees along the planter strip at affected seawall and newly reclaimed coastline; For HKBCF, providing aesthetic architectural design on the related buildings (e.g. similar materials for PCB building facade to Airport buildings, roof planting and subtle materials for other facilities buildings and so on), and the related infrastructure (e.g. parapet planting and transparent cover for elevated footbridges) to provide harmonious atmosphere of the HKBCF; and Fine-tuning the sizes of the structural members to minimize the bulkiness of buildings and adjustment of building arrangement to minimise disturbance to surrounding vegetation in the HKBCF. 		
Landscap	e & Visual (Construction Phase)		
S14.3.3.3		Mitigate both Landscape and Visual Impacts	HKBCF	N/A
		G1. Grass-hydroseed bare soil surface and stock pile areas. G2. Add planting strip and automatic irrigation system if appropriate at some portions of bridge footbridge to screen bridge and traffic. G3. Not applicable as this is for HKLR. G4. For HKBCF, providing aesthetic architectural design on the related buildings (e.g. similar materials for PCB building facade to Airport buildings, roof planting and subtle materials for other facilities buildings and so on), and the related infrastructure (e.g. parapet planting and transparent cover for elevated footbridges) to provide harmonious atmosphere of the HKBCF G5. Vegetation reinstatement and upgrading to disturbed areas G6. Maximizing new tree shrub and other vegetation planting to compensate tree felled and vegetation removed G7. Providing planting area around peripheral of HKBCF for tree planting screening		

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Location of the measures	Implementation Status
		effect;		
		G8. Plant salt-tolerant native and shrubs etc along the planter strip at affected seawall. G9. Reserve of loose natural granite rocks for re-use. Provide new coastline to adopt		
		"natural-look" by means of using armour rocks in the form of natural rock materials and planting strip area accommodating screen buffer to enhance "natural-look" of the new coastline.		
S14.3.3.3	LV3	Mitigate Visual Impacts		N/A
		V1. Minimize time for construction activities during construction period.		
		V2. Provide screen hoarding at the portion of the project site / works areas / storage areas near VSRs who have close low-level views to the Project during HKBCF construction.		
EM&A				
S15.2.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	All construction sites	V
S15.5 -	EM2	1) An Environmental Team needs to be employed as per the EM&A Manual.	All construction sites	V
S15.6		2) Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures.		
		 An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with. 		
Legend:	V = implen	nented; x = not implemented; N/A = not applicable		

Appendix F. Site Audit Findings and Corrective Actions

Appendix F – Site Audit Findings and Corrective Actions

Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control mitigation measures for the project. During the reporting period, site inspections were carried out on 3, 10, 15, 24 and 31 January, 9, 12, 22 and 28 February and 7, 14, 19 and 28 March 2018.

Particular observations during the site inspections are described below.

29 December 2017

a. A stockpile of C&D material was observed near P105 (Bridge D1). Subsequently, the C&D material was cleared. The observation was closed on 3 January 2018.

3 January 2018

- a. Spreading of dust was observed at haul road near P104 (Bridge D1). Subsequently, the haul road near P104 (Bridge D1) has been water spray to ensure wet surface. The observation was closed on 10 January 2018.
- b. Loose general refuse was observed near the pump house area. Subsequently, the general refuse was cleared. The observation was closed on 10 January 2018.

10 January 2018

a. Uncovered C&D waste was observed near the bridge D8. Subsequently, the C&D waste was cleared. The observation was closed on 15 January 2018.

15 January 2018

- a. The Contractor was reminded to display a sign of temporary stop in the vicinity of wheel washing facilities. Subsequently, the sign of temporary stop in the vicinity of wheel washing area was provided. The observation was closed on 24 January 2018.
- b. The Contractor was reminded to provide watering on road at Bridge D1. Subsequently, water spray was provided. The observation was closed on 24 January 2018.
- c. The Contractor was reminded to clear the general refuse inside the gully on the deck of Bridge D1. Subsequently, the general refuse was cleared. The observation was closed on 24 January 2018.
- d. C&D materials were accumulated on the deck of Bridge D1. Subsequently, the C&D materials were sorted and enclosed. The observation was closed on 24 January 2018.
- e. The Contractor was reminded to provide chemical container with drip tray at Box Culvert C. Subsequently, the chemical container was removed. The observation was closed on 24 January 2018.
- f. The Contractor was reminded to display the appropriate NRMM label affixed on the generator at Box Culvert C. Subsequently, the appropriate NRMM label was affixed. The observation was closed on 24 January 2018.

24 January 2018

- a. Poor house keeping including loose general refuse was observed near pump house area. Subsequently, the general refuse was cleared. The observation was closed on 22 February 2018.
- b. Loose general refuse was observed at Box Culvert C area. The Contractor was reminded to clear the general refuse as soon as possible. Subsequently, the general refuse was cleared. The observation was closed on 31 January 2018.

31 January 2018

a. Loose general refuse was observed near A801 area. The Contractor was reminded to clear the general refuse as soon as possible. Subsequently, the general refuse was cleared. The observation was closed on 9 February 2018. b. Loose general refuse was observed near pump house area at P805. The Contractor was reminded to clear the general refuse as soon as possible. Subsequently, the general refuse was cleared. The observation was closed on 9 February 2018.

9 February 2018

- a. Dust emission was observed near Bridge P14 area. The Contractor was reminded to provide water spraying near Bridge P14 area. Subsequently, Water spraying has been provided near Bridge P14 area regularly. The observation was closed on 22 February 2018.
- b. Unsorted C&D materials were observed near Box Culvert C area. The Contractor was reminded to sort the C&D materials on site. Subsequently, the C&D materials were removed. The observation was closed on 12 February 2018.

12 February 2018

- a. Fugitive dust was generated when vehicles passed through the haul road between wheel washing facilities and Box Culvert C. The Contractor was reminded to provide watering on haul road frequently. Subsequently, water spraying has been provided on the haul road. The observation was closed on 22 February 2018.
- b. A generator without valid NRMM label was observed in the vicinity of Box Culvert C. The Contractor was reminded to affix valid NRMM label. Subsequently, the generator was removed from site. The observation was closed on 22 February 2018.
- c. Dark smoke emission from generator was observed in the vicinity of Box Culvert C. The Contractor was reminded to maintain plants/equipment in a good condition. Subsequently, the generator with dark smoke emission near Box Culvert C was fixed. The observation was closed on 22 February 2018.
- d. A chemical container without provision of drip tray was observed in the vicinity of Box Culvert C. The Contractor was reminded to provide drip tray. Subsequently, the chemical container was removed from site. The observation was closed on 22 February 2018.
- e. General refuse was scattered in the vicinity of Box Culvert C. The Contractor was reminded to dispose of general refuse properly. Subsequently, the general refuse was cleared. The observation was closed on 22 February 2018.
- f. C&D materials mixed with general refuse were observed at P803. The Contractor was reminded to sort general refuse out of C&D materials properly. Subsequently, the C&D materials were sorted and the general refuse was removed. The observation was closed on 22 February 2018.

22 February 2018

a. Dark smoke emission was observed from a lifting vehicle near P802 area. Subsequently, the lifting vehicle was removed from site. The observation was closed on 28 February 2018.

28 February 2018

- a. Accumulation of stagnant water was observed near Bridge P1305. Subsequently, the stagnant water near Bridge P1305 was cleared and sand was used to fill up the holes to prevent formation of stagnant water. The observation was closed on 7 March 2018.
- b. Dust emission at haul road near Bridge P1411 was observed. Subsequently, water spraying was provided. The observation was closed on 7 March 2018.

7 March 2018

- a. A chemical container without drip tray was observed near Box Culvert C. The Contractor was reminded to provide drip tray for the chemical container. Subsequently, the chemical container near Box Culvert C was removed. The observation was closed on 14 March 2018.
- b. Loose general refuse was observed near depressed road. Subsequently, the loose general refuse near depressed road was cleared. The observation was closed on 14 March 2018.
- c. The wetsep near the wheel washing bay was not in operation. Subsequently, the wetsep near the wheel washing bay was set in operation. The observation was closed on 14 March 2018.

14 March 2018

- a. Accumulation of general refuse without covering was observed near bridge P803. Subsequently, clearance of the accumulated general refuse was conducted. The observation was closed on 19 March 2018.
- b. Sand was observed near the storm drainage channel on the paved haul road. Subsequently, the sand was cleared. The observation was closed on 19 March 2018.
- c. Loose general refuse was observed near pump house area. Subsequently, the loose general refuse was cleared. The observation was closed on 19 March 2018.

19 March 2018

- a. Haul road next to Bridge D1 was dusty. Subsequently, water spraying was provided. The observation was closed on 28 March 2018.
- b. Chemical containers near P1302 were on bare ground. Subsequently, the containers were removed. The observation was closed on 28 March 2018.
- c. The size of a NRMM label on a generator near P1005 appeared to be smaller than the required dimensions. Subsequently, a correct size of NRMM label was provided. The observation was closed on 28 March 2018.
- d. A waste skip near P1008 was full and additional loose C&D waste was observed nearby. Also, loose general refuse was observed near P1302. Subsequently, the general refuse and loose C&D waste were cleared. The observation was closed on 28 March 2018.

28 March 2018

- a. Accumulation of general refuse without covering was observed near P803. The Contractor was reminded to clear the general refuse as soon as possible. Follow-up actions for the outstanding observation will be inspected during the upcoming site inspections and reported in the coming reporting period.
- b. Accumulation of stagnant water was observed at the gully on the deck of bridge D15. The Contractor was reminded to clear the stagnant water as soon as possible. Follow-up actions for the outstanding observation will be inspected during the upcoming site inspections and reported in the coming reporting period.
- c. Loose general refuse was observed between bridge D9c and bridge D14. The Contractor was reminded to clear the general refuse as soon as possible. Follow-up actions for the outstanding observation will be inspected during the upcoming site inspections and reported in the coming reporting period.
- d. Accumulation of C&D waste was observed on the deck of bridge D15. The Contractor was reminded to clear the C&D waste as soon as possible. Follow-up actions for the outstanding observation will be inspected during the upcoming site inspections and reported in the coming reporting period.

Appendix G. Waste Flow Table

Name of Department: Highways Department

Contract No.: HY/2013/04

Monthly Summary Waste Flow Table for 2018

		Actual Qua	Intities of Inert C&D	Materials Generate	ed Monthly			Actual Quantitie	s of C&D Wastes G	enerated Monthly	
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Transported to other Projects (Note 2)	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (Note 1)	Chemical Waste	Others, e.g. general refuse
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m ³)
Jan	0	0	0	0	0	0	0	0	0	0	0.1293
Feb	0	0	0	0	0	0	0	0	0	0.2	0.1397
Mar	0	0	0	0	0	0	0	0	0	0	0.1346
Apr											
May											
Jun											
Sub-total	0.000	0	0	0.000	0	0	0	0	0	0.2	0.4036
Jul											
Aug											
Sep											
Oct											
Nov											
Dec											
Total	0.000	0	0	0.000	0	0	0	0	0	0.2	0.4036

Note:

⁽¹⁾ Plastics refer to plastic bottles / containers, plastic sheets / foam from packaging material

^{(2) &}quot;Other Projects" refers to HKBCF Contract No. HY/2013/03

Name of Department: Highways Department

Contract No.: HY/2013/04

Monthly Summary of Excavated Marine Sediment for 2018

Month	a. Estimated Volume of Excavated Marine Sediment Generated	b. Estimate Volume of Accumulated Excavated Marine Sediment Treated	c. Reused in the Contract	d. Estimated Volume of Excavated Marine Sediment Transported to Other Projects (Note 1)	e. Estimated Volume of Treated Excavated Marine Sediment Stored on Site (Unused)
	(in m³)	(in m³)	(in m³)	(in m³)	(in m³)
Jan	0	0	0	0	0
Feb	0	0	0	0	0
Mar	0	0	0	0	0
Apr					
May					
Jun					
Sub-total	0	0	0	0	0
Jul					
Aug					
Sep					
Oct					
Nov			•		
Dec			•		
Total	0	0	0	0	0

Note:

^{(1) &}quot;Other Projects" refers to HKBCF Contract No. HY/2013/03. The disposal of excavated marine sediments to allocated dumping site via Contract No. HY/2013/03 has been completed with the last batch disposal on 30 August 2017.

Appendix H. Environmental Licenses and Permits

Environmental Licences and Permits

Item No.	Type of Permit / Licence	Reference No.	Application Date	Valid from	Valid until	Remark
1	Environmental Permit under EIAO	EP-353/2009/K	24 Mar 2016	11 Apr 2016	N/A	Issued
2	Construction Dust Notification (HKBCF Southern Portion)	387156	26 Mar 2015	1 Apr 2015	N/A	Notified
3	Construction Waste Disposal Account	7022038	16 Mar 2015	1 Apr 2015	N/A	Account approved
4	Registration as a Chemical Waste Producer (HKBCF Southern Portion)	Waste Producer Number (WPN): 5213-951-C3952-01	27 Mar 2015	27 Apr 2015	N/A	Registration completed
5	Discharge Licence under WPCO (Works Area WA3)	WT00022316-2015	1 Jun 2015	14 Aug 2015	31 Aug 2020	Issued
6	Discharge Licence under WPCO (HKBCF Works Area)	WT00028782-2017	25 May 2017	19 Jul 2017	31 Jul 2022	Issued
7	Construction Noise Permit	GW-RS0945-17	16 Oct 2017	1 Nov 2017	30 Apr 2018	Issued

Appendix I. Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions

Statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions

Reporting Period	Complaints	Notifications of Summons	Successful Prosecutions
This reporting period	1	0	0
From commencement date of construction to end of reporting month	9	0	0